I 29.88:EL 5/V.4/APP.A/PT.1
pt. 1
Clemson University
3 1604 019 703 224

existing condition survey

units 2, 3, and 4
volume 4
appendix A
part one

PUBLIC DOCUMENTS
DEPOSITORY ITEM
FEB 27 1989
CLEMSON
LIBRARY

ELLIS ISLAND

STATUE OF LIBERTY

NATIONAL MONUMENT/NEW YORK-NEW JERSEY

Funds for preparation and printing of this document were provided by a donation from the Statue of Liberty/Ellis Island Foundation

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT

EXISTING CONDITION SURVEY
UNITS 2, 3 AND 4

Volume 4
Appendix A
Part One

Prepared by

Beyer Blinder Belle/
Anderson Notter Finegold

U.S. Department of the Interior / National Park Service

Existing Condition Survey

Acknowledgement

This document was prepared for the United States Government, National Park Service, Denver Service Center, preparatory to development of preservation plans for the Units 2, 3 and 4 buildings and as part of the architectural/engineering technical services to the National Park Service.

The survey was conducted November 1985 - January 1986, and May 1986. Work was performed by the following staff members of Beyer Blinder Belle/Notter Finegold Alexander Inc., Architects: John H. Stubbs, developed the survey forms and methodology; Rose-Marie Ballard and Caroline Kane conducted the survey and prepared the report; Caroline Kane served as project photographer and Scott Duenow, Jorge Sein and Kelly Sarver executed the documentary drawings and various graphic presentations.

EXISTING CONDITION SURVEY

TABLE OF CONTENTS

PAGE

Part I

I. Introduction.....1

II. Survey Methodology

A. Explanation of Forms.....3

B. Definition of Existing Conditions.....5

Floor - Tile.....6

Floor - Wood.....7

Floor - Linoleum.....8

Floor & Base - Resilient Tile.....9

Base - Wood.....10

Base & Walls - Tile/Tile Wainscot.....11

Walls & Ceilings - Plaster.....12

Walls & Ceilings - Gypsum Board/
Glazed Wood Partitions/Acoustic Panels.....13

Doors/Openings - Wood/Glass Panelled.....14

Doors/Openings - Wood Veneer.....15

Doors/Openings - Galvanized Metal.....16

Lighting Fixtures.....17

Heating/Ventilation/Plumbing.....21

C. Definitions of Architectural Significance.....26
Areas of Most Architectural Significance.....27
Areas of Some Architectural Significance.....28
Areas of Minor Architectural Significance.....29
Areas of Negligible Architectural Significance.....30

III. Inventory & Plans Building
A. Ferry House
1. Plan Depicting Existing Conditions
First Floor.....31
2. Plan Depicting Architectural Significance
First Floor.....32
3. Inventory
First Floor.....33

B. Administration Building
1. Floor Plans
Second Floor.....57
Third Floor.....58
2. Inventory
Second Floor.....59
Third Floor.....77

C. New Hospital Extention

1. Plans Depicting Existing Conditions

Basement.....127
First Floor.....128
Second Floor.....129
Third Floor.....130

2. Plans Depicting Architectural Significance

First Floor.....131
Second Floor.....132
Third Floor.....133

3. Inventory

Basement.....134
First Floor.....140
Second Floor.....218
Third Floor.....280

Part II

D. Staff House

1. Plans Depicting Existing Conditions

First Floor.....360

Second Floor.....361

2. Plans Depicting Architectural Significance

First Floor.....358

Second Floor.....359

3. Inventory

First Floor.....362

Second Floor.....388

E. Immigrant Building

1. Plans Depicting Existing Conditions

First Floor.....424

2. Plan Depicting Architectural Singificance

First Floor.....425

3. Inventory

First Floor.....426

F. Recreation Building
1. Plans Depicting Existing Conditions
First and Second Floor.....560

2. Plans Depicting Architectural Significance
First and Second Floor.....561

3. Inventory
First Floor.....562
Second Floor.....596

IV. Revised Interior Condition Survey
A. Explanation of Forms.....606
1. Inventory.....607

V. Exterior Condition Survey
A. Explanation of Forms.....618
1. Inventory.....619

Digitized by the Internet Archive
in 2012 with funding from
LYRASIS Members and Sloan Foundation

http://archive.org/details/existingconditiov4appapt1

INTRODUCTION

"Existing Condition Survey: Units 2, 3 and 4" presents the results of the field documentation of existing conditions for the interiors and exteriors of the buildings of Units 2, 3 and 4 completed November 1985-May 1986 by Beyer Blinder Belle/Notter Finegold Alexander, Inc. under contract to the National Park Service/United States Department of the Interior. This document serves as an appendix to be read in conjunction with the main body of HSR III, "Historic Structures Report: Units 2, 3 and 4".

This survey provides a definitive record of existing conditions for all interior spaces of buildings surveyed as of December 1985: the ferry house, the new hospital extension of Unit 2, the staff house of Unit 3, and the immigrant and recreation buildings of Unit 4. In addition, each space surveyed was evaluated for architectural significance. This information is presented in summary form on graphically-coded plans that illustrate the relative condition and architectural significance of each space.

Observations recorded in this study will also help to identify appropriate design parameters for alternative space utilization at the time when new uses are proposed for these structures and should serve as a basis for rehabilitation cost analysis.

Due to a potential asbestos hazard to the BBB/NFA team, the usual "Existing Condition Survey" of the interior spaces of nineteen of the buildings of Units 2, 3 and 4 was not conducted. These buildings are: the hospital outbuilding, psychopathic ward, and main hospital building of Unit 2, office building, mortuary, powerhouse and laundry building, measles ward buildings, administration building, kitchen and the three isolation wards of Unit 3. Twelve survey forms were completed for the main hospital building of Unit 2 and 23 forms for isolation ward K. These forms were used in the

preparation of the interior conditions sections of the text of HSR III and were not reproduced as part of the existing condition survey report. The survey of the administration building of Unit 2 was limited to the second and third floors with photography limited to the third floor only. The first floor was not documented, having been recently renovated and occupied by the National Park Service. The survey forms for the administration building are included in this document.

For all buildings affected by the asbestos restriction, a new form was created for the interior existing condition survey which treated the survey on a building-by-building basis rather than room-by-room. Information to complete this form was gleaned from archival documents, prior historic structures reports and field observations conducted prior to the asbestos restrictions. The completed form offers a descriptive summary of the interior spaces, finishes and interior conditions of each building. Some assumptions as the conditions were made based on prior field observation of these and similarly constructed and sited buildings on the island.

In addition to the previously described interior survey work, a new survey method was developed which records the exterior of each of the 26 structures of Units 2, 3 and 4, and provides an assessment of the conditions of their architectural finishes. The results of this survey have been recorded on survey forms which offer a summary of the types, levels and locations of exterior deterioration as well as a relative assessment of condition for each material and for the building as a whole. Both the revised interior condition forms and the exterior condition survey forms are included in this report.

EXPLANATION OF FORMS

This interior architectural survey for all buildings surveyed within Units 2, 3 and 4 consists of a room-by-room analysis of all visually accessible finishes, decorative trim, door, lighting, plumbing and heating equipment. Approximately 287 survey forms were completed at the site. On these, the room number, last known use, square footage, ceiling height and date of survey are recorded. The surface materials in each space are described and assessed for their existing condition and approximate date. A summary condition description and date was tabulated based on this information. In cases where sizable portions of the rooms date from different periods, the various dates are noted. Rooms are also evaluated for relative architectural significance within the building according to a carefully developed set of definitions. Photographs of each room supplement the written description; however, in some instances photographic coverage was limited due to accumulation of debris.

Room numbers for each building were assigned by the survey team in a roughly clockwise manner and do not represent any historical numbering systems.

Square footage calculations are "net", the area of each room being measured from the interior face of the exterior and/or principal walls within each space.

Survey forms for each building are in numerical sequence for each floor and are followed by forms for the hallways (numbers preceded by an "H"). Forms for all interior stairs (numbers preceded by an "S") are located in the last section for each building survey form group.

References to directions have been simplified to relate to wall orientation. For example, the wall of the new hospital extension of Unit 2 facing the ferry slip will be referred to as the "north" wall, although the true compass direction is northwest. See drawing below for directional references.

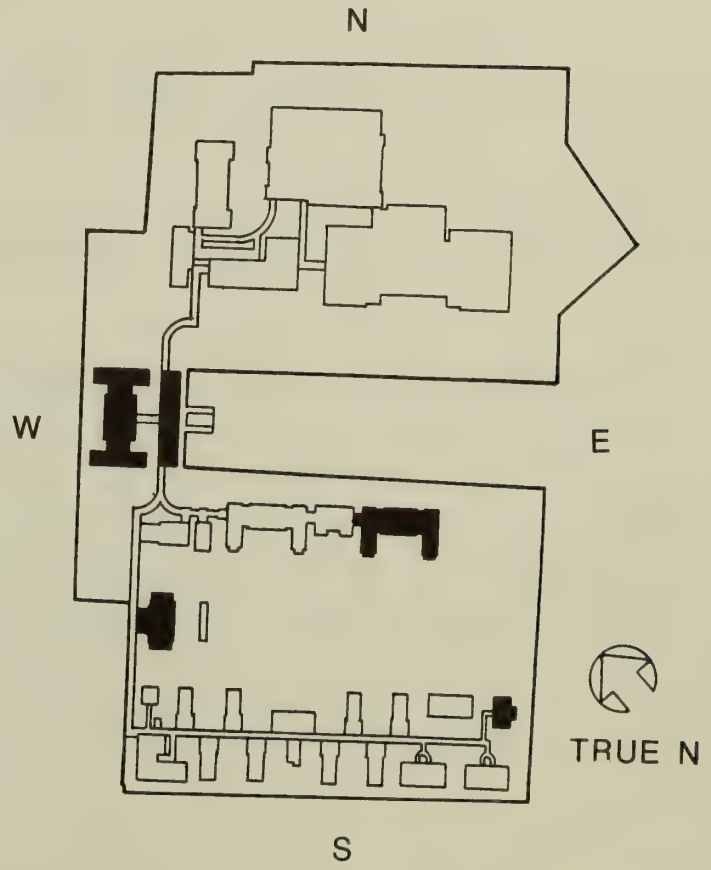

DEFINITIONS OF EXISTING CONDITIONS

The condition of each space has been evaluated according to criteria that were specifically developed for the main building on Ellis Island and adapted for all Unit One buildings for use in "Existing Condition Report, Unit One Buildings." These criteria have been further adapted for the Units 2, 3 and 4 structures. A range of conditions was defined for each material in the buildings following careful field inspection. The condition of a finish was evaluated relative to other similar finishes in all buildings using the standard terms "good," "fair," "poor" and "destroyed." Since these buildings have experienced extensive deterioration, no surfaces or fixtures were considered to be in "excellent" condition. In borderline cases, the more deteriorated condition was selected. It has been noted where the survey of a room, or parts of a room, was made difficult or impossible by debris accumulation.

Following are definitions of the criteria that were used in the existing condition survey of Units 2, 3 and 4 buildings.

FLOOR
Tile

GOOD

85-100% intact. Very few, if any, cracks in tile. Minor discoloration. Retiling noticeable in places.

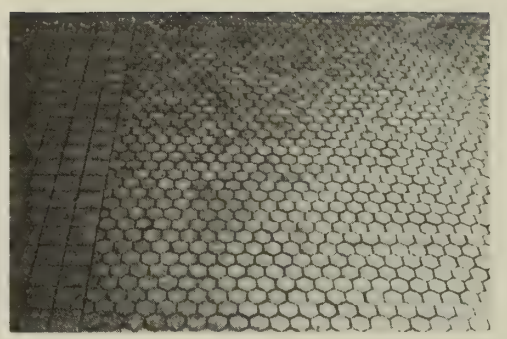

FAIR

60-85% intact. Some cracks in localized areas. Some tiles missing.

POOR

30-60% intact. Large cracks. Large areas missing.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

FLOOR
Wood

GOOD

90-100% intact. Floorboards in place. Minor deterioration of varnished finish.

FAIR

75-90% intact. General loss of varnished finish and ware of underlying wood surface. Occasional areas of staining.

POOR

20-75% intact. Localized areas of warping, severe discoloration and rot.

DESTROYED

Material is completely missing or is destroyed beyond practical retrieval.

NOTE: all surveyed wood floors were in good to fair condition

FLOOR
Linoleum

GOOD

85-100% intact. Little or no cracking or buckling. No material missing.

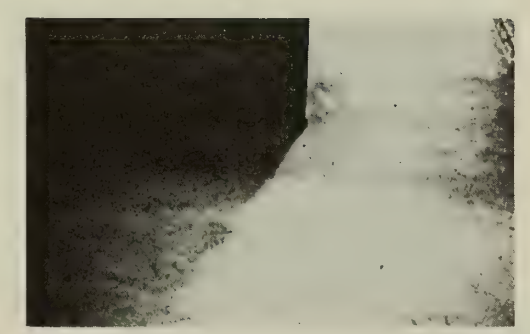

FAIR

60-85% intact. Some material missing. Cracked into sections. Some buckling.

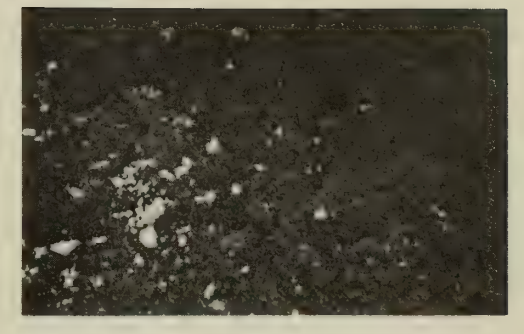

POOR

30-60% intact. Significant amount of material missing. Extensive cracking, buckling, and spalling of material.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

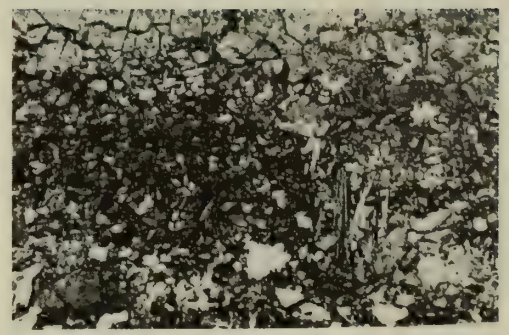

FLOOR & BASE

Resilient Tile

GOOD

85-100% intact. Material in place, adhered to floor or base of wall, not broken.

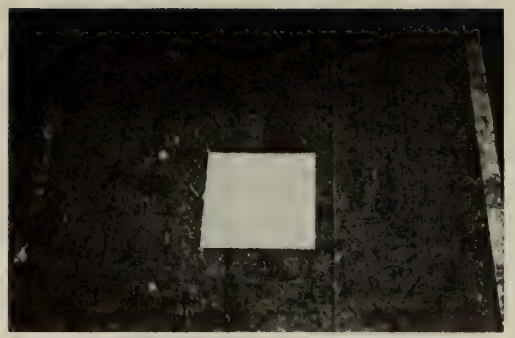

FAIR

60-85% intact. Some material broken, some buckling, some adhesive failure. Exposure of sections of sub-floor.

POOR

30-60% intact. Significant amount of material is missing, broken, buckling, loose, no longer adhered.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

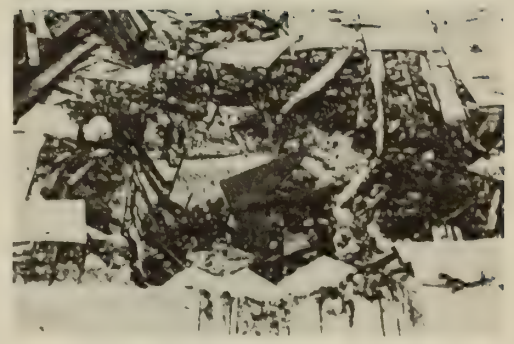

BASE
Wood

GOOD

90-100% intact. Still joined to wall. Minor deterioration of paint surface.

FAIR

75-90% intact. Separated from wall in limited areas. Some deterioration in localized areas (generally along window).

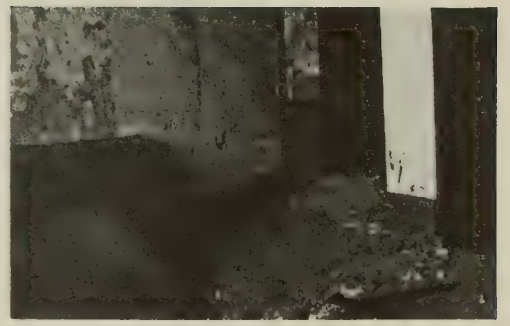

POOR

20-75% intact. Complete separation from wall. Serious deterioration (generally under windows).

DESTROYED

Material is completely missing or is destroyed beyond practical retrieval.

BASE & WALLS
Tile / Tile Wainscot

GOOD

85-100% intact. Few or no cracks forming. Minimum number of tiles missing.

FAIR

60-85% intact. Some cracks in localized areas. Some tiles missing.

POOR

30-60% intact. Large areas missing, sizable cracks present.

DESTROYED

0-30% intact. Material is completely missing or is destroyed beyond practical retrieval.

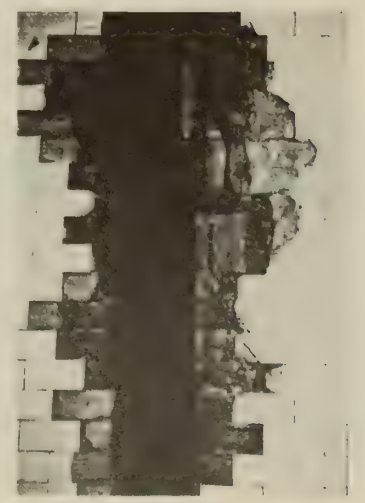

WALLS & CEILINGS
Plaster

GOOD

70-100% intact. Minor surface spalling, cracking and peeling of paint.

FAIR

50-70% intact. Substantial surface spalling, cracking and peeling of paint. Unit masonry and/or basecoat exposed in certain areas.

POOR

20-50% intact. Majority of plaster is severely cracked with buckling and spalling. Exposure of significant areas of base surface.

DESTROYED

0-20% intact. Material is completely missing or is destroyed beyond practical retrieval.

WALLS & CEILINGS
Glazed Wood Partitions / Gypsum Board / Acoustic Panels

GOOD

85-100% intact. Minor surface damage including scrapes, knicks and peeling of paint.

FAIR

50-70% intact. Small holes and cracks. Some missing material. Glass missing.

POOR

20-50% intact. Large holes and cracks. Major amount of missing material.

DESTROYED

0-20% intact. Material is completely missing or is destroyed beyond practical retrieval.

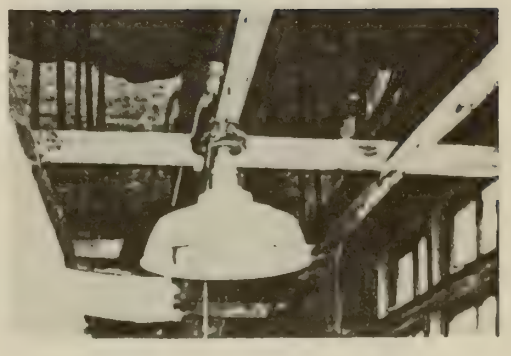

DOORS / OPENINGS
Wood / Glass Panelled

GOOD

Wood, glass, and hardware intact. Minor peeling of paint. Minor surface knicks and scrapes.

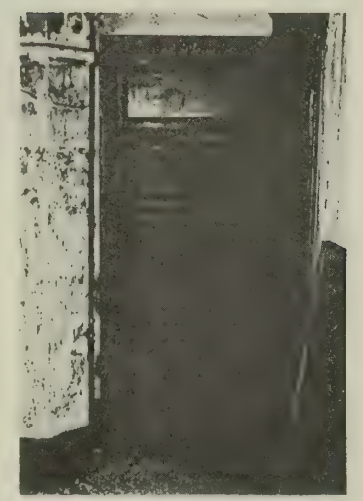

FAIR

Hardware intact, part may be missing. Minor warping of doors. Deteriorated paint finish and/or surface damage.

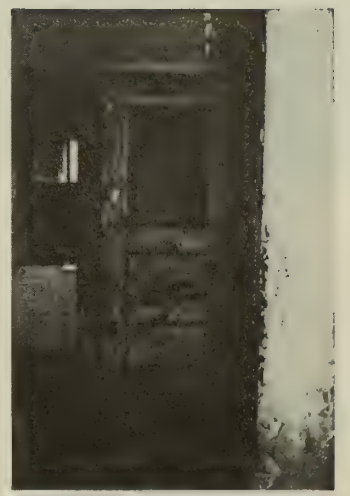

POOR

Severe wood damage, i.e., splitting and missing elements. Glass broken or missing. Extensive deterioration.

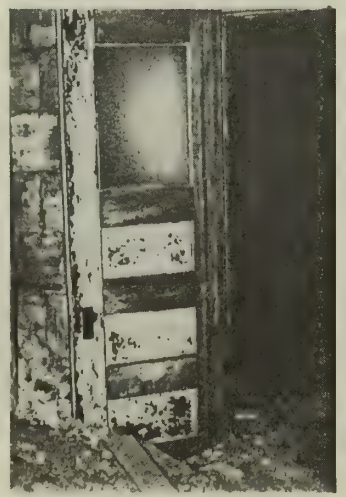

DESTROYED

Door is missing or is destroyed beyond practical retrieval.

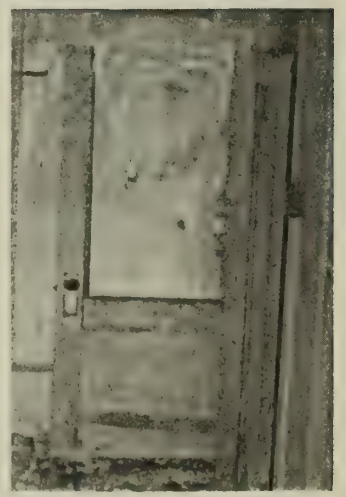

DOORS / OPENINGS
Wood Veneer

GOOD

Wood and hardware intact, no splitting.

FAIR

Minor splitting and/or delamination. Finish and hardware may have minor deterioration.

POOR

Hardware missing. Severe splitting and/or delamination.

DESTROYED

Door is missing or is destroyed beyond practical retrieval.

DOORS / OPENINGS
Galvanized Metal

GOOD

Minor peeling of paint finish. Hardware intact.

FAIR

Deteriorated paint finish. Small dents to surface. Hardware may have minor damage.

POOR

Deteriorated paint finish. Severe corrosion to surface. Bad dents. Hardware badly damaged or missing.

DESTROYED

Door is missing or is destroyed beyond practical retrieval.

LIGHTING:	☐	Incandescent/Type A	☐	Intact	☐	Destroyed
	☐	Incandescent/Type B	☐	Intact	☐	Destroyed
	☐	CML/Sconce	☐	Intact	☐	Destroyed
	☐	Other:	☐	Intact	☐	Destroyed

The evaluation of lighting fixtures is based on physical appearance only and does not consider whether the fixture still functions. Ceiling fixtures are considered "intact" if the shade and mount are in place. Wall fixtures or sconces are considered intact with or without their shade, if the mount is in place. A fixture may be given an "intact" designation with or without its lamp, or bulb. A fixture is designated "destroyed" if if is damaged beyond practical retrieval or is missing.

Lighting fixture types consist of suspended glass globes, Type A, and ceiling-mounted or suspended "RLM" - type incandescent fixtures, Type B. "RLM" refers to a type of flared metal enamel shade, commonly used in industrial installations. Fixtures referred to as sconces on survey forms consist of oval or round shaped wall-mounted porcelain bases, some having glass shades. Another light source is referred to as "CML" (ceiling-mounted lamp) on survey forms. These fixtures consist of ceiling-mounted bare lamps in porcelain sockets and metal housing or lamps mounted to a ceiling conduit.

TYPE A: glass globes

TYPE B: "RLM" metal shade fixtures

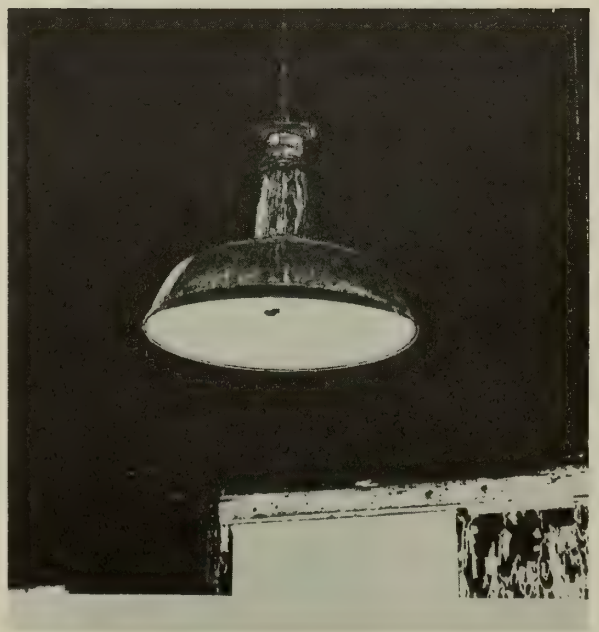

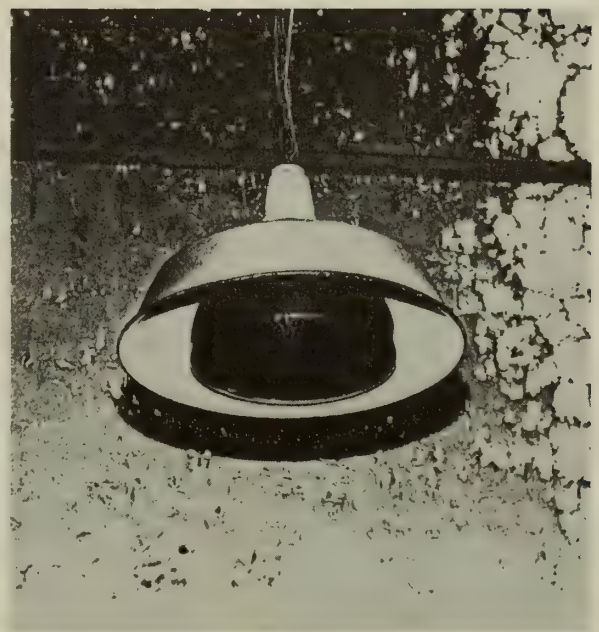

Sconce: Ward 1 Type sconce, typically found in wards of the new hosptial extension, and sconce with oval mount

CML: ceiling-mounted lamps, with metal housing or conduit mount

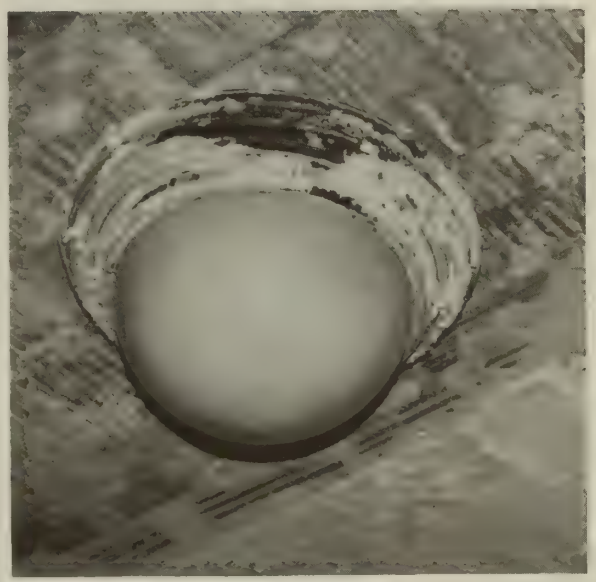

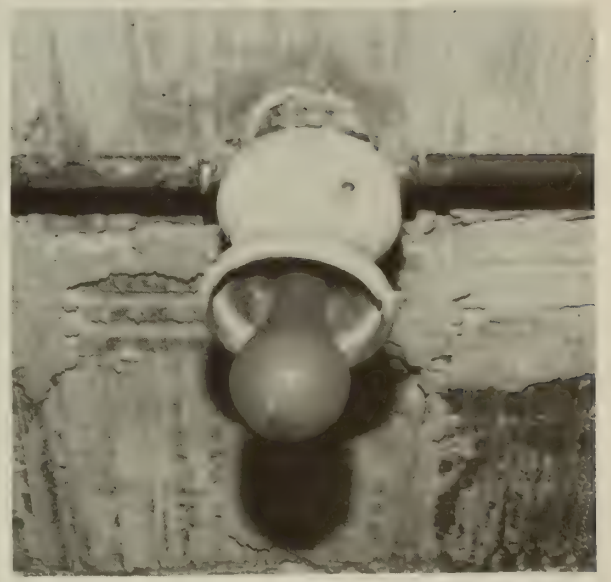

Other: Glass shade fixtures and fluorescent units

HEATING/ VENTILATION PLUMBING:	☐	Radiators	☐	Intact	☐	Destroyed
	☐	Vents/Fans	☐	Intact	☐	Destroyed
	☐	Sink/Toilet/Urinal	☐	Intact	☐	Destroyed
	☐	Other:	☐	Intact	☐	Destroyed

Evaluation of heating, ventilation and plumbing fixtures is based on external appearance only and does not consider whether the fixture is still functioning. If a fixture is not "intact", it has been damaged beyond practical retrieval or is missing and is designated "destroyed".

The following photographs illustrate typical fixture types referred to in the survey form "notes".

RADIATOR: sectional floor type

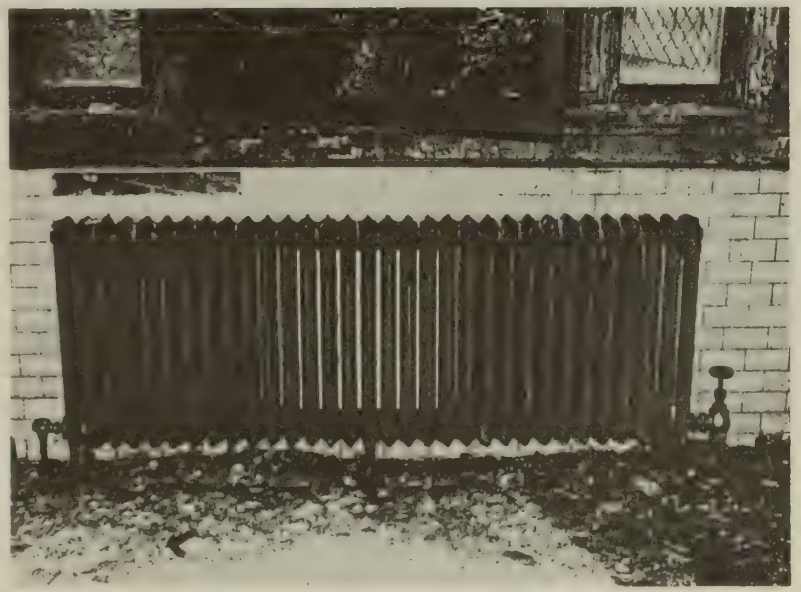

RADIATOR: sectional wall-mounted type

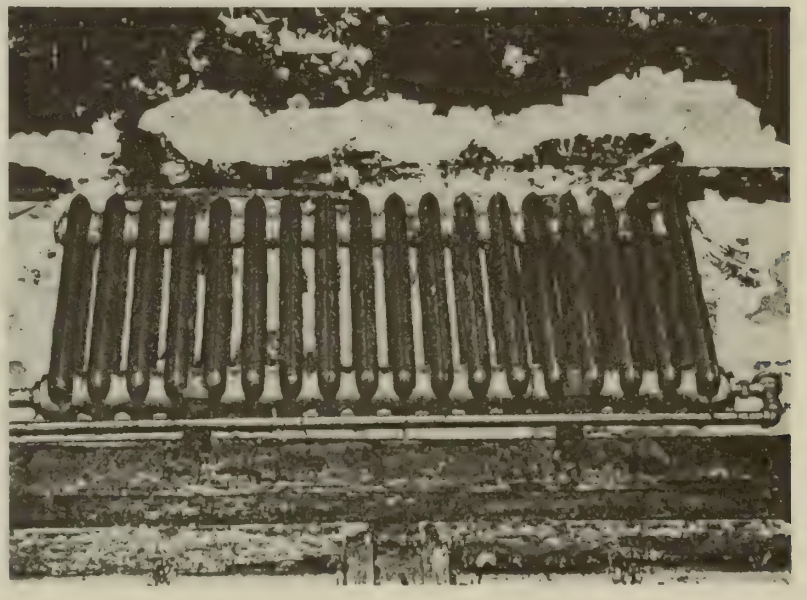

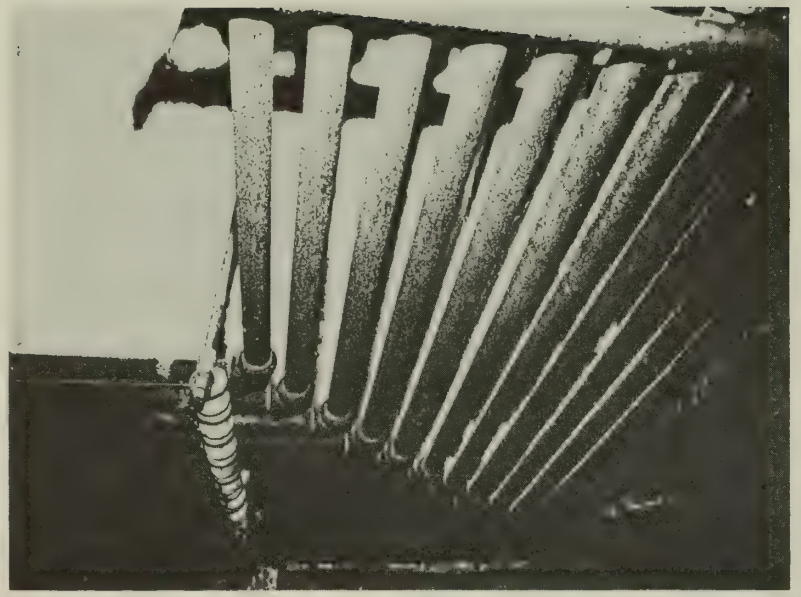

RADIATOR: parallel pipe cluster, ceiling-suspended

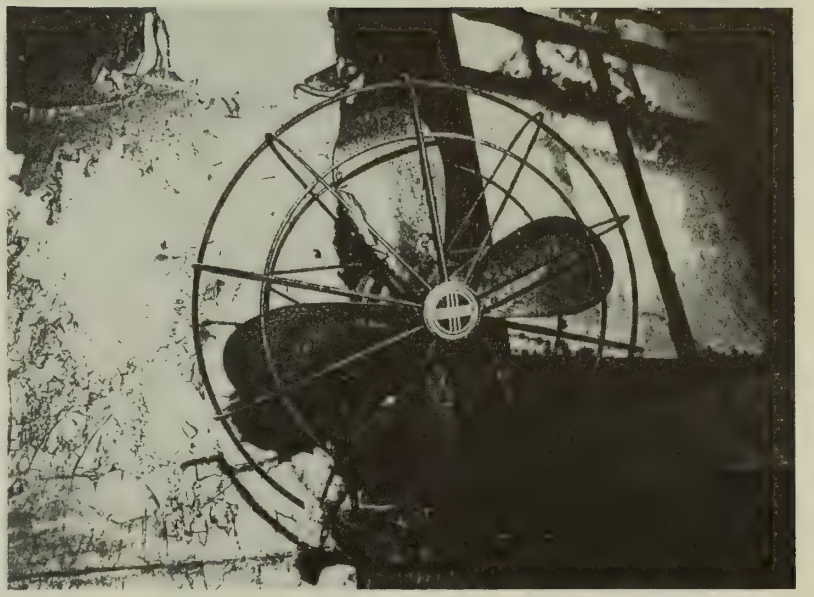

FAN: wall-mounted rotary

FAN: window fan

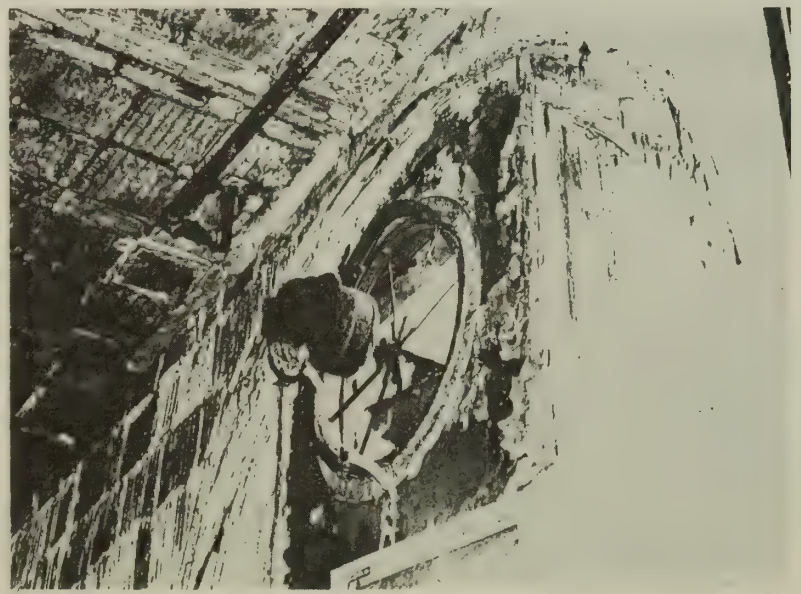

VENT: ceiling grille to fan house

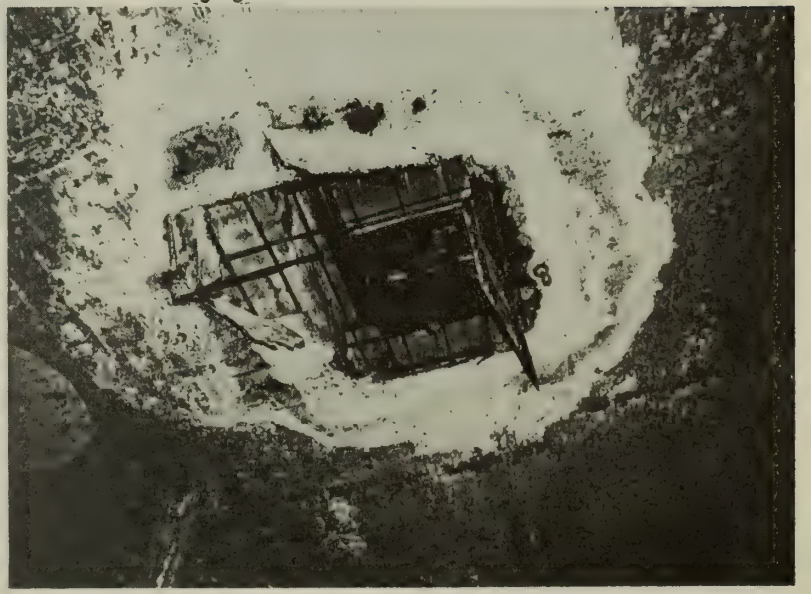

PLUMBING: porcelain rounded pedestal wall sinks (c. 1920's)

PLUMBING: free-standing metal supported sinks and water fountain

PLUMBING: slop sinks

PLUMBING: wall-mounted type urinal (c. 1940)

PLUMBING: floor-type urinal

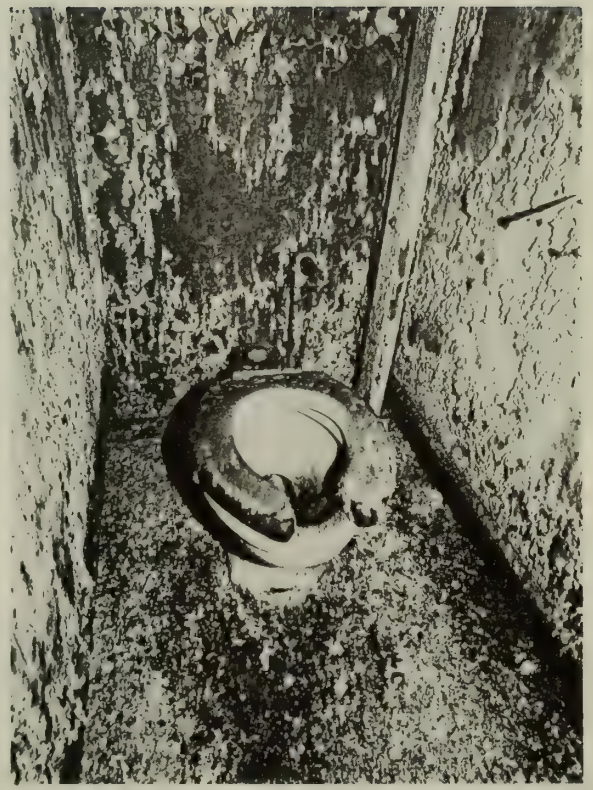

PLUMBING: toilet

PLUMBING: shower stall with galvanized metal partitions

PLUMBING: porcelain square pedestal wall sinks

PLUMBING: free standing urinals

PLUMBING: solid side bath tub.

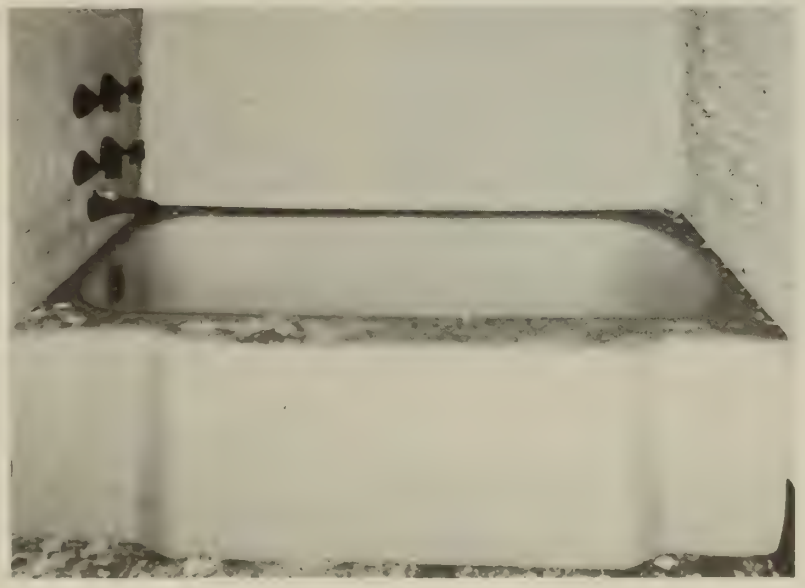

PLUMBING: galvanized metal shower stalls

DEFINITIONS OF ARCHITECTURAL SIGNIFICANCE

A range of significance for spaces within the buildings of Units 2, 3 and 4 was developed for existing architectural spaces within each structure surveyed. The ranking of spaces for architectural significance is relative to the architectural context of each building as it relates to the architecture of Ellis Island as a whole. Certain factors were considered in evaluating the spaces:

- Volume, size, monumentality, proportions
- Quality of materials and workmanship
- Overall design
- Uniqueness of the design, rare features

In borderline cases, the higher level of significance was selected.

Following is a brief discussion of the criteria:

MOST ARCHITECTURAL SIGNIFICANCE

The classification of "Most Architectural Significance" was assigned to spaces that have great architectural character. Such spaces may exhibit monumental proportions and their design, materials, and workmanship are of a high quality. They are often unique volumes. An example is the waiting room, room 101, of the ferry house. This large volume is distinguished by a spacious stepped interior rising to 36 feet at its highest point, glazed terra cotta tile wainscot and a terrazzo floor.

SOME ARCHITECTURAL SIGNIFICANCE

The classification of "Some Architectural Significance " was assigned to spaces that have a moderate amount of architectural character. Volume, size, monumentality, and proportions may distinguish them from the more common and generally smaller spaces in the building. Careful attention was given to the use of materials and the execution of details. An example is room 110, of the new hospital extension. This volume is distinguished by its southern facing exit onto a verandah, composed of a central door with glazed transom and flanking windows. The space also has two pairs of double doors connecting it with rooms to the east and west.

MINOR ARCHITECTURAL SIGNIFICANCE

The classification of "Minor Architectural Significance " was assigned to spaces that exhibit few architectural pretensions. Materials and workmanship are standard. Volume and proportions are relatively undistinguished. Rooms are common for their type. An example is room 114 of the immigrant building. Which was designed, but never utilized as a dormitory room. It has plaster walls, a suspended ceiling, and linoleum floor with an 8 inch cement border.

NEGLIGIBLE SIGNIFICANCE

The classification, "Negligible Architectural Significance" was assigned to spaces that have no architectural character. They are often very small and of standard materials and design. An example is H106B, a closet located in the west end of the first floor central corridor of the new hospital extension.

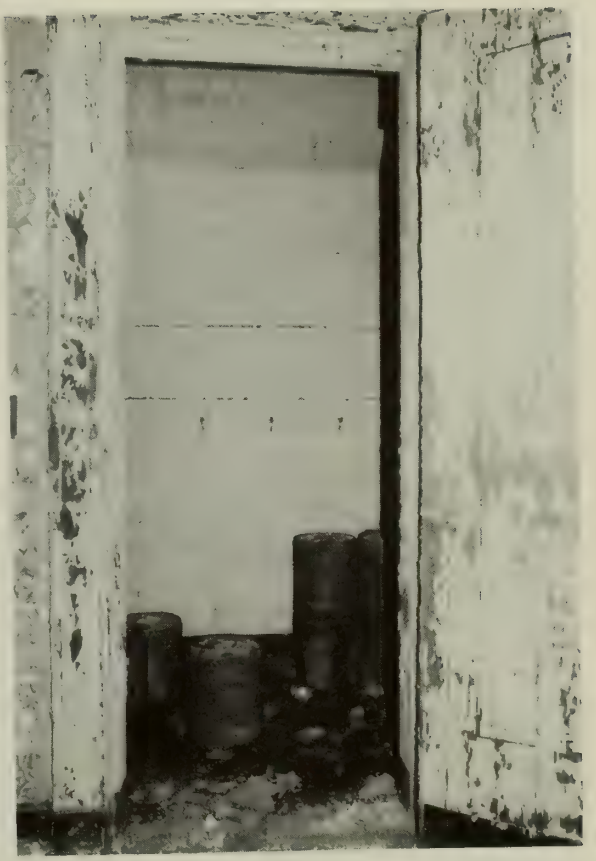

FERRY HOUSE

EXISTING CONDITIONS

GOOD
FAIR
POOR
DESTROYED

Exhibit 24

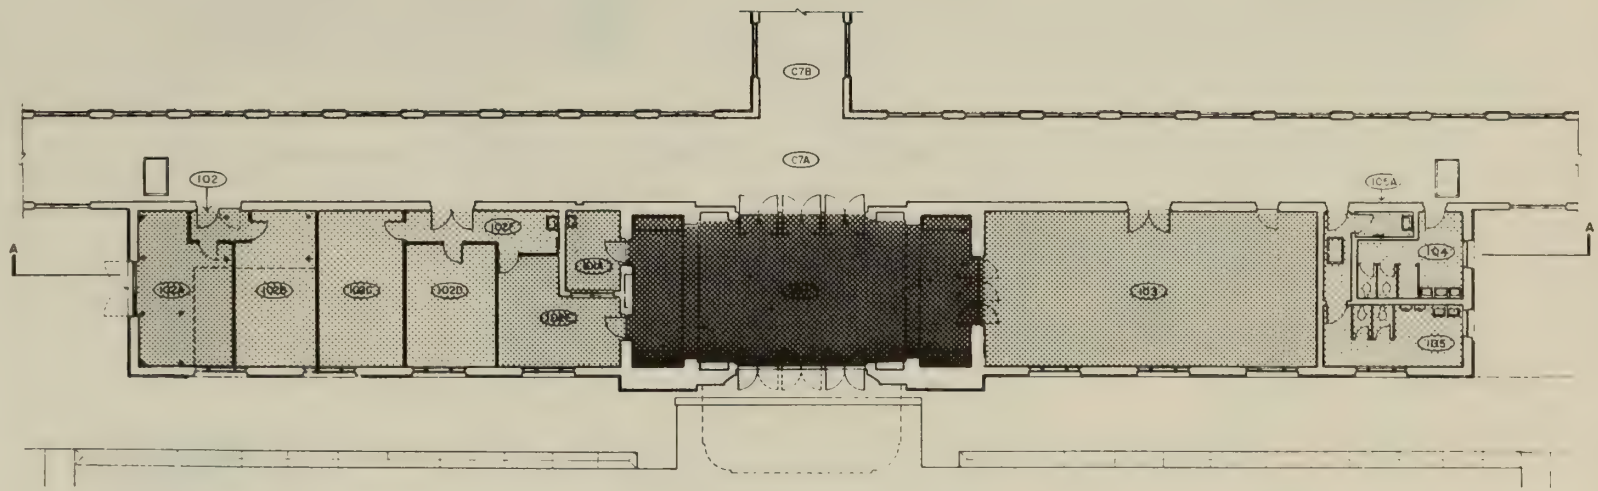

356 | 26,012 / 1 of 9
DSC | JUL 88

FEET 1/8"
METE 1/96

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE / MOTTER PINEGOLD & ALEXANDER
41 EAST 11 STREET
NEW YORK, NY 10003
(212) 777-7800

STRUCTURAL ENGINEERS
ROBERT SILMAN ASSOCIATES, P.C.

MECHANICAL & ELECTRICAL ENGINEERS
SYSKA & HENNESSY INC.

SURVEY OF STRUCTURES UNIT 2

ELLIS ISLAND
STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

NO. BY | REVISIONS | DATE

DESIGNED | DATE
DRAWN | TECH REVIEW

KEY

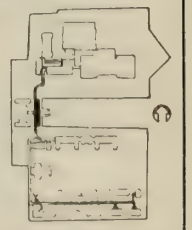

TITLE OF SHEET
FERRY HOUSE
FIRST FLOOR PLAN

SUB SHEET NO | DRAWING NO

PROJ NO | SHEET OF

ARCHITECTURAL SIGNIFICANCE

Exhibit 25

- MOST
- SOME
- MINOR
- NEGLIGIBLE

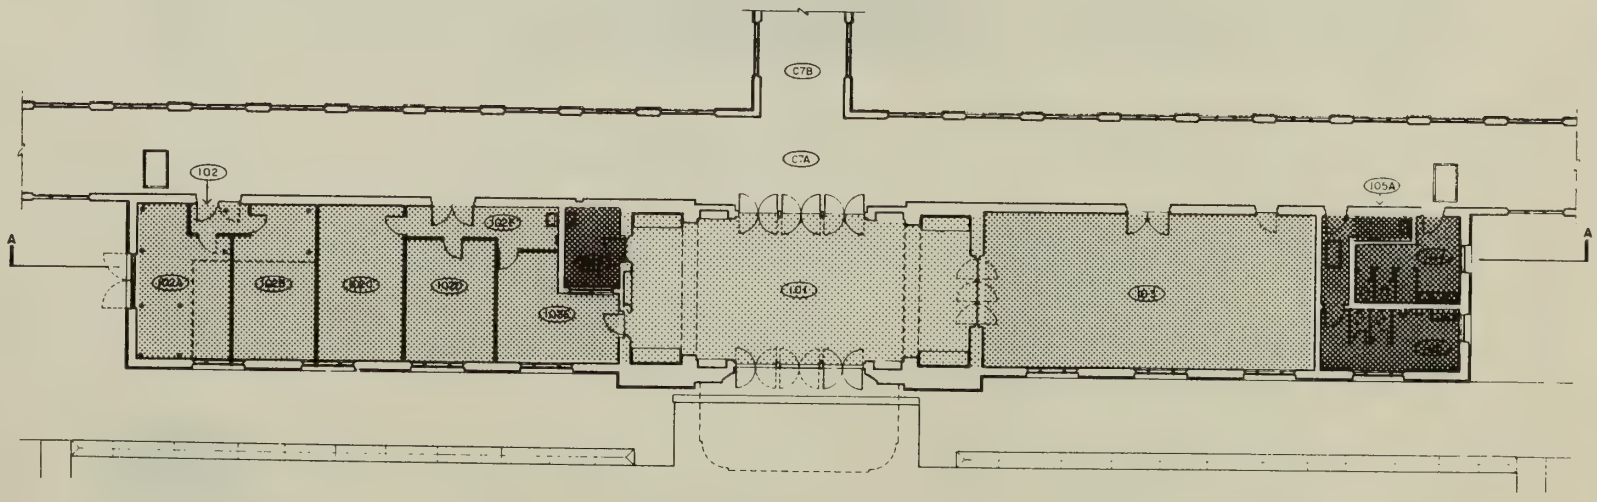

356 | 26,012 / 2 of 9
DSC | JUL 88

FEET 1/8"=1'-0"
METERS 1:96

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS :
BEYER BLINDER BELLE /
MOTTER FINEGOLD & ALEXANDER
41 EAST 11 STREET
NEW YORK, NY 10003
(212) 777-7800

STRUCTURAL ENGINEERS
ROBERT SILMAN ASSOCIATES, P.C.

MECHANICAL & ELECTRICAL ENGINEERS
SYSKA & HENNESSY INC.

SURVEY OF STRUCTURES UNIT 2

ELLIS ISLAND
STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk	BY	REVISIONS	date

DESIGNED: | DATE:
DRAWN: DUENOW / SEIN | TECH REVIEW:

KEY

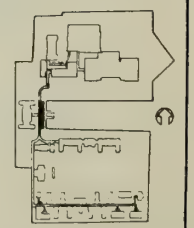

TITLE OF SHEET
FERRY HOUSE
FIRST FLOOR PLAN

SUB SHEET NO | DRAWING NO
PKG NO | SHEET

ELLIS ISLAND EXISTING CONDITION SURVEY — Ferry House — page: 33

ROOM NO: 101 LAST KNOWN USE: Waiting room SQUARE FEET: 904 CEILING HEIGHT: 36'-1/4" DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: Terrazzo	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	Black, white, light buff marble chips. Darker border. Brass division strips.
BASE:	X Tile/Concrete Resilient Wood Other:	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	
WALLS:	X Plaster Partitions X Tile Wainscot Other:	X Good Fair X Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	Beige + pink terra cotta tile. Cracking. S. wall has area of missing tiles.
CEILING:	X Plaster Acoustic panels Cove Other	Good Fair Poor X Destroyed	1911-1923 1924-1933 1934-present In question	Completely destroyed. Exposure of metal lath + frame. Possible to look into tower.
DOORS/ OPENINGS:	X Wood/Glass Panelled Wood Veneer X Galvanized Metal Other:	Good X Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	3 pairs double swinging glass + metal doors on each of N+S walls. 2 6-light doors, S. wall. 3 single swinging doors, N. wall.
LIGHTING:	Incandescent/Type A Incandescent/Type B X CML/Sconce Other:	Intact Destroyed Intact Destroyed Intact 4 Destroyed Intact Destroyed	1911-1923 1924-1933 X 1934-present In question	Ceiling destroyed – evidence of ceiling fixtures gone.
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans Sink/Toilet/Urinal Other:	8 Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1911-1923 1924-1933 X 1934-present In question	8 metal lined wall niches for radiators.
MISCELLANEOUS:		X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	4 high back curved wooden benches, one in each corner, stained dark
SUMMARY:		Good Fair X Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	**ARCHITECTURAL SIGNIFICANCE:** X Most; Some; Minor; Negligible

PHOTOGRAPHS: (1) View North (2) View South (3) View Southeast ROOM NO.

PHOTOGRAPHS: (4) Doors, East wall (5) Doors, West wall ROOM NO. 101

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY — Ferry House — page: 51

ROOM NO: 101A LAST KNOWN USE: Ferry Boat Engineer's office SQUARE FEET: 91 CEILING HEIGHT: 10'-6½" DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient rolled [ ] Wood [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [X] Other: screen door	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Metal/glass panelled: 6 lights. 1 pane destroyed. Window into 102E, casement.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [X] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	chain hanging from ceiling, lamp missing.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [1] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	1 Rotary fan on shelf. 1 Wall mounted sectional radiator. 1 Wall mounted sink.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Fire instructions for "whistle warning" on glass plaque on N. wall, typ. Shelf + fuse box on N. wall. Shelf over sink., ghost of mirror.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View Southwest ② View South east ROOM NO. 101A

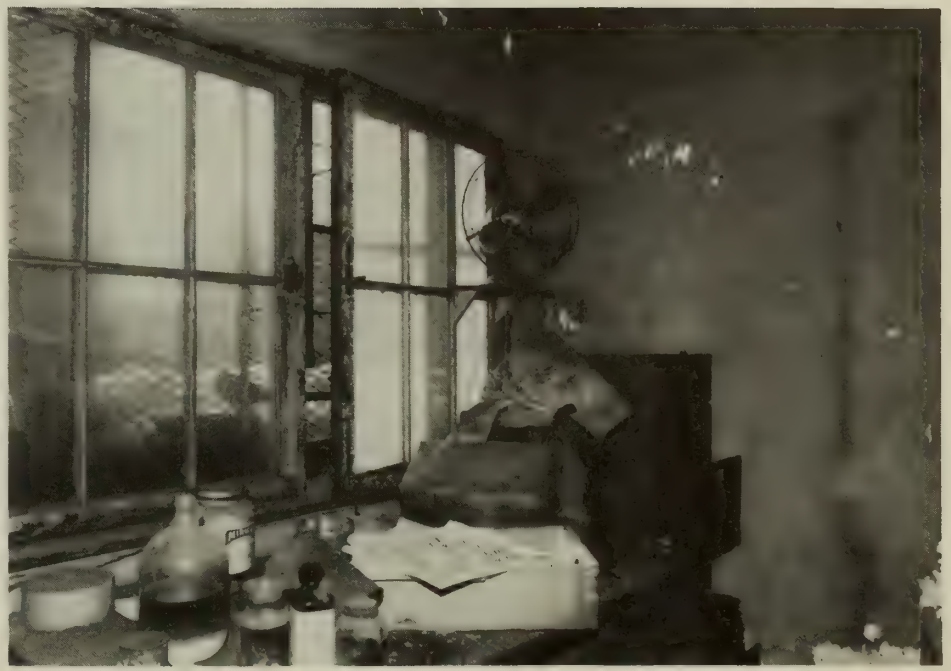

ELLIS ISLAND EXISTING CONDITION SURVEY Ferry House page: 39

ROOM NO: 102A LAST KNOWN USE: Storage SQUARE FEET: 292 CEILING HEIGHT: 16'-4½" DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair obscured [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [X] Wood [X] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Wooden partition walls have wood base. Bases of original walls – obscured by debris.
WALLS:	[X] Plaster [X] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	N. + part of S. wall – wood partitions. Gray paint. 2" wood strips over seams in wood sections.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	exposed iron lath.
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Wood vestibule addition w/ stippled glass panels, 8 panes. Entrance to 102B from vestibule. White paint. New plywood door.
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed 2 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	small floor mounted sectional in vestibule, supported on bricks.
MISCELLANEOUS:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Wood balcony supported by 8 iron columns. Blue-gray paint. Room filled with stacks of green wood benches.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① view east

ROOM NO. 102A

ELLIS ISLAND EXISTING CONDITION SURVEY Ferry House page: 41

ROOM NO: 102B LAST KNOWN USE: Office SQUARE FEET: 262 CEILING HEIGHT: 16'-4½" DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete (circled) [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Painted gray
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Black painted base.
WALLS:	[X] Plaster [X] Partitions [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	N. + S. partition walls. Yellow paint. N. wall covered w/plaster board — Black wood frame mounted on wall, infilled w/ plywood.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood ~~Veneer~~ [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	from Vestibule. stippled glass light. Single sidelight.
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed 2 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
MISCELLANEOUS:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	NPS office furniture/lockers. Balcony w/ iron columns. — cont. from 102A.
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) view east (2) view West ROOM NO. 102B

ELLIS ISLAND EXISTING CONDITION SURVEY Ferry House page: 43

ROOM NO: 102C LAST KNOWN USE: Office SQUARE FEET: 274 CEILING HEIGHT: 16'-4" DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	gray paint.
BASE:	[ ] Tile/Concrete [ ] Resilient [X] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Wood base on N. partition wall. Other walls have none.
WALLS:	[X] Plaster [X] Partitions [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Wood moulding on S. wall (frame). Fresh yellow paint.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood ~~Veneer~~ [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	New plywood door. Transom light over door frame / stippled glass.
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed 2 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Globes missing.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
MISCELLANEOUS:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Lockers + table (NPS office furniture)
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View east ② View west ROOM NO. 102C

ELLIS ISLAND EXISTING CONDITION SURVEY Ferry House page: 45

ROOM NO: 102D LAST KNOWN USE: Fire Cashe SQUARE FEET: 224 CEILING HEIGHT: 16'-4" DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile/Concrete Resilient Wood Other:	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	
BASE:	Tile/Concrete Resilient X Wood X Other:	Good X Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	Wood base on partition walls. Black paint on plaster wall.
WALLS:	X Plaster X Partitions Tile Wainscot Other:	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	E. wall, plaster. walls painted light blue – shiny finish (glue) at seams of partitions.
CEILING:	X Plaster Acoustic panels Cove Other	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	
DOORS/ OPENINGS:	X Wood/Glass Panelled Wood ~~Veneer~~ Galvanized Metal Other:	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	Single light - stippled glass. "FIRE CASHE, AUTHORIZED PERSONNEL ONLY" & NPS Logo painted on outside of door. Square transom light.
LIGHTING:	Incandescent/Type A X Incandescent/Type B CML/Sconce Other:	Intact Destroyed 2 Intact Destroyed Intact Destroyed Intact Destroyed	1911-1923 1924-1933 X 1934-present In question	globes missing.
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans Sink/Toilet/Urinal Other:	1 Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1911-1923 1924-1933 X 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1911-1923 1924-1933 1934-present In question	Orange contact paper pasted on bottom 8 window panes. Remnants of green window shade.
SUMMARY:		X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS: (1) View east (2) View West ROOM NO. 102D

ELLIS ISLAND EXISTING CONDITION SURVEY — Ferry House — page: 47

ROOM NO: 102E LAST KNOWN USE: Office SQUARE FEET: 269 CEILING HEIGHT: 16'-4" DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [X] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Wood base on partition walls only.
WALLS:	[X] Plaster [X] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	W. & S. Walls: partitions. Paint peeling at seams.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] ~~Wood~~/Glass Panelled [X] Wood ~~Veneer~~ [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 6-light metal/glass panelled door to 101. 1 Wood door to 102F. 1 Casement window to 101A w/metal grille.
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed 2 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Radiators, if they exist, are obscured from view by storage items.
MISCELLANEOUS:	[ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Storage of trash cans.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View Northeast

ROOM NO. 102E

ELLIS ISLAND EXISTING CONDITION SURVEY Ferry House page: 49

ROOM NO: 102F LAST KNOWN USE: Vestibule SQUARE FEET: 82 CEILING HEIGHT: 16'-4" DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile/Concrete Resilient Wood Other:	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	
BASE:	Tile/Concrete Resilient X Wood Other:	Good X Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	Wood base on partition walls only.
WALLS:	X Plaster X Partitions Tile Wainscot Other:	Good X Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	E + S. walls: partitions.
CEILING:	X Plaster Acoustic panels Cove Other	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	
DOORS/ OPENINGS:	1 Wood/Glass Panelled 3 Wood ~~Veneer~~ Galvanized Metal Other:	Good X Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	
LIGHTING:	X Incandescent/Type A X Incandescent/Type B CML/Sconce Other:	Intact Destroyed 1 Intact Destroyed Intact Destroyed Intact Destroyed	1911-1923 1924-1933 X 1934-present In question	
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans X Sink/Toilet/Urinal Other:	Intact Destroyed Intact Destroyed 1 Intact Destroyed Intact Destroyed	1911-1923 1924-1933 X 1934-present In question	1 wall-mounted sink.
MISCELLANEOUS:		Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	fuse box on N. wall. Iron ladder attached to N. wall climbs up thru ceiling to roof. chain hangs from roof hatch.
SUMMARY:		X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS: ① View North

ROOM NO. 102F

ELLIS ISLAND EXISTING CONDITION SURVEY Ferry House page: 51

ROOM NO: 103 LAST KNOWN USE: Storage SQUARE FEET: 1049 CEILING HEIGHT: 16'-4 1/4" DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Terrazzo	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Black, white, light buff marble chips. Brass division strips.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Beige Tile.
WALLS:	[X] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
CEILING:	[ ] Plaster [X] Acoustic ~~panels~~ Tiles [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	Patches of missing acoustic tiles.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other: w/ glass	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	1 double door: W. wall, 4 lights each. 1 triple door: S. wall, 6 lights each. 1 single door with small square light and screen door behind.
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [8] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	1 wall-mounted rotary fan on S. wall. Radiators, if they exist, are obscured by storage items.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	1 shelf, NW corner. 1 strip on ceiling, N. end running E/W. 1 chain hangs from it.
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① view north ② View south ROOM NO. 103

ELLIS ISLAND EXISTING CONDITION SURVEY Ferry House page: 53

ROOM NO: 104 LAST KNOWN USE: Women's toilet SQUARE FEET: 163 CEILING HEIGHT: 11'-1¼" DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	putty color, 6" sq; matte.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [2] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Sink/Toilet/~~Urinal~~ [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	3 central pedestal sinks. 2 toilets, third removed.
MISCELLANEOUS:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	2 new heaters. 3 structural glass toilet stalls. 3 pump soap dispensers over sinks.
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1911-1923 [ ] 1924-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View East ② View Southeast ROOM NO. 104

ELLIS ISLAND EXISTING CONDITION SURVEY Ferry House page: 55

ROOM NO: 105 LAST KNOWN USE: Men's toilet SQUARE FEET: 176 CEILING HEIGHT: DATE: 9 Dec. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile/Concrete Resilient Wood Other:	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	putty color, 6" sq., matte.
BASE:	X Tile/Concrete Resilient Wood Other:	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	
WALLS:	Plaster Partitions X Tile Wainscot Other:	X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	
CEILING:	X Plaster Acoustic panels Cove Other	Good X Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	
DOORS/ OPENINGS:	1 Wood/Glass Paneled Wood Veneer 2 Galvanized Metal Other:	Good X Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	glass missing from light of wood door.
LIGHTING:	X Incandescent/Type A Incandescent/Type B CML/Sconce Other:	1 Intact 1 Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1911-1923 1924-1933 X 1934-present In question	
HEATING/ VENTILATION PLUMBING:	X Radiators X Vents/Fans X Sink/Toilet/Urinal Other:	2 Intact Destroyed 2 Intact Destroyed X Intact Destroyed Intact Destroyed	1911-1923 1924-1933 X 1934-present In question	2 new heaters. 2 central pedestal sinks. 1 slop sink in closet. 2 toilets, 2 Urinals (floor type).
MISCELLANEOUS:		X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	Door to closet: "Danger high Voltage." "MEN" stenciled in black w/ gold trim on plaque on door.
SUMMARY:		X Good Fair Poor Destroyed	1911-1923 1924-1933 X 1934-present In question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS: ① View southeast ② View northwest ROOM NO. 105

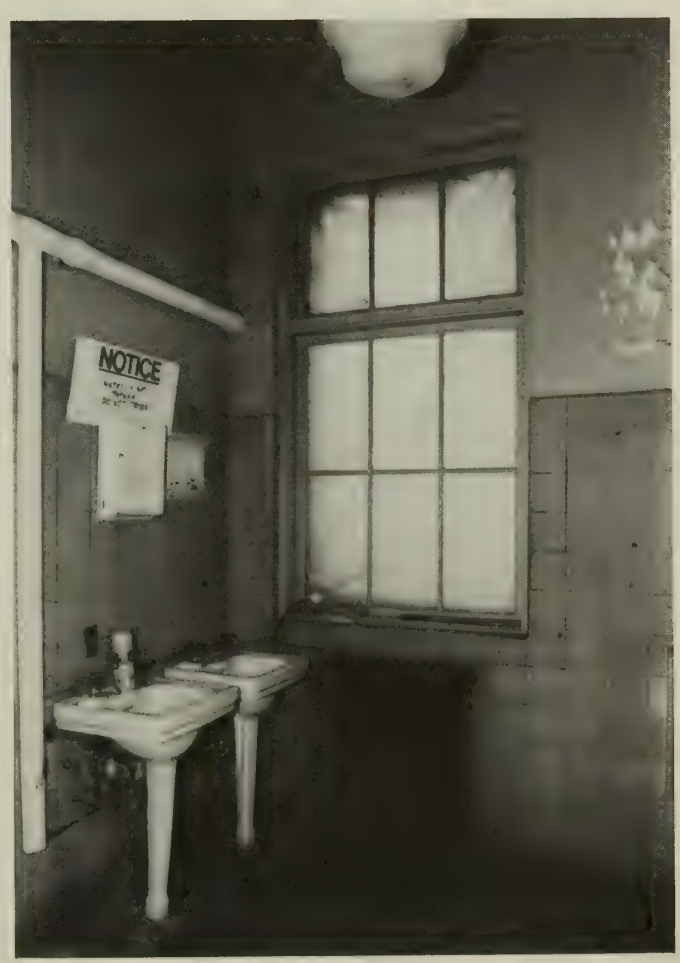

ADMINISTRATION BUILDING

Exhibit 9

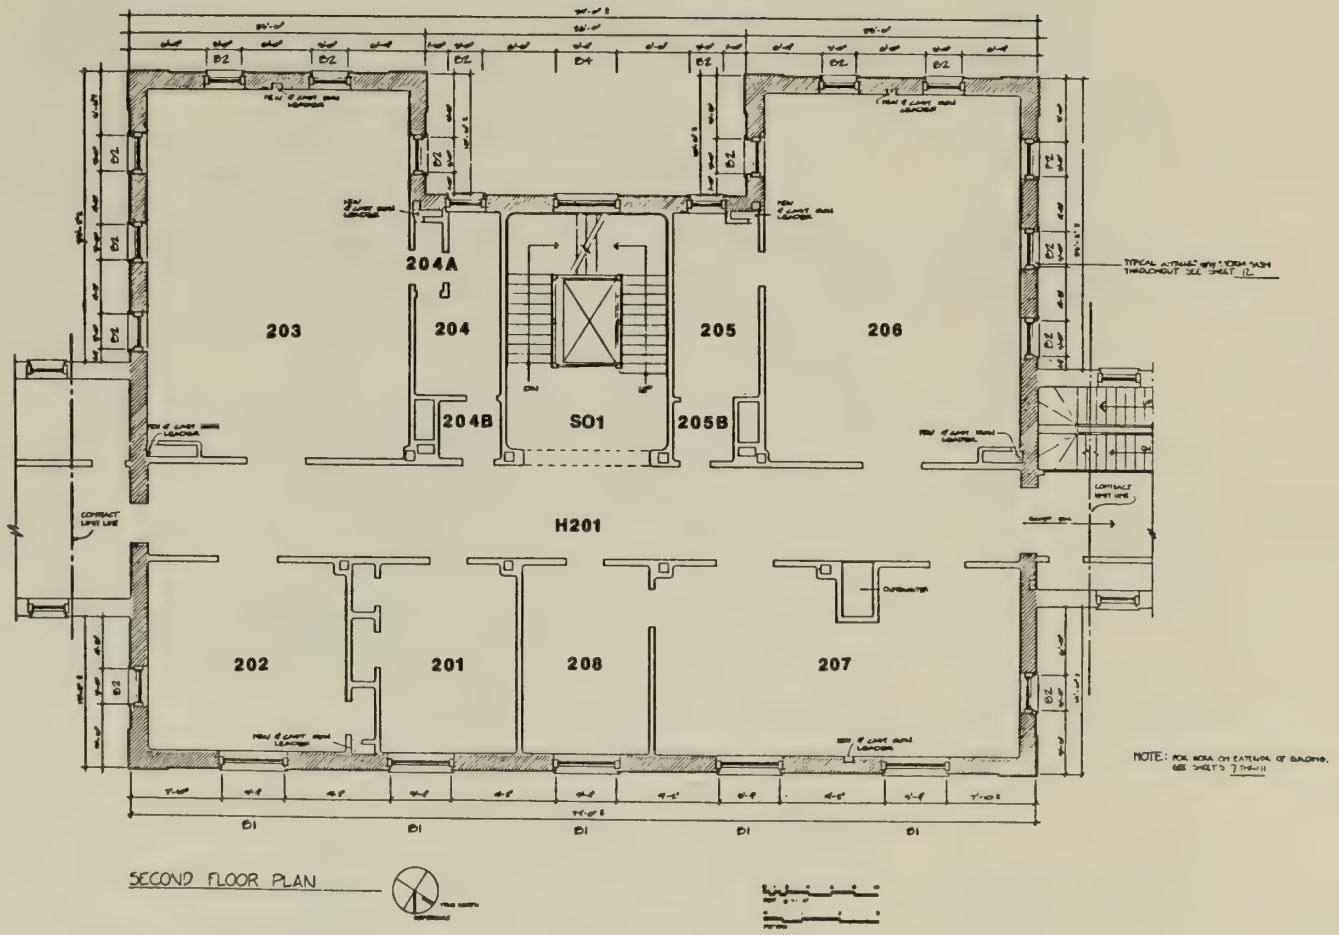

Second floor plan, administration building
Ehrenkrantz Group, 8/80.
NPS ID#

356	25,006 A / 4 of 21
DSC	JUL 88

Exhibit 10

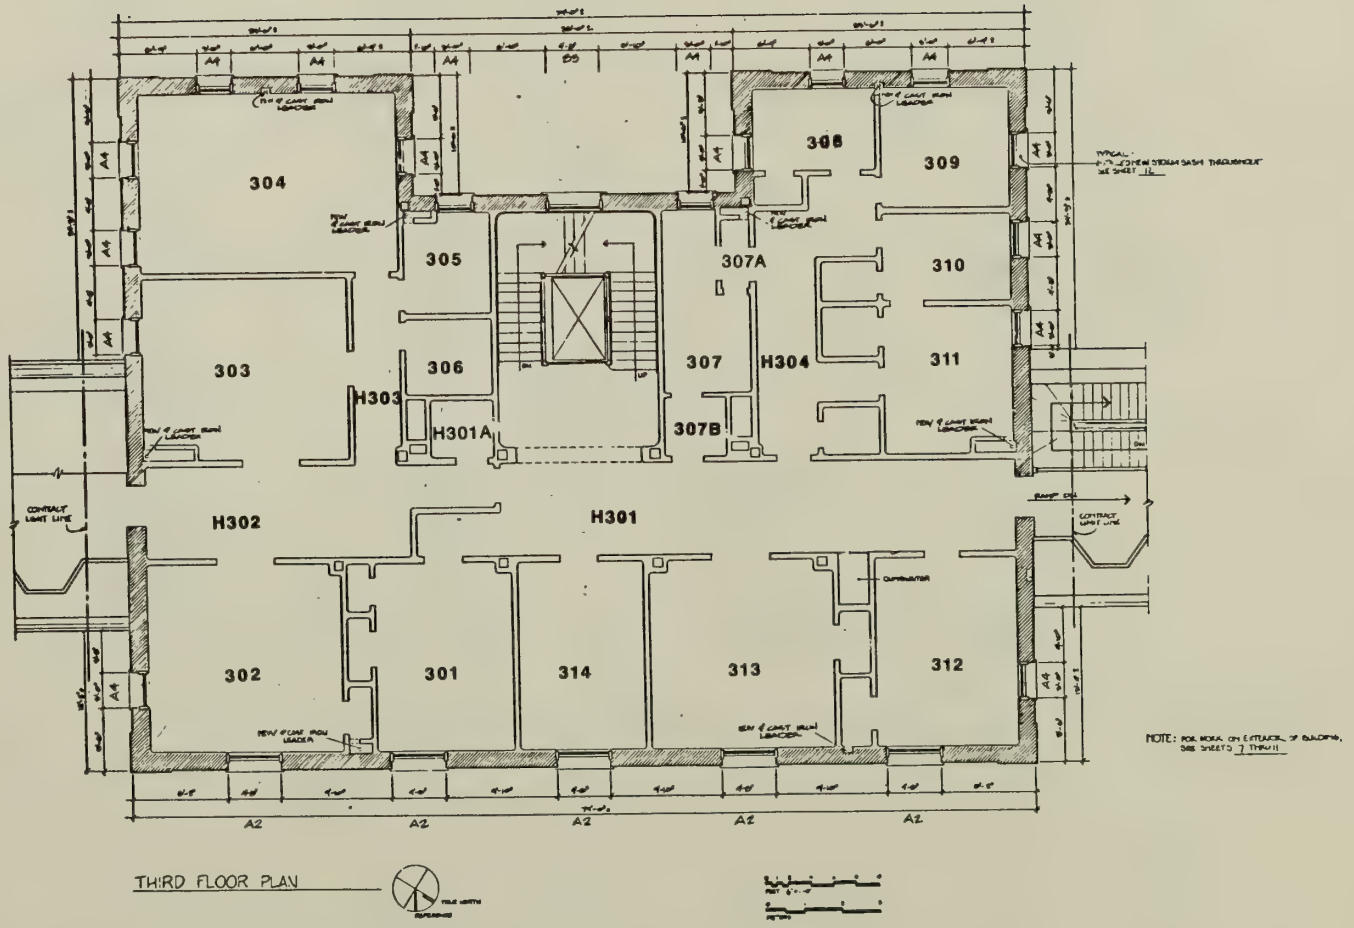

Third floor plan, administration building, Ehrenkrantz Group, 8/80.

NPS ID# 356 | 25,006 A / 5 of 21

DSC | JUL 88

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 59

ROOM NO: 201 LAST KNOWN USE: Doctor's office SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Linoleum laid over concrete.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair Obscured. [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 5-panel door to hall - white overpaint. 1 5-panel door to closet - white overpaint 1 Veneer door w/ 28"×45" floral pattern glass light.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 ward 1 CML. 3 Ward 1 sconces, 2 on west wall mtd. on raised metal circular supports on wood board.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 hole w/ gas jet, E. wall.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 green window shade on floor. 1 shelf, E. wall, deteriorating; painted green. 1 wood wall mount, possibly for a fan.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 61

ROOM NO: 202 LAST KNOWN USE: office SQUARE FEET: CEILING HEIGHT: DATE: 18 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Linoleum over concrete subfloor.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 pr. double 5 panel doors to hallway. 1 door w/ 28"x45" light, to 201. 1 5-panel door to closet, destroyed.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	5 ward 1 type sconces. (see Neus Hospital Extension) 1 ward 1 type CML.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 wall mounted rotary fan.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"226" stenciled on door. Wood and brass transom opener against wall. Broken wood roller for shade on floor. Closet: Metal clothes rod with upper shelf.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 63

ROOM NO: 203 LAST KNOWN USE: Ward SQUARE FEET: CEILING HEIGHT: DATE: 18 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete X Resilient Wood Other:	Good Fair Poor X Destroyed	X 1900-1912 1913-1933 1934-present X In question	Linoleum over concrete.
BASE:	X Tile/Concrete Resilient Wood Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	1 infilled window, South end of E. wall. Holes for new pipes in walls.
CEILING:	X Plaster Acoustic panels Cove Other	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	X Wood/~~Glass~~ Panelled Wood Veneer Galvanized Metal Other:	Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	1 pr. 5-panel double doors to hall. (no transom). 1 5-panel single door (w.) to bathroom, 3-light transom light.
LIGHTING:	Incandescent/Type A Incandescent/Type B X CML/Sconce Other:	Intact Destroyed Intact Destroyed 15 Intact 6 Destroyed Intact Destroyed	1900-1912 1913-1933 X 1934-present In question	2 Ward 1 Type CML-s. 13 sconces, as Ward 1. 6 caps over sconce openings, N & S. walls.
HEATING/ VENTILATION PLUMBING:	X Radiators X Vents/Fans Sink/Toilet/Urinal Other:	4 Intact 1 Destroyed 1 Intact 1 Destroyed Intact Destroyed Intact Destroyed	X 1900-1912 1913-1933 1934-present X In question	1 wall mounted rotary fan, N. wall. 1 wood base remains on other side of door for similar fan. fan itself removed. 4 radiators intact, one on floor.
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	Older sconces are cream colored, newer ones are white. Glass sconce shade on window sill w/ NPS label. Tan painted wood shelf, N. wall.
SUMMARY:		Good Fair X Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** X Most Some Minor Negligible

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 65

ROOM NO: 204/204A/204B LAST KNOWN USE: Bathroom SQUARE FEET: CEILING HEIGHT: DATE: 18 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Dark gray or black overpaint.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Removal of upper tiles, 204A, and by toilet Plaster above wainscot in poor cond.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Ceiling destroyed in 204 and 204A. Good cond. in 204B.
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 doorway w/ door removed 204A → 204 (N.). 3 5-panel wood door w/ 3-light Transoms. 1 5-panel door altered to slide on metal track.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	3 Ward 1 type sconces: W. wall. 1 oval sconce: 204 B, south.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/~~Urinal~~ [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 Toilet. 1 Tub, w/ shower rod. Terminated pipes from 3 removed sinks: 204B. 1 Wall mounted sink w/ curved side + back.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	204B: Metal clothes rod w/ shelf above. Tile and wood upright suggest possible swinging doors from toilet area to tub area
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 67

ROOM NO: 205 LAST KNOWN USE: Bathroom SQUARE FEET: CEILING HEIGHT: DATE: 18 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Red-brown 4" sq. tile, obscured by plaster debris.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Plaster above wainscot in poor cond. Damage to tile over new piping. Area of alteration w/ cement infill, mid-South wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Paneled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [1] Fair [ ] Poor [1] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 5-panel wood door w/ 3-light transom: fair cond. 1 5-panel door to 206: destroyed, transom poor.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [2] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Base, chain + mounts intact; globes destroyed.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: metal shower.	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [X] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	2 wall mounted sinks: w. wall, intact. 1 toilet: destroyed. 1 urinal: destroyed. 1 metal shower.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Label on shower stall: "BATHE RITE Modern shower cabinets, Milwaukee Stamping Co."
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 69

ROOM NO: 206 LAST KNOWN USE: Employee's dining room SQUARE FEET: CEILING HEIGHT: DATE: 18 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☒ Resilient ☐ Wood ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	linoleum over concrete subfloor.
BASE:	☒ Tile/Concrete ☐ Resilient ☐ Wood ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	black overpaint peeling.
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	1 3-panel wood door w/ upper dimpled + horizontally incised glass light. 1 5-panel wood door w/ 3-light transom to 205.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	2 CMLs as ward 1; 1 globe broken. 10 ward 1 type sconces (5 later, whiter type). 1 hole + wiring + metal cap: W. wall. 4 caps south wall, 2 caps N. wall.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☒ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	2 ☐ Intact 1 ☐ Destroyed 2 ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	2 radiators in place, 1 lying on floor. 2 wall-mounted rotary fans: N. wall.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	"DS" stenciled on door to hall. 1 square plaque, (approx 1') above door to 205.
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☒ Most ☐ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 71

ROOM NO: 207 LAST KNOWN USE: Nurses dining room SQUARE FEET: CEILING HEIGHT: DATE: 18 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	linoleum over concrete subfloor.
BASE:	[X] Tile/~~Concrete~~ [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Black overpaint; concrete base, E. 2/3 of room. painted 6" base: west portion of room.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Picture moulding, varnished w/ overpaint 1' down from ceiling.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 5-panel wood door to hall w/ hook on interior face. 1 3-panel w/ dimpled & rear incised glass light. 1 3-panel w/ dimpled overpainted gray glass light, no evidence of door handles.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	2 "ward 1" type CML's - globes missing. 3 oval sconces. 1 "ward 1" type sconces.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/~~Fans~~ [ ] Sink/Toilet/Urinal [ ] Other:	3 [ ] Intact [ ] Destroyed 1 [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 wall mounted rotary fan.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	212" stencilled on hall face of both doors. sconce shade labelled "Ward 7" on window sill.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 73

ROOM NO: 208 LAST KNOWN USE: Pantry SQUARE FEET: CEILING HEIGHT: DATE: 18 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	obscured by plaster debris.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	probable painted base (some paint fragments in debris by wall.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Picture moulding, varnished and overpainted.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 wood 5-panel door to hall, white overpaint, interior 1 wood 3-panel w/ glass light to 207 - no hardware.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 ward 1 type CML. 1 ward 1 type sconce. 1 cap. N. wall.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 wall mounted rotary fan over door.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"210" stenciled on door.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 75

ROOM NO: H201 LAST KNOWN USE: Corridor SQUARE FEET: CEILING HEIGHT: DATE: 18 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	over concrete subfloor.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	black over paint.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	see indiv. forms for doors on N. & S. walls. E. wall: 1 red single galvanized metal door w/ 10" sq. wire glass light. Metal transom. W. wall: double metal door, as above.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 3 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	3 enamel bases w/ ont shades.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	2 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:	1 circuitry box @ w. end: labelled "1 = EYE NOSE CLINIC" + a no. to dining rm.	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 fire hose: E. end. 1 circuitry box w/ metal levers & printed labels. rusting. 1 = "Dr. Reichard o/f." 1 fire alarm; 1 red wood mount, W. end.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 77

ROOM NO: 301 LAST KNOWN USE: Nurses' room SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	obscured partially by plaster dust + debris, but appears good. scored in 21¼" squares, similar to H.E verandahs. Marble sills.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	7" base w/ bottom coved to floor. Red/ brown over paint.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	½" dado.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	3 wood 5-panel doors: grained. Evidence of door widening or removal of surrounds, all door, even closets.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [X] Destroyed [ ] Intact [ ] Destroyed 3 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	1 chain + mount w/ 4 screws; globe gone. 3 oval sconces. One on S. of E. wall appears to be older.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed 1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 wall mounted sink w/ 1 metal support. faucets intact.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	301A: closet w/ wood clothes rod & upper shelf. 301B: closet w/ 2 beaded supports for shelves. N+S., no rod or shelf. "No Smoking" on wall "318" stenciled on door.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View Northeast ② View North ③ View South ROOM NO. 301

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 79

ROOM NO: 302 LAST KNOWN USE: Dormitory SQUARE FEET: CEILING HEIGHT: DATE: 14 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete / Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Linoleum over wood subfloor. wood sill. Partially obscured by debris.
BASE:	[ ] Tile/Concrete / Resilient [ ] Wood [X] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Painted base on S. wall: black.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile visible, N & E. walls. Remainder of plaster cracked and spalling.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 wood 5-panel door to hall, dark deteriorated graining, simple flush surround. 1 wood 5-panel door to closet.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	White glass globe w/ gold pattern. 1 sconce w/out shade. 2 ghosts w/ wiring for removed sconces.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] ~~Vents~~/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [X] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 sink w/ fixtures lying on floor.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Closet: Metal clothes rod, shelf above. Black "No Smoking" stenciled S. wall.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View Northwest (2) South doors ROOM NO. 302

PHOTOGRAPHS: (3) View Northeast (4) View North ROOM NO. 302

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 83

ROOM NO: 303 LAST KNOWN USE: Dormitory SQUARE FEET: CEILING HEIGHT: DATE: 14 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Linoleum laid over wood subfloor. Wood sill.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Brown painted 8" base.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Infilled window: N. of E wall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~-Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 wood 5-panel door w/ 3-light transom. flush, simple surround, dark graining. Inside painted white.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 White glass globe w/ gold pattern. 1 Ward 1 Type sconce.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 central pedestal sink, 1 faucet intact.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"321" stenciled on door. "No Smoking" stencil: S. wall.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View Southeast (2) View East (3) View North ROOM NO. 303

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 85

ROOM NO: 304 LAST KNOWN USE: Dormitory SQUARE FEET: CEILING HEIGHT: DATE: 14 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	linoleum laid over wood subfloor
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	brown painted base.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 wood 5-panel grained door w/ 3-light transom. Standard flush surround.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [3] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	white glass globe w/ gold pattern, broken upper portion. 3 caps for possible sconces.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 radiator in place, 1 lying on floor. 1 single pedestal sink w/ faucets.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"323" stencilled on door.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① sink, Northeast corner. ② View East ③ View Southwest ROOM NO. 304

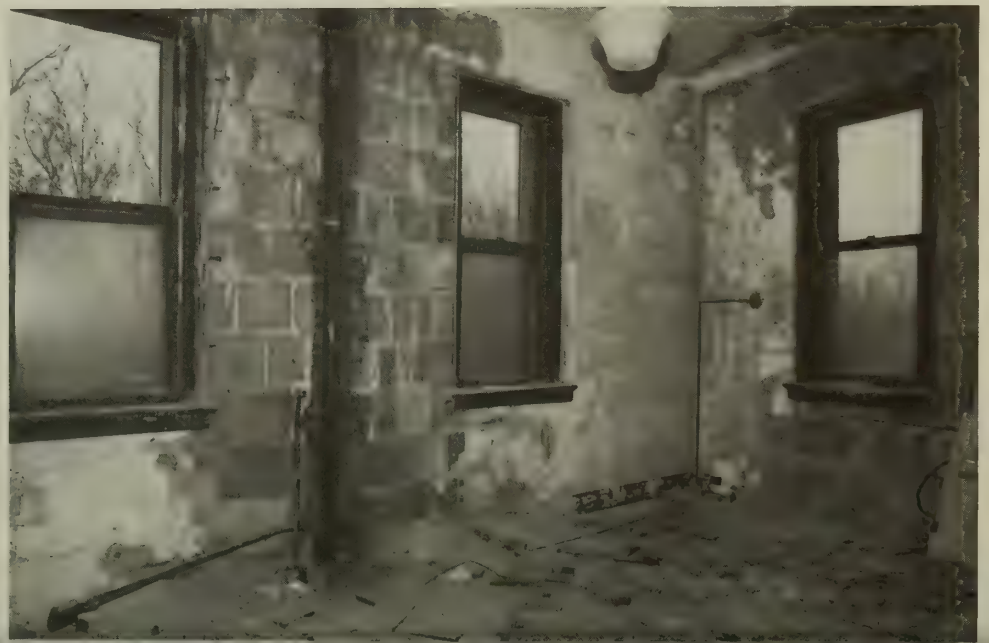

PHOTOGRAPHS: (4) View West ROOM NO. 304

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 89

ROOM NO: 305 LAST KNOWN USE: Toilet SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	obscured by debris.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	obscured.
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Plaster above wainscot destroyed. Area of wainscot removed: central toilet stall: west wall; lower + upper south/east and s. door surround.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 wood 5-panel door w/ 3-light transom. 1 double 4-light window to 306 I N. wall. painted wood sash + surrounds. Exterior window has marble sill (damaged).
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 oval sconce, E. wall.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/~~Fans~~ [X] Sink/Toilet/Urinal [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed 3 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	3 toilets, tanks gone.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"325" stencilled on door. Toilet partitions appear to be of slate. Doors removed.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View Southwest

ROOM NO. 305

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 91

ROOM NO: 306 LAST KNOWN USE: Bathroom SQUARE FEET: CEILING HEIGHT: DATE: 14 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor obscured [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Plaster above wainscot fair cond.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 wood 5-panel door w/ 3-light transom. Double 4-light window: S. wall (allows light from 305 window).
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 oval sconce, W. wall. (no shade).
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: tub	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 partially wall hung radiator. 1 tub = rolled top, porcelain over metal, 2 faucets. fitted for shower.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 screen door leaning against wall. "327" stenciled on door.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① Bathtub, View Northwest ROOM NO. 306

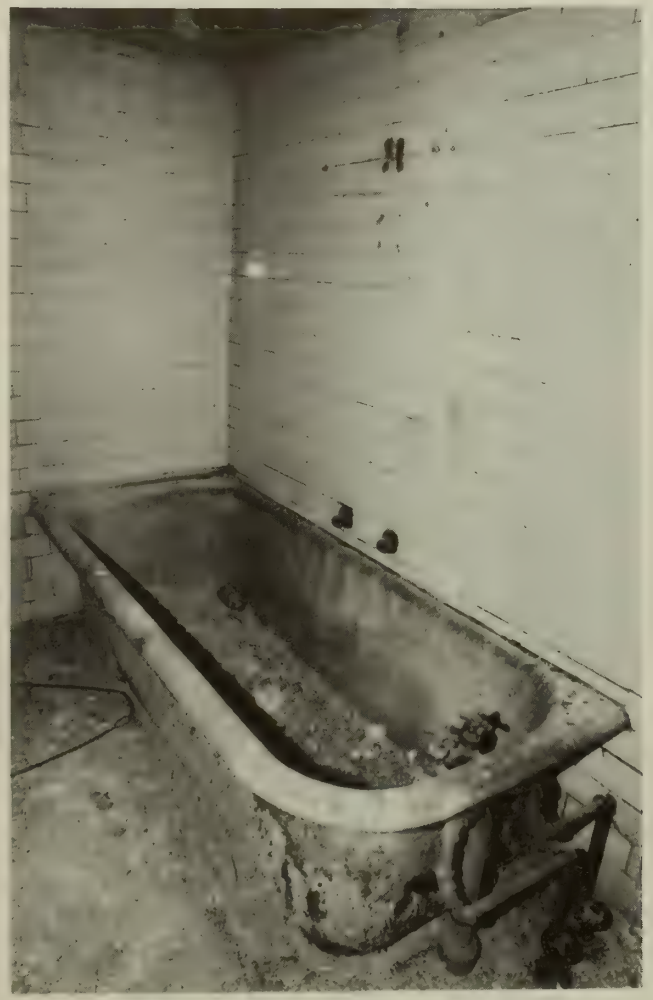

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 93

ROOM NO: 307/307A/307B LAST KNOWN USE: Bathroom SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair obscured. [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [1] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Plaster above wainscot poor. 1 Partition, wood surrounds (varnished) E. to W. at line of 307A. See plan. 1 wood louvred door in tub.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	4 3/4" ghost around door. 4 wood 5-panel doors, 2 open to 307A - poor, 1 detached. One w/ 3-light transom to hall. Marble window sill.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	2 oval sconces, 307. 1 round sconce, 307B; 1 round 307A - no shades.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: tub.	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [X] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 wall mounted sectional radiator. 1 toilet: destroyed. 1 tub - rounded edge; shower curtain rod. 1 wall mounted sink; pipes for 3 sinks, 307B.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"329" stenciled on door to hall. 1 screen door on floor. Mirror in wood frame above sink, 307A. Hook on back of door to hall.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) Bathtub, view Northwest (2) View South ROOM NO. 307

PHOTOGRAPHS: (3) West Wall ROOM NO. 307B

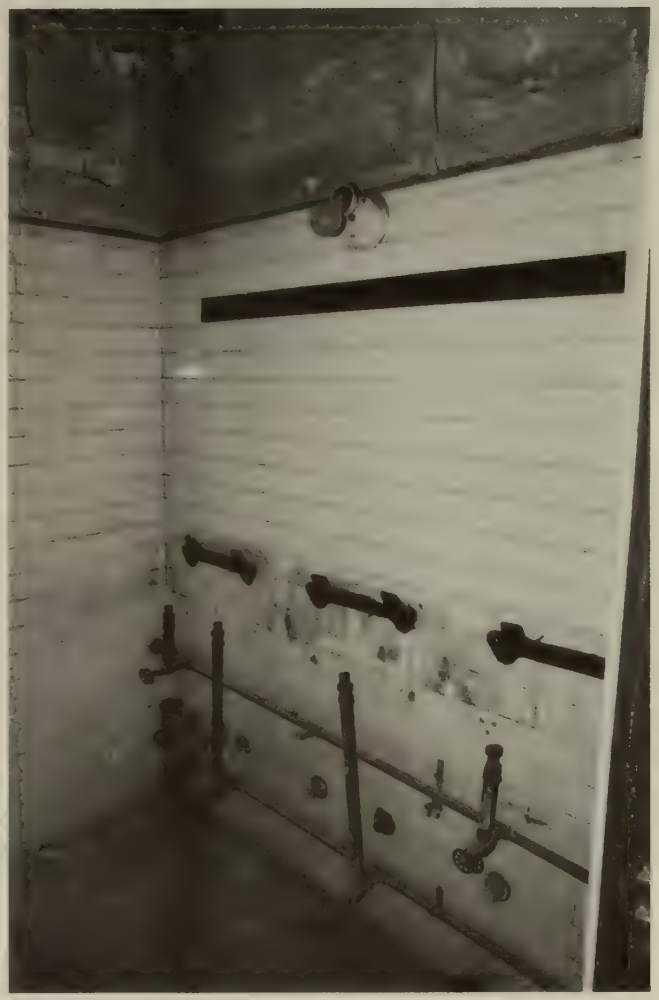

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 97

ROOM NO: 308 LAST KNOWN USE: SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☒ Resilient ☐ Wood ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	Asphalt tile: obscured.
BASE:	☐ Tile/Concrete ☐ Resilient ☒ Wood ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	7" base w/ upper wood 1/4" round cap. Asphalt base glued over wood: poor.
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	without cove.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	without cove.
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	1 infilled doorway. Doorway to 308 – altered to arched opening. 1 wood 5 panel door.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☒ Intact ☒ Destroyed ☒ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	1 Ward I type sconce (no shade). Ghost of 1 oval sconce + structural opening for one other wall fixture (south). Ghost + cap of central ceiling fixture.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☒ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	1 wall hung sink w/ faucets (E. wall).
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	closet w/ beaded backboard. finishes destroyed.
SUMMARY:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) View East (2) View West ROOM NO. 308

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 99

ROOM NO: 309 LAST KNOWN USE: SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Brown asphalt tile.
BASE:	[ ] Tile/Concrete [ ] Resilient [X] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	wood w/ 1/4" round cap. Overglued asphalt base: black.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Non-cove, N/W corner (wall added).
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 wood 5 panel door w/ single light Transom. wood plinths at base of door surround. ~~wood surround as Hospital Extension.~~
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [ ] Intact [X] Destroyed	[ ] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	1 white round sconce w/ socket. Openings (1 capped) for 2 sconces. Flat cap on ceiling for central fixture
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"335" stenciled on door.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View West ② View East ROOM NO. 309

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 101

ROOM NO: 310 LAST KNOWN USE: SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Scored concrete floor. Closet: linoleum.
BASE:	[ ] Tile/Concrete [ ] Resilient [X] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Dark varnish, 1/4" round cap. Underlying wood = tan/gold wood surface.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	non-cove
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Non cove.
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Door in N. wall altered to arched opening. 1 wood 5-panel to closet. 1 wood 5-panel to hall w/ single light transom.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [1] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	1 Base, chain + mount w/4 screws, globe gone. 1 ceramic wall fixture (utility) inside above closet door.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 wall hung sink, severe damage, 2 faucets.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View West ② View East ROOM NO. 310

PHOTOGRAPHS: (3) View Northeast ROOM NO. 310

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 105

ROOM NO: 311 LAST KNOWN USE: SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Scored concrete, dark overpaint. Obscured by plaster debris.
BASE:	[ ] Tile/Concrete [ ] Resilient [X] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	As 309.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	N/W cove, others, when extant, non cove.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 screen door. 1 arched door opening. 1 wood 5-panel door to closet. 1 wood 5-panel w/ single-light transom (black paint on transom light).
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [2] Intact [1] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Base, chain + mount w/ broken glass globe. 2 unusual ceramic sconces 1 opening + wiring for removed sconce.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"339" stenciled on door to hall. Closet w/ clothes rod. shelf removed, beaded wall board.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) East entrance (2) View Southeast (3) View West ROOM NO. 311

PHOTOGRAPHS: (4) North Wall ROOM NO. 311

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 109

ROOM NO: 312 LAST KNOWN USE: Maternity Ward SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/(Concrete) Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	scored. Marble sill to hall.
BASE:	[X] Tile/(Concrete) Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Brown overpaint.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Evidence of 11'4" altered area around door? cove.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	2 wood 5-panel doors to hall + closet. closet door overpainted w/ white
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [1] Destroyed; [ ] Intact [ ] Destroyed; [ ] Intact [ ] Destroyed; [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Base, chain + mount w/ 4 screws – globe gone. 4 Ward I type sconces, west, North. 2 ghosts + wiring: E. wall.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed; [ ] Intact [ ] Destroyed; [ ] Intact [1] Destroyed; [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 wall mounted sink, destroyed.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"No Smoking" stencil: E. wall. "324" stencil on door. 1 ladder 13 rungs, wood. Evidence of turquoise pt. closet: double beaded board. 4 hooks.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View North (2) View Northeast ROOM NO. 312

PHOTOGRAPHS: (3) View South ROOM NO. 312

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 113

ROOM NO: 313 LAST KNOWN USE: Ward dining room SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Obscured by debris.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Obscured: N. wall.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	6" ghost around door. turquoise pt.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 pr. double 5-panel doors: blue/gray overpaint. 1 single 5-panel door to closet.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	3 ward 1 type sconces (no shades). 2 ghosts of removed sconces. 1 hole in ceiling for removed fixture.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Louvred door for 301 on floor. closet: wood clothes rod, 2 beaded side supports w/ 5 hooks, 1 upper shelf.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View North (2) View Northeast (3) View West (4) View South ROOM NO. 313

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 115

ROOM NO: 314 LAST KNOWN USE: Ward attendant's room SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Linoleum laid over wood subfloor.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	None.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile breaks to rooms on either side.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood ~~/Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 wood 5-panel door. Evidence of ghost around door 3½" sides, 4" on top.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 Base, mount + chain, globe gone. 3 round sconces (ward 1 type), 1 remains, 2 removed.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	wiring w/ central pipe which looks like a gas jet.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"320" stenciled on door - in blue. 2 clothes hooks, back of door.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View North (2) View South ROOM NO. 314

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 117

ROOM NO: H301 LAST KNOWN USE: Hallway SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete X Resilient Wood Other:	Good Fair Poor X Destroyed	X 1900-1912 1913-1933 1934-present In question	Linoleum laid over concrete.
BASE:	X Tile/Concrete Resilient Wood Other:	Good X Fair Poor Destroyed	1900-1912 1913-1933 X 1934-present In question	Black and red overpaint.
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present X In question	Rectangular areas of infill, West end.
CEILING:	X Plaster Acoustic panels Cove Other	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	X Wood/Glass Panelled Wood Veneer X Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present X In question	1 wood 5-panel door w/ 3-light transom : E. wall. 1 metal door - central 10" sq. wire glass light. Painted red/ black base.
LIGHTING:	Incandescent/Type A Incandescent/Type B X CML/Sconce Other:	Intact Destroyed Intact Destroyed 2 Intact Destroyed Intact X Destroyed	1900-1912 1913-1933 1934-present X In question	2 enamel, white CML's w/ flared glass shade (at Hosp. ext.).
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans Sink/Toilet/Urinal Other:	1 Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	X 1900-1912 1913-1933 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	Wood mounts for fire equipment. 1 fire alarm., 1 mustng panel box. Graffiti: Sketch of man in uniform.
SUMMARY:		Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** X Most / Some / Minor / Negligible

PHOTOGRAPHS: ① View South

ROOM NO. H301

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 119

ROOM NO: H301A LAST KNOWN USE: Slop room SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	scored.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Holes in wall indicate removed plumbing fixtures. Plaster above wainscot good.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~-Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 wood 5-panel w/ 3-light transom.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 ward I-type sconce, no shade.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 central pedestal slop sink.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Red edged white paper label on door.
SUMMARY:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: ① View East

ROOM NO. H301A

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 121

ROOM NO: 4302 LAST KNOWN USE: Corridor SQUARE FEET: CEILING HEIGHT: DATE: 18 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Linoleum over wood subfloor.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: painted	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	painted brown 8-9" base.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Structural tiles exposed: East end.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 red overpainted Metal door w/ 10" sq. light w/ wire glass (broken) East. 1 wood 5-panel door w/ 3-light transom
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	1 enamel white base w/ glass shade 1 ghost + wiring - oval sconce, South wall 1 metal cap for sconce, S. wall.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Rusting circuit box: hand lettered labels above switches + door (south). Fire hose attached to pipe: (south).
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View West. ② South wall.

ROOM NO. H302

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 123

ROOM NO: H303 LAST KNOWN USE: Corridor SQUARE FEET: CEILING HEIGHT: DATE: 15 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Linoleum laid over wood.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: paint	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Vestiges of brown paint base, S. Wall.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Evidence of plaster infill of 6" around door opening.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	Ghost/wiring for oval sconce.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	None.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View South

ROOM NO. H303

ELLIS ISLAND EXISTING CONDITION SURVEY Administration Building page: 125

ROOM NO: H304 LAST KNOWN USE: corridor SQUARE FEET: CEILING HEIGHT: DATE: 15 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	linoleum over wood.
BASE:	[ ] Tile/Concrete [ ] Resilient [X] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	w/ 1/4" round cap. Asphalt or linoleum overlayer w/ cap exposed.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Some cove corners, some not.
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	West: Non-cove, East: cove.
DOORS/ OPENINGS:	[X] Wood/~~Glass~~ Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	See individual room forms. 1 wood 5-panel door to closet. Door to 306A: Veneered, panel lifting.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [X] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	2 sconces: east wall, no shades. 2 caps for additional sconces, E+N. walls. 1 white utility wall fixture inside above closet door.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	"331" stenciled on door to 306A. closet: beaded board w/ ghost of clothes rod. Shelving supports.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View South

ROOM NO. H304

NEW HOSPITAL EXTENSION

Exhibit 11

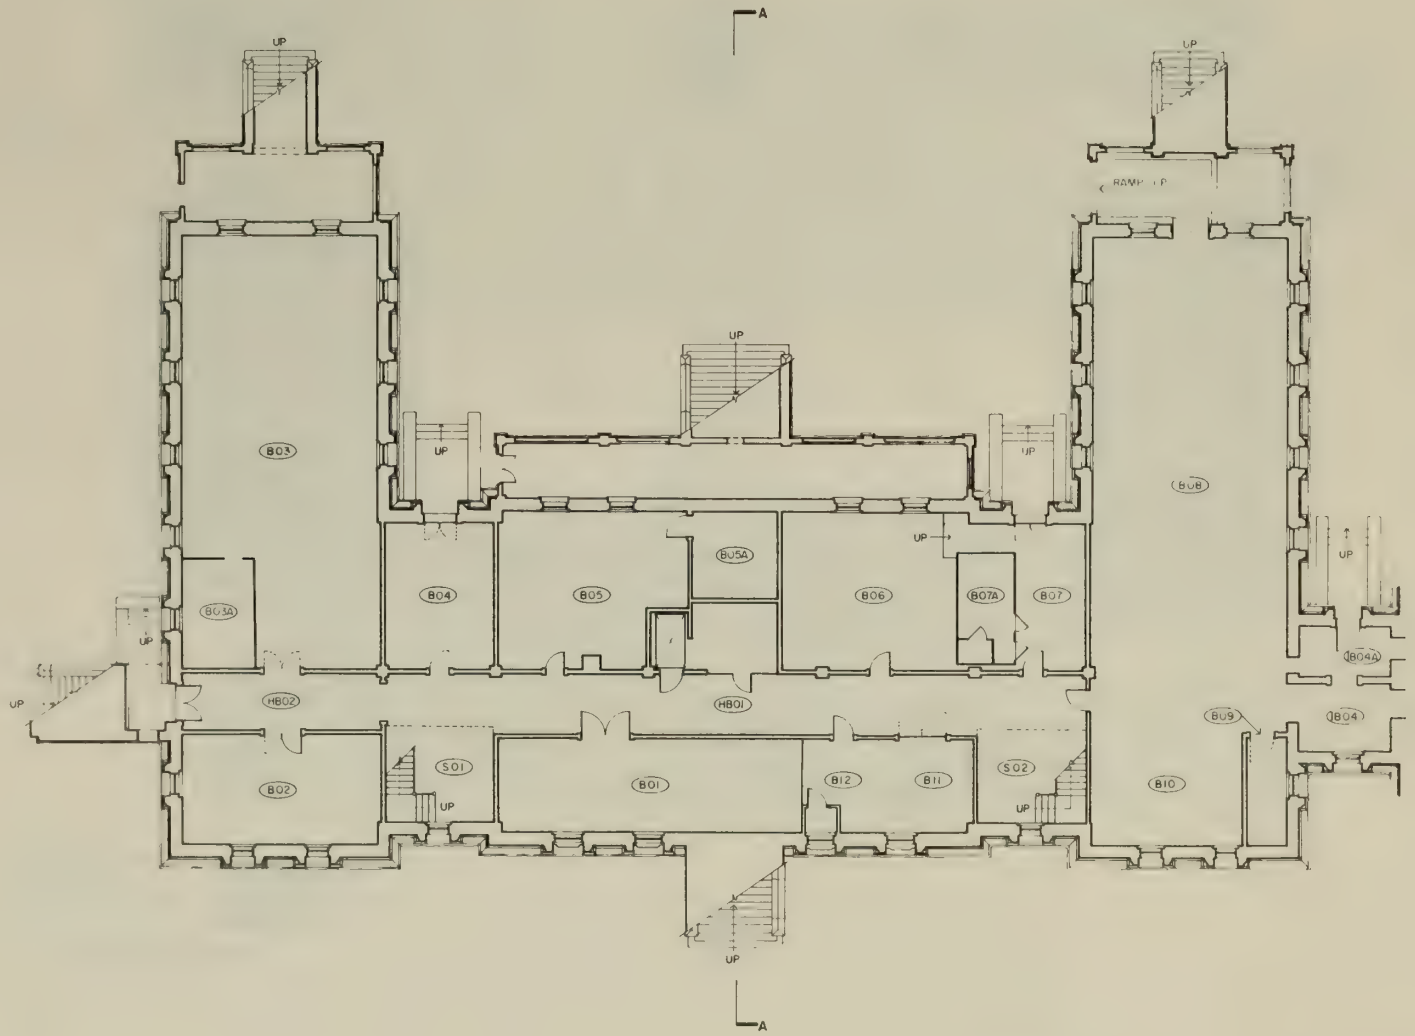

356 | 26,012 / 3 of 9
DSC | JUL 88

FEET 1/8"=1'-0" 8 0 8 16
METERS 1:96 3 2 1 0 1 2 3 4 5

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE / MOTTER FINEGOLD & ALEXANDER
41 EAST 11 STREET
NEW YORK, NY 10003
(212) 777-7800

STRUCTURAL ENGINEERS
ROBERT SILMAN ASSOCIATES, P.C.

MECHANICAL & ELECTRICAL ENGINEERS
SYSKA & HENNESSY INC.

SURVEY OF STRUCTURES UNIT 2

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | sht | REVISIONS | date | ap

DESIGNED | DATE
DRAWN K SARVER | TECH REVIEW

KEY

TITLE OF SHEET
NEW HOSPITAL EXT BASEMENT PLAN

SUB SHEET NO | DRAWING NO
PKG NO | SHEET OF

Exhibit 37

EXISTING CONDITIONS

GOOD
FAIR
POOR
DESTROYED

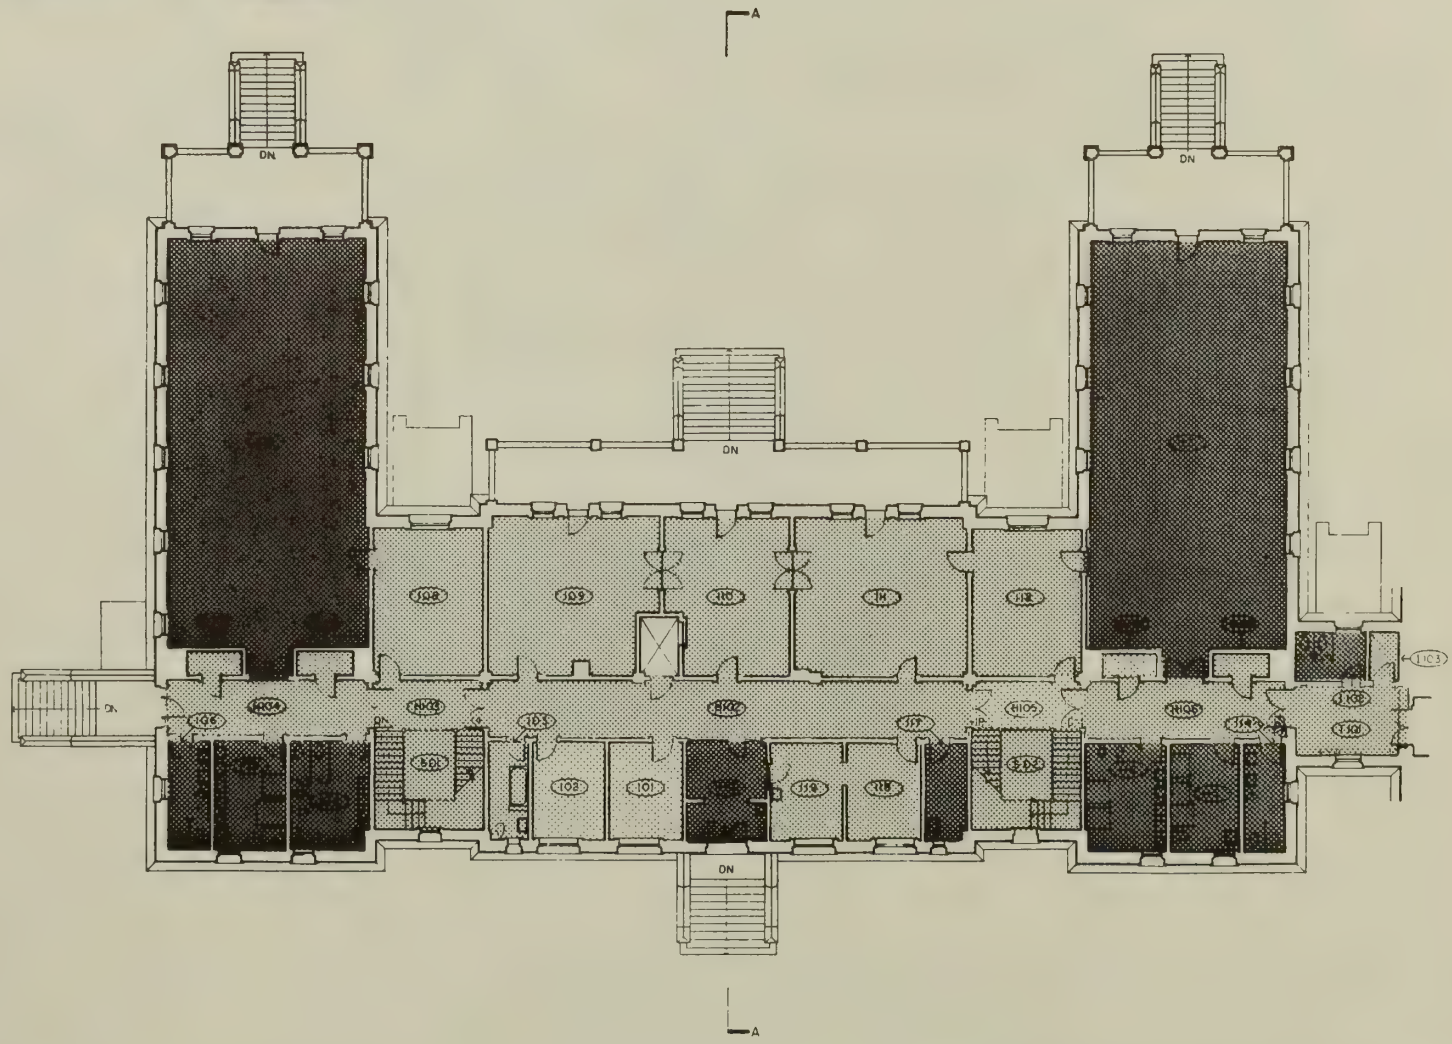

356 | 26,012 / 4 of 9
DSC | JUL 88

FEET 1:8 1:12
METERS 1:96

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE / MOTTER FINEGOLD & ALEXANDER
41 EAST 11 STREET
NEW YORK, NY 10003
(212) 777-7800

STRUCTURAL ENGINEERS
ROBERT SILMAN ASSOCIATES, P.C.

MECHANICAL & ELECTRICAL ENGINEERS
SYSKA & HENNESSY INC.

SURVEY OF STRUCTURES UNIT 2

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

REVISIONS

DESIGNED | DATE
DRAWN K SARVER | TECH REVIEW

KEY

TITLE OF SHEET
NEW HOSPITAL EXT. FIRST FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET OF

Exhibit 38

EXISTING CONDITIONS

GOOD
FAIR
POOR
DESTROYED

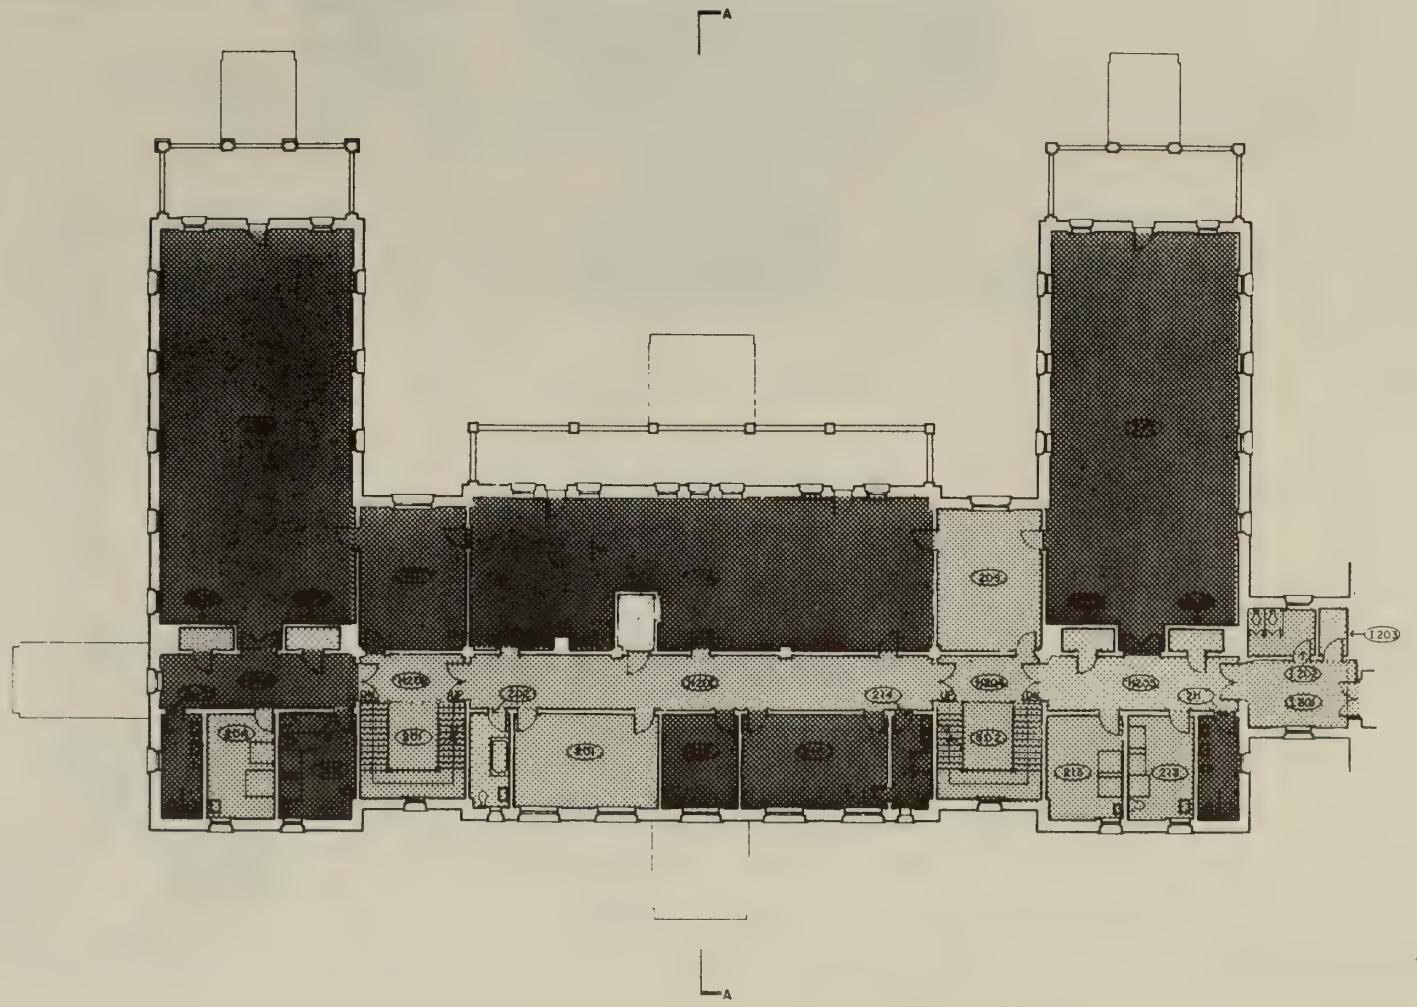

356 | 26,012 / 5 of 9
DSC | JUL 88

FEET 0
METERS 1 0 1 2 3 4 5

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE /
MOTTER FINEGOLD & ALEXANDER
41 EAST 11 STREET
NEW YORK, NY 10003
(212) 777-7800

STRUCTURAL ENGINEERS
ROBERT SILMAN ASSOCIATES, P.C.

MECHANICAL & ELECTRICAL ENGINEERS
SYSKA & HENNESSY INC.

SURVEY OF STRUCTURES UNIT 2

ELLIS ISLAND
STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

no | yr/d REVISIONS

DESIGNED | DATE
DRAWN: K SARVER | TECH REVIEW

KEY

TITLE OF SHEET
NEW HOSPITAL EXT.
SECOND FL PLAN

SUB SHEET NO | DRAWING NO
PKG NO | SHEET OF

Exhibit 39

EXISTING CONDITIONS

GOOD
FAIR
POOR
DESTROYED

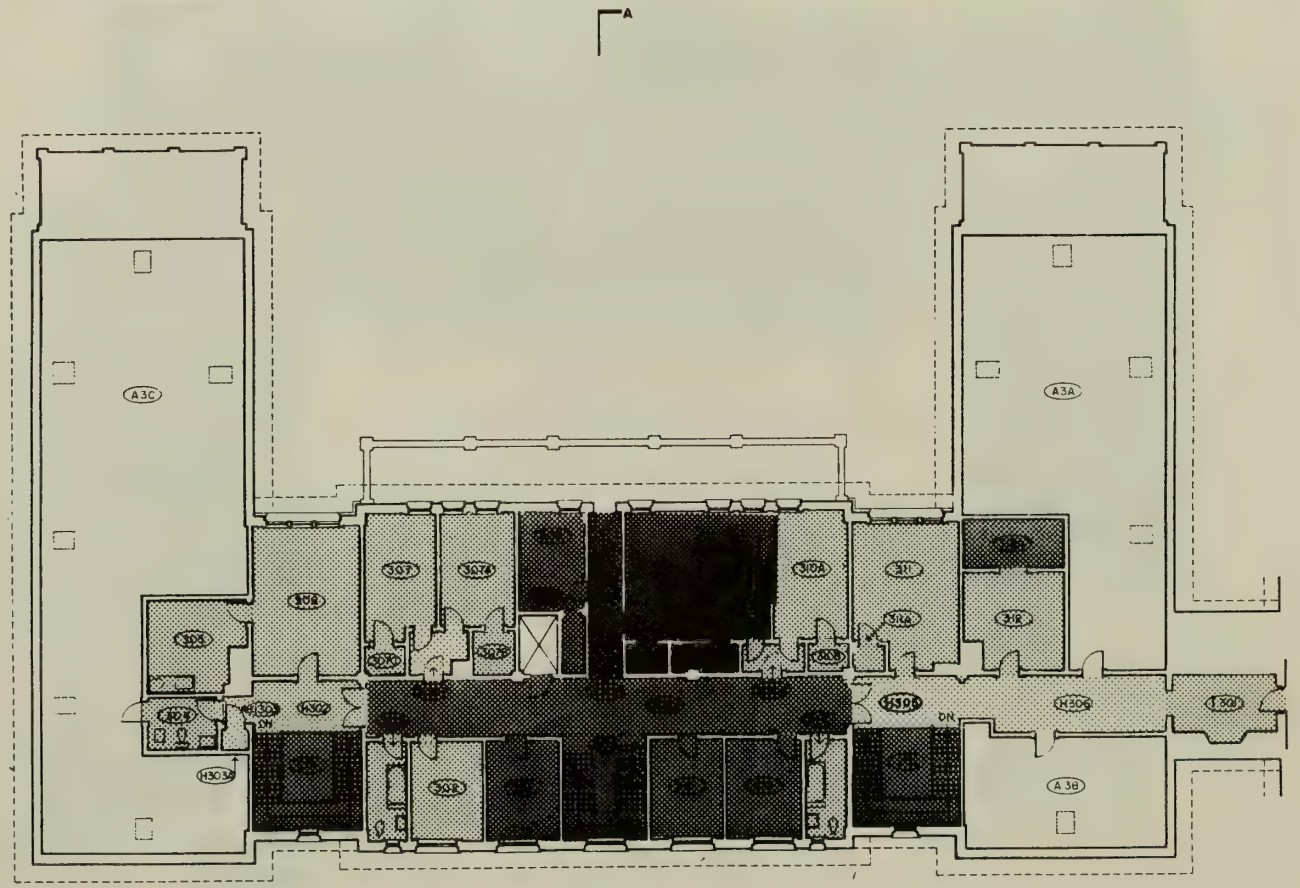

356 | 26,012 / 6 of 9
DSC | JUL 88

FEET 1/8"=1'-0"
METERS 1:96

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE / MOTTER FINEGOLD & ALEXANDER
41 EAST 11 STREET
NEW YORK, NY 10003
(212) 777-7800

STRUCTURAL ENGINEERS
ROBERT SILMAN ASSOCIATES, P.C.

MECHANICAL & ELECTRICAL ENGINEERS
SYSKA & HENNESSY INC.

SURVEY OF STRUCTURES UNIT 2

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

mk | a/n | REVISIONS | date | by

DESIGNED: | DATE:
DRAWN: K SARVER | TECH REVIEW:

KEY

TITLE OF SHEET
NEW HOSPITAL EXT
THIRD FL PLAN

SUB SHEET NO | DRAWING NO

SHEET
OF

Exhibit 40

ARCHITECTURAL SIGNIFICANCE

MOST
SOME
MINOR
NEGLIGIBLE

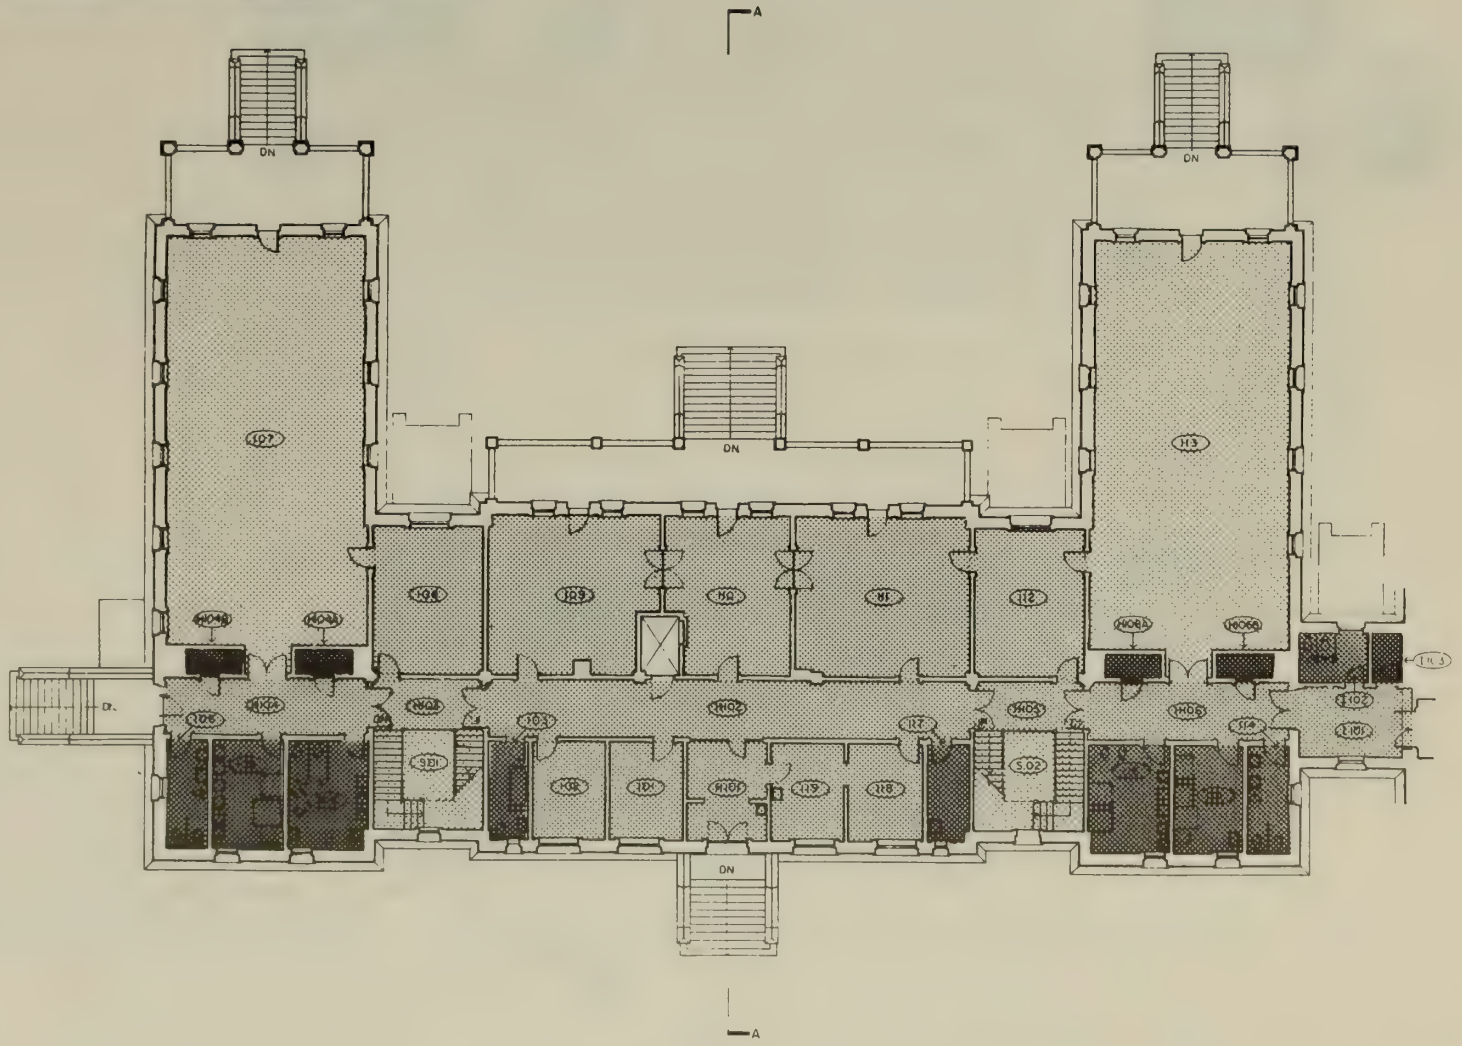

356 | 26,012 / 7 of 9
DSC | JUL 88

FEET
METERS

UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS
BEYER BLINDER BELLE / MOTTER FINEGOLD & ALEXANDER
41 EAST 11 STREET
NEW YORK, NY 10003
(212) 777-7800

STRUCTURAL ENGINEERS
ROBERT SILMAN ASSOCIATES, P.C.

MECHANICAL & ELECTRICAL ENGINEERS
SYSKA & HENNESSY INC.

SURVEY OF STRUCTURES UNIT 2

ELLIS ISLAND
STATUE OF LIBERTY NATIONAL MONUMENT
NEW YORK / NEW JERSEY

no. | by | REVISIONS | date | by

DESIGNED | DATE
DRAWN: K. SARVER | TECH REVIEW

KEY

TITLE OF SHEET
NEW HOSPITAL EXT. FIRST FLOOR PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET OF

ARCHITECTURAL SIGNIFICANCE

MOST | MINOR

SOME | NEGLIGIBLE

Exhibit 41

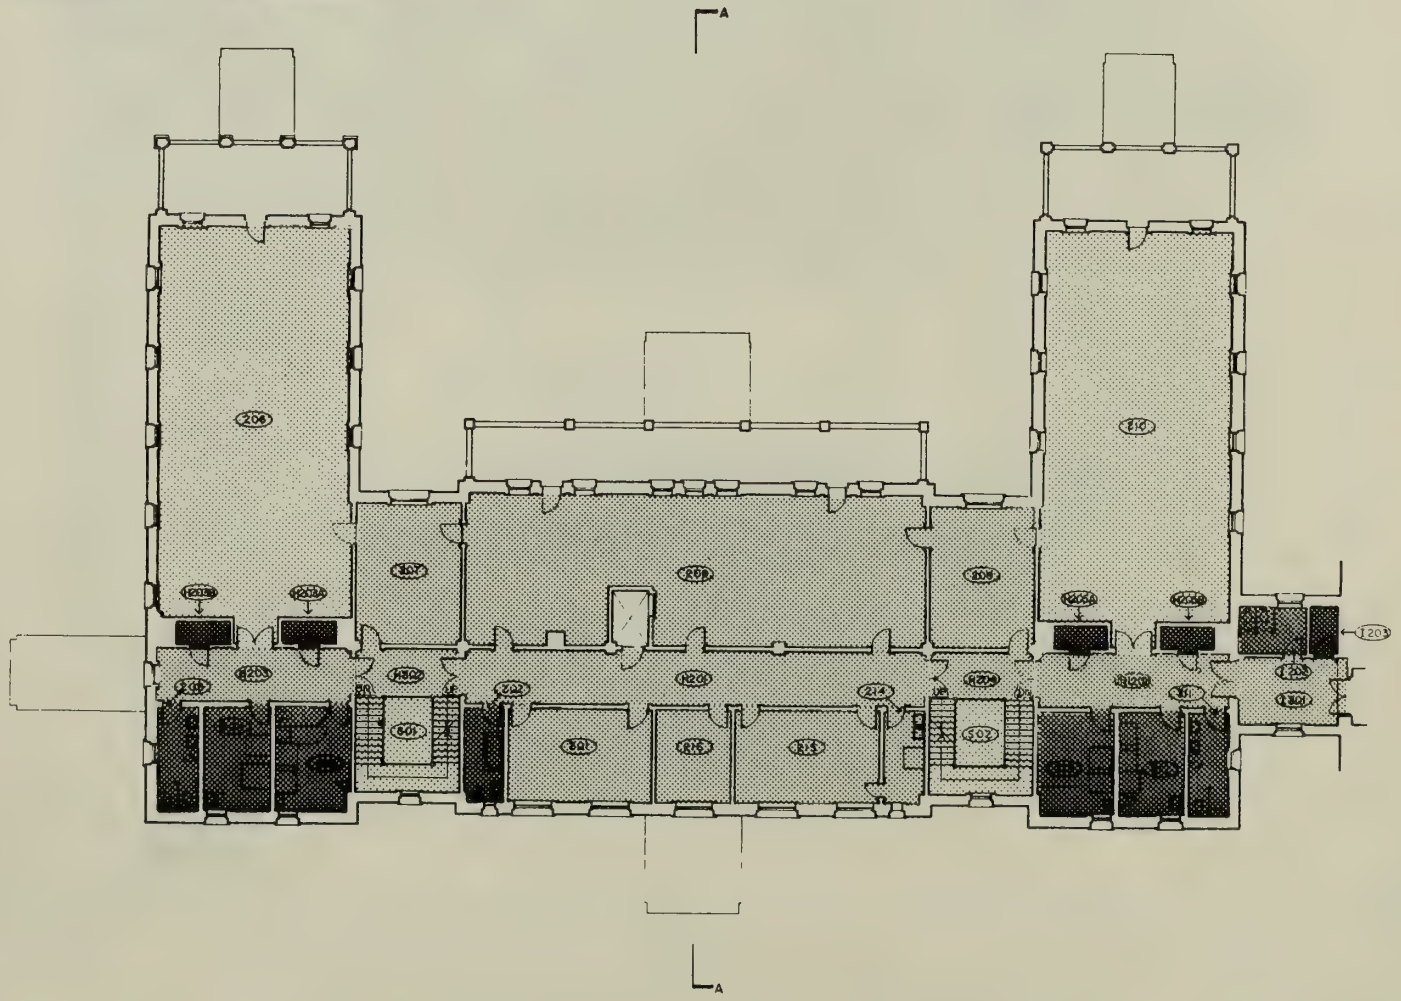

356 | 26,012 / 8 of 9

DSC | JUL 88

FEET /A

METERS 196

3 2 1 0 1 2 3 4 5

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BEYER BLINDER BELLE / MOTTER PINEGOLD & ALEXANDER

41 EAST 11 STREET
NEW YORK, NY 10003
(212) 777-7800

STRUCTURAL ENGINEERS

ROBERT SILMAN ASSOCIATES, P.C.

MECHANICAL & ELECTRICAL ENGINEERS

SYSKA & HENNESSY INC.

SURVEY OF STRUCTURES UNIT 2

ELLIS ISLAND

STATUE OF LIBERTY NATIONAL MONUMENT

NEW YORK / NEW JERSEY

no.	s/h	REVISIONS	Date

DESIGNED: | DATE:

DRAWN: K. SARVER | TECH REVIEW:

KEY

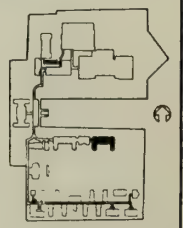

TITLE OF SHEET
NEW HOSPITAL EXT. SECOND FL PLAN

SUB SHEET NO | DRAWING NO

PKG NO | SHEET

ARCHITECTURAL SIGNIFICANCE

MOST | MINOR

SOME | NEGLIGIBLE

Exhibit 42

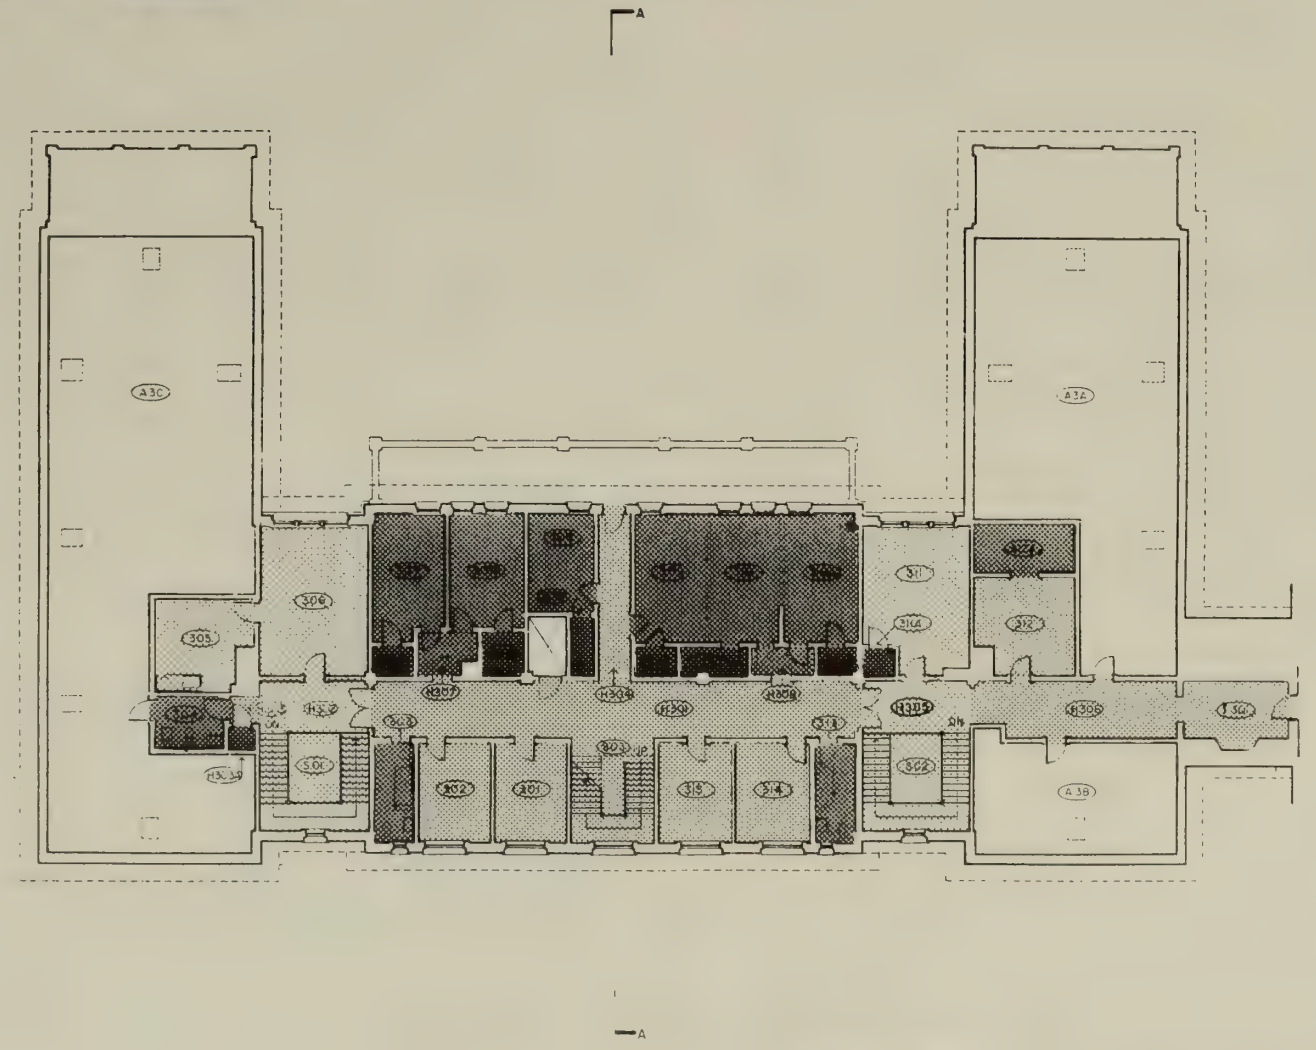

356 | 26,012 / 9 of 9

DSC | JUL 88

UNITED STATES DEPARTMENT OF THE INTERIOR

NATIONAL PARK SERVICE
DENVER SERVICE CENTER

ARCHITECTS

BETTER BLINDER BELLE /
MOTTER FINEGOLD & ALEXANDER

41 EAST 11 STREET
NEW YORK, NY 10003
(212) 777-7800

STRUCTURAL ENGINEERS

ROBERT SILMAN ASSOCIATES, P.C.

MECHANICAL & ELECTRICAL ENGINEERS

SYSKA & HENNESSY INC.

SURVEY OF STRUCTURES UNIT 2

ELLIS ISLAND

STATUE OF LIBERTY
NATIONAL MONUMENT
NEW YORK / NEW JERSEY

REVISIONS

DESIGNED | DATE

DRAWN | TECH REVIEW

KEY

TITLE OF SHEET
AREA HOSPITAL EXT.
THIRD FL PLAN

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 134

ROOM NO: Basement B01 through B12 **LAST KNOWN USE:** Maintenance/shop/ ~~mess hall/storage~~ **SQUARE FEET:** **CEILING HEIGHT:** **DATE:** 11/13/85

DESCRIPTION:

General:	Full basement partitioned into fourteen rooms with a corridor extending from the east exit to the administration building to the west. Allocated into a variety of room sizes with areas in the southern wings being single large spaces. Finish is generally plaster over brick and structural tile. Floors are poured in place. The basement contains an elevator equipment room and a walk-in refrigerator.	Condition:	Fair to poor condition. Plaster surfaces exhibit extensive spalling and loss. Poured flooring is in good condition. Metal surfaces are generally rusting.
Floors:	Poured concrete and the red-brown cementitious material standard throughout the upper floors.	Condition:	Good condition. Obscured by debris in some areas. Some overpainting.
Base:	Concrete and cementitious flooring material. Wood on some partition walls.	Condition:	Good. Some overpainting.
Walls:	Exterior wall structure is 3'-5" concrete below brick with plaster. Interior walls are wood and glass paneling, plywood, brick and painted plaster over brick.	Condition:	Fair to poor condition. Extensive spalling and loss of plastered surfaces. Wood paneling exhibits deteriorating finishes with some plywood in a destroyed condition.
Ceiling:	Plaster over structural tile.	Condition:	Severe deterioration, spalling and loss.
Doors/ Openings:	Doors: Wood veneer, paneled, plywood, wood screen doors some with wire glass lights and upper ventilation louvres. Wood surrounds. Wheelchair entrance south exit, west wing.	Condition:	Delamination of wood veneer, overpainting and loss due to removal.
Lighting:	Utility type: Bulbs suspended from electrical wiring, white ceramic ceiling mounts, green metal suspended ceiling fixtures, enameled 4-5" base ceiling type without glass globe.		

SUMMARY:

- [ ] Good
- [XXX] Fair
- [ ] Poor
- [ ] Destroyed

ARCHITECTURAL SIGNIFICANCE:

- [ ] Most
- [ ] Some
- [XXX] Minor
- [ ] Negligible

PHOTOGRAPHS: ① B03, View South ② B03, View North ③ B03A ④ HB02, South ROOM NO. Basement

PHOTOGRAPHS: (5) Door to B01 (6) B01, East (7) B11/B12, East (8) HB01 from S02 ROOM NO. Basement

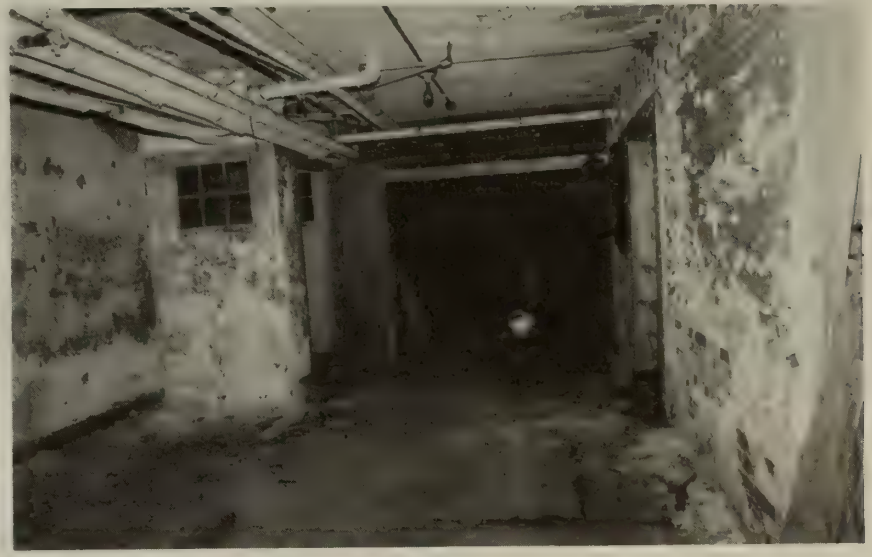

PHOTOGRAPHS: (9) B10, Northwest corner (10) B10, Northeast (11) B08, South ROOM NO. Basement

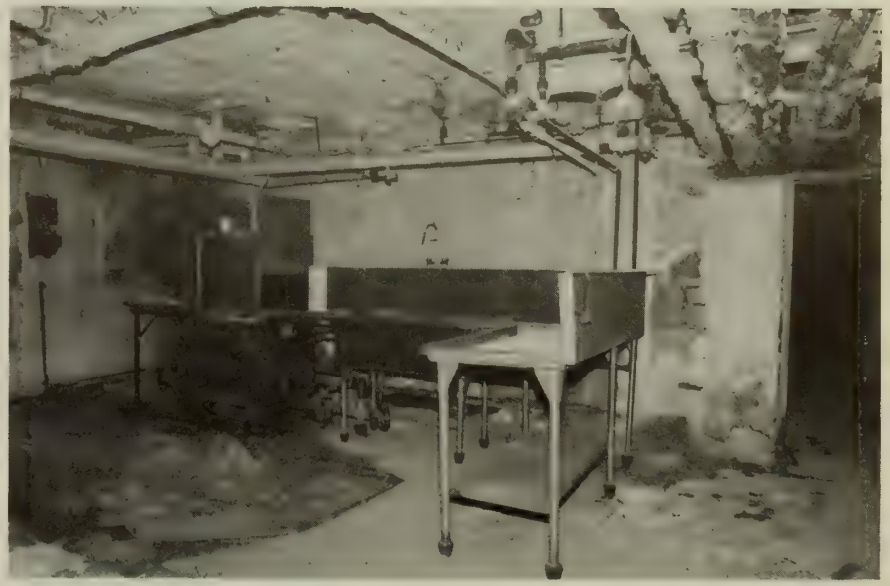

PHOTOGRAPHS: (12) 502, View Southeast. (13) Elevator. ROOM NO. Basement

PHOTOGRAPHS: (14) B02, View Southwest (15) B07, View North ROOM NO. Basement

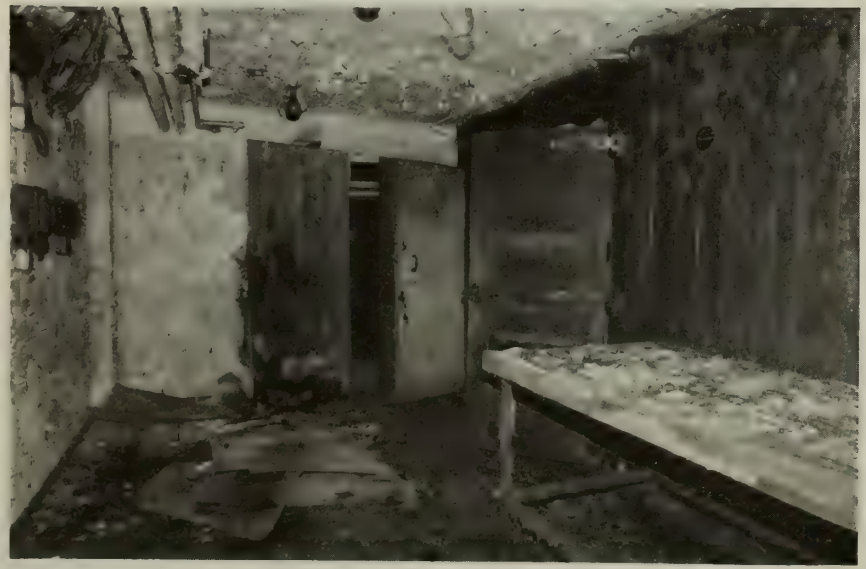

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 140

ROOM NO: 101 LAST KNOWN USE: Officer's room SQUARE FEET: 135 CEILING HEIGHT: DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: Standard	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Standard = red-brown cementitious material.
BASE:	Tile/Concrete Resilient Wood X Other: Standard	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Standard = red-brown cementitious material.
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	cove.
CEILING:	X Plaster Acoustic panels X Cove Other	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	Wood/Glass Paneled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Cupboard built onto rear of door. Opening mechanism for window transom.
LIGHTING:	X Incandescent/Type A 1 Intact Destroyed Incandescent/Type B Intact Destroyed X CML: Sconce 1 Intact Destroyed Other: Intact Destroyed	1900-1912 1913-1933 X 1934-present In question	1 white glass globe w/ gold pattern. 1 sconce.
HEATING/ VENTILATION PLUMBING:	X Radiators 1 Intact Destroyed X Vents: Fans 1 Intact Destroyed Sink/Toilet/Urinal Intact Destroyed Other: Intact Destroyed	X 1900-1912 1913-1933 1934-present X In question	1 wall-mounted rotary fan, W. wall.
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present X In question	1 varnished wood box w/ glass door mounted on W. wall. wood circle above box. "104" stenciled on door.
SUMMARY:		X Good Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS: (1) View North (2) View South ROOM NO. 101

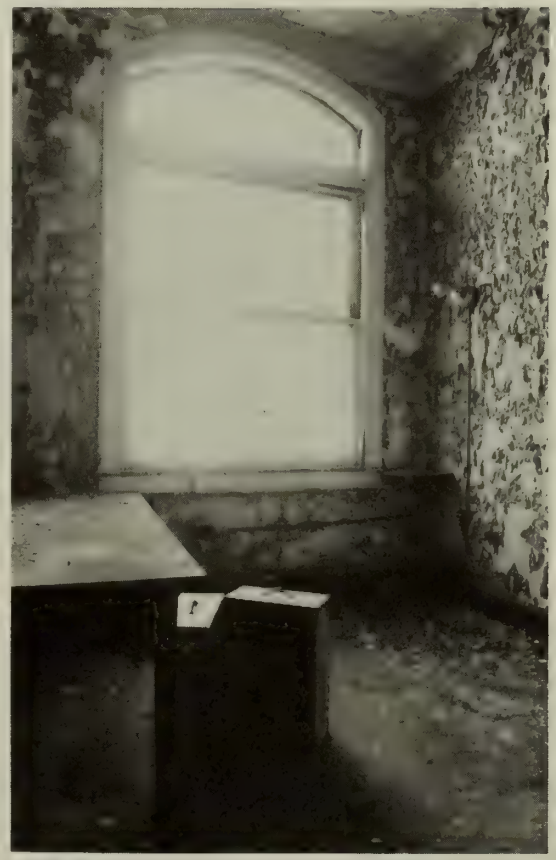

PHOTOGRAPHS: ③ west wall. ④ Wall-mounted rotary fan ROOM NO. 101

PHOTOGRAPHS:

ROOM NO. 101

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 144

ROOM NO: 102 LAST KNOWN USE: Officer's room SQUARE FEET: 135 CEILING HEIGHT: DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	cove.
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	cove.
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer (☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Door has mounted closet. Window has glass-paned air-deflector window shade intact.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	1 CML. 2 sconces.
HEATING/ VENTILATION PLUMBING:	☒ Radiators 1 ☒ Vents/Fans 1 ☐ Sink/Toilet/Urinal ☐ Other:	☒ Intact ☐ Destroyed ☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	1 wall-mounted rotary fan.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View North (2) View Southeast (3) Door with closet ROOM NO. 102

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 146

ROOM NO: 103 LAST KNOWN USE: Bathroom SQUARE FEET: 77 CEILING HEIGHT: DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good obscured. [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete cove [ ] Resilient [ ] Wood [ ] Other:	[ ] Good obscured [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster cove [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	plaster – fair cond. N. wall (exterior) structural tile visible.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Deterioration @ N. end.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Marble surrounds on window + interior door. "LADIES HEAD" stenciled on door.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/~~Urinal~~ [X] Other: tub	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 single pedestal sink 1 solid-side tub / shower curtain rod. 1 toilet.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	toilet paper holder. hooks on wall.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View North (2) View South ROOM NO. 103

PHOTOGRAPHS: (3) Stencil on door. ROOM NO. 103

PHOTOGRAPHS:

ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 150

ROOM NO: 104 LAST KNOWN USE: Toilet SQUARE FEET: 142 CEILING HEIGHT: 12'-3½" DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood Other: standard	Good Fair obscured Poor Destroyed	1900-1912 1913-1933 1934-present In question	
BASE:	Tile/Concrete Resilient Wood Other: standard	Good Fair Poor obscured Destroyed	1900-1912 1913-1933 1934-present In question	
WALLS:	Plaster cove Partitions Tile Wainscot Other:	Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	
CEILING:	Plaster Acoustic panels Cove Other	Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	Little plaster remains. Biological growth on exposed structural tile.
DOORS/ OPENINGS:	Wood/Glass Panelled Wood Veneer Galvanized Metal Other:	Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	
LIGHTING:	Incandescent/Type A Incandescent/Type B CML (Sconce) Other:	Intact / Destroyed Intact / Destroyed Intact / Destroyed Intact / Destroyed	1900-1912 1913-1933 1934-present In question	
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans Sink/Toilet/Urinal Other:	Intact / Destroyed Intact / Destroyed Intact / Destroyed Intact / Destroyed	1900-1912 1913-1933 1934-present In question	4 pedestal sinks. 1 wall-mounted sink. 2 urinals 2 toilets in rusting metal stalls.
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	
SUMMARY:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / Minor / Negligible

PHOTOGRAPHS: ① View Northeast ② View South ROOM NO. 104

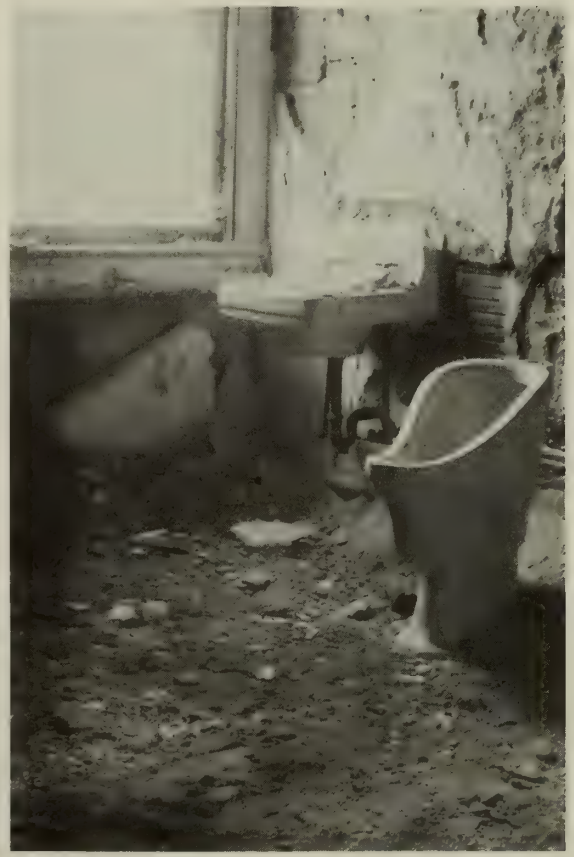

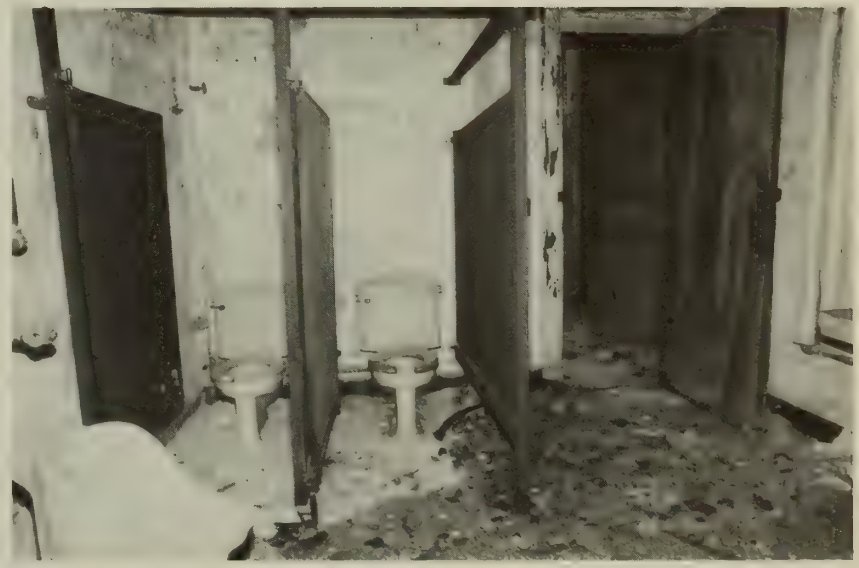

PHOTOGRAPHS: (3) View Northwest ROOM NO. 104

PHOTOGRAPHS:

ROOM NO. 104

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 154

ROOM NO: 105 LAST KNOWN USE: Bathroom SQUARE FEET: 142 CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good obscured [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Possible damage under added stall showers.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good obscured [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Plaster above wainscot - poor. Puncture in E. wall in wainscot over sinks.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Severe deterioration on N. side — exposed structural tiles.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble surrounds on door + window.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Bases intact - no shades.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [X] Destroyed	[ ] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	5 central pedestal sinks. 1 slop sink. 1 marble shower stall
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 metal shower stall. 1 original toilet paper roller. 1 4-prong hook attached to window surround.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View North ② View South ROOM NO. 105

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 156

ROOM NO: 106 LAST KNOWN USE: Toilet SQUARE FEET: 85 CEILING HEIGHT: DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Plaster above wainscot - destroyed. Tile in N/E corner - destroyed
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Structural tile completely exposed. Dripping water, green staining + biological growth.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer \ [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble surrounds on windows + door.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce \ [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Base intact - no shade.
HEATING/ VENTILATION PLUMBING:	[X] Radiators \ [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	2 rounded pedestal sinks. 2 toilets - 1 destroyed. 1 freestanding urinal.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 Toilet paper roller. Marbel stalls.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① Northeast corner ② View Northwest ROOM NO. 106

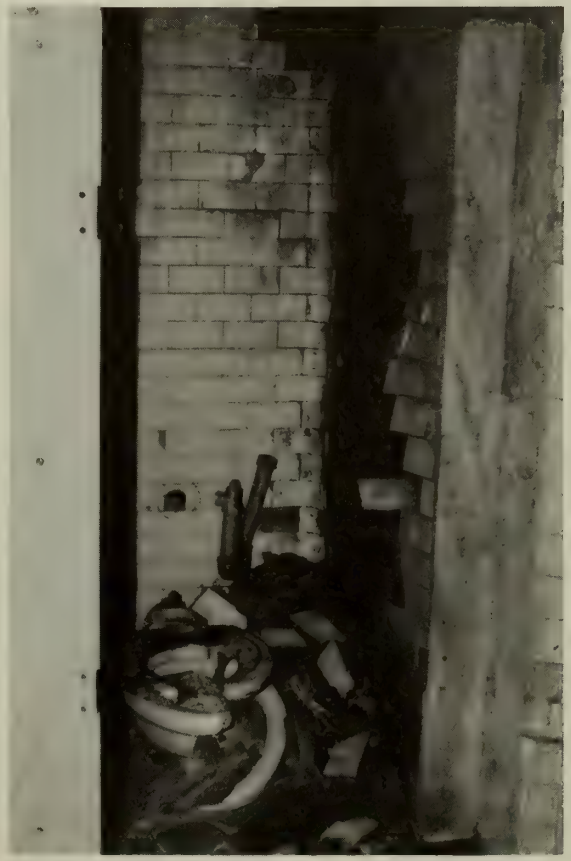

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 158

ROOM NO: 107 LAST KNOWN USE: Barracks SQUARE FEET: 1,534 CEILING HEIGHT: 12'-2½" DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Standard	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed Obscured	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Standard	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed Obscured	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Severe exposure of structural tile.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Severe exposure of structural tile.
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Severe delamination of all doors. 1 door completely destroyed.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	2 destroyed CMLs, large bulbs. 19 sconces, - 2 destroyed.
HEATING/ VENTILATION PLUMBING:	[X] Radiators 10 [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 transom fan above S. door. 2 wall-mounted rotary fans on N. wall. 10 floor-mounted sectional radiators.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View South ② View North ROOM NO. 107

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 160

ROOM NO: 108 LAST KNOWN USE: Cardiac clinic SQUARE FEET: 313 CEILING HEIGHT: DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: Standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	obscured.
BASE:	Tile/Concrete Resilient Wood X Other: Standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Obscured.
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Cove. Structural tile exposed on 3 walls.
CEILING:	X Plaster Acoustic panels X Cove Other	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Much exposure of structural tile.
DOORS/ OPENINGS:	Wood/Glass Panelled X Wood Veneer 2 Galvanized Metal Other:	Good Fair 1 Poor 1 Destroyed	X 1900-1912 1913-1933 1934-present In question	
LIGHTING:	Incandescent/Type A Incandescent/Type B X CML/Sconce Other:	Intact / Destroyed Intact / Destroyed X Intact / Destroyed Intact / Destroyed	1900-1912 X 1913-1933 X 1934-present In question	1 CML. 1 sconce, missing shade.
HEATING/ VENTILATION PLUMBING:	X Radiators/ Vents/Fans Sink/Toilet/Urinal Other:	X Intact / Destroyed Intact / Destroyed Intact / Destroyed Intact / Destroyed	X 1900-1912 1913-1933 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	
SUMMARY:		Good X Fair Poor Destroyed	X 1900-1912 X 1913-1933 X 1934-present In question	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS: (1) View South (2) View North ROOM NO. 108

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 162

ROOM NO: 109 LAST KNOWN USE: Conference room SQUARE FEET: 453 CEILING HEIGHT: DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	Rolled linoleum over standard flooring.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Exterior (S.) wall destroyed. 3 other walls, fair cond.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	S. door has glazed upper half & square transom light above.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 wall-mounted rotary fan.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Plywood squares mounted high on E. wall.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View Southwest ② View North ③ View East ROOM NO. 109

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 164

ROOM NO: 110 LAST KNOWN USE: Pantry SQUARE FEET: 359 CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair Obscured [X] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Rolled linoleum over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Standard	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster cove [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile exposed @ S. end. Ghost of sink on W. wall. Ghost of possible shelving.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile exposed @ S. end.
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	2 pairs of veneer push double doors - painted black base. 1 door with glazed upper half.
LIGHTING:	[ ] Incandescent/Type A [X] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [2] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	2 lamps w/ metal shades, large bulbs, white string pulls.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 wall-mounted rotary fan w/ cover.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Wood elevator door opens into space on E. wall. "105" stenciled on door.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View Southeast ② View East ③ View North ④ View West ROOM NO. 110

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 166

ROOM NO: 111 LAST KNOWN USE: Dining room SQUARE FEET: 528 CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Rolled linoleum over Standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Standard	[X] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Structural tile exposed @ S. end.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Structural tile exposed @ S. end
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 set double doors: E. wall · White paint. 1 single veneer door: W. wall - destroyed. 1 single door w/ transom: N. wall - poor. 1 single door w/ light + transom: S. wall - poor.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators 1 [X] Vents (Fans) 2 [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	2 wall mounted rotary fans w/ covers, N. wall
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 plywood square above double doors on E. wall. 1 wood panel, 24" wide - veneer w/ severe delamination, NE corner.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View Southeast ② View North ③ View West ROOM NO. 111

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 168

ROOM NO: 112 LAST KNOWN USE: Doctors Office SQUARE FEET: 323 CEILING HEIGHT: DATE: 7 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster cove. ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Structural Tile exposed, SE corner. Ghost: gold rectangle 8½×12": N. wall adjacent to door + fan.
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Structural tile exposed in SE corner.
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer 3 ☐ Galvanized Metal ☐ Other:	1 Good ☐ Fair 2 Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	1 door W. wall / white over paint – good. 1 door E. – poor. 1 door N. – destroyed. Door + window frames: White paint.
LIGHTING:	☒ Incandescent/Type A 1 Intact ☐ Destroyed ☐ Incandescent/Type B ☐ Intact ☐ Destroyed ☒ CML/Sconce 1 Intact ☐ Destroyed ☐ Other: ☐ Intact ☐ Destroyed		☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators 1 ☒ Intact ☐ Destroyed ☒ Vents/Fans 1 ☒ Intact ☐ Destroyed ☐ Sink/Toilet/Urinal ☐ Intact ☐ Destroyed ☐ Other: ☐ Intact ☐ Destroyed		☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	1 wall-mounted rotary fan w/ cover. ghost of removed sink – pipe, 24" from floor; E. wall.
MISCELLANEOUS:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	Dark green cloth window shade w/ string covered circular pull.
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View South (2) View North ROOM NO. 112

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 170

ROOM NO: 113 LAST KNOWN USE: Barracks SQUARE FEET: CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	rolled linoleum over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Standard	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile exposed on all walls except NE. corner. Ghost: NW - tan rectangle 4'x2'6".
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Random exposed struct. tiles. intact NE corner.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer 3 [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 double door to hall - poor; white overpaint, dark painted base. 1 door, E. Wall, 1' high painted base. 1 door, S. wall, 1' high painted base.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [X] Other: sconce	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 1 Intact 1 Destroyed 16 Intact 2 Destroyed	[ ] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	sconces have bases overpainted w/ tan paint - no shades.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	9 Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	4 wall-mounted rotary fans 1 window fan over S. door.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View South (2) View North ROOM NO. 113

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 172

ROOM NO: 114 LAST KNOWN USE: Toilet SQUARE FEET: 85 CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good obscured [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Plaster above wainscot in poor cond. destroyed in NW corner, structural tile exposed.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Most structural tile exposed at North end.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Window + door surrounds - marble with white overpaint. Door painted white. Door surround destroyed, but remains in room.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	sconce has shade.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	2 single pedestal sinks, damaged + rusting - no fixtures. 1 urinal, plumbing destroyed, base good. 2 toilets, without plumbing.
MISCELLANEOUS:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	marble stalls w/ wood veneered swinging doors.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View North (2) View South ROOM NO. 114

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 174

ROOM NO: 115 LAST KNOWN USE: Bathroom SQUARE FEET: 142 CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	X Tile/Concrete Resilient Wood Other:	Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	obscured by debris.
BASE:	X Tile/Concrete Resilient Wood Other:	Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	obscured.
WALLS:	Plaster Partitions X Tile Wainscot Other:	X Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Tile - good cond. Plaster: structural tile exposed N. section.
CEILING:	X Plaster Acoustic panels X Cove Other	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	structural tile exposed N. end.
DOORS/ OPENINGS:	Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Marble window and door surrounds w/ white overpaint. Door stencil - "HEAD" - exterior.
LIGHTING:	X Incandescent/Type A Incandescent/Type B X CML/Sconce Other:	Intact | Destroyed Intact Destroyed Intact | Destroyed Intact Destroyed	1900-1912 1913-1933 X 1934-present In question	globe missing from Incandescent A. 1 broken wall sconce — not standard type.
HEATING/ VENTILATION PLUMBING:	X Radiators | Vents/Fans X Sink/Toilet/Urinal X Other: showers	X Intact Destroyed Intact Destroyed X Intact Destroyed X Intact Destroyed	1900-1912 X 1913-1933 X 1934-present In question	1 slop sink. 2 destroyed sinks. 1 toilet. 1 marble shower stall, 2 metal.
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 X 1934-present In question	stencil on S wall "H53". 2 cans of leaking chemicals.
SUMMARY:		Good Fair X Poor Destroyed	X 1900-1912 X 1913-1933 X 1934-present In question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS: ① View North ② View South ROOM NO. 115

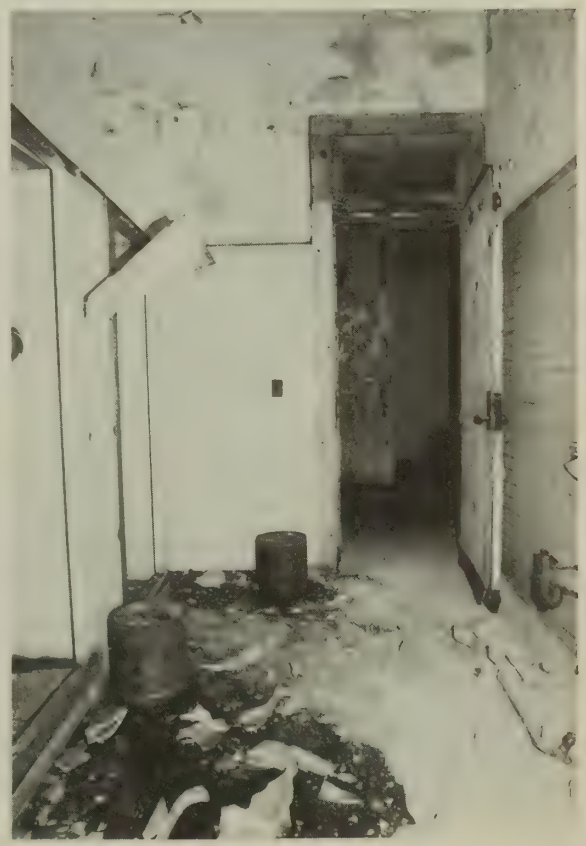

PHOTOGRAPHS: (3) View Southeast. (4) sink, Southwest corner. ROOM NO. 115

PHOTOGRAPHS:

ROOM NO. 115

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 178

ROOM NO: 116 LAST KNOWN USE: Employee's Washroom SQUARE FEET: 142 CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: standard	Good Fair obscured Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
BASE:	Tile/Concrete Resilient Wood X Other: standard	Good Fair obscured Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	structural tile exposed N end. 2 boards attached above sinks/ lower one has hooks.
CEILING:	X Plaster Acoustic panels X Cove Other	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	structural tile exposed N. end.
DOORS/ OPENINGS:	Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	wood door and window ornaments, white overpaint.
LIGHTING:	X Incandescent/Type A Incandescent/Type B CML/Sconce Other:	Intact / Destroyed Intact / Destroyed Intact / Destroyed Intact / Destroyed	1900-1912 1913-1933 X 1934-present In question	
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans X Sink/Toilet/Urinal X Other: showers	1 Intact / Destroyed Intact / Destroyed X Intact / X Destroyed X Intact / Destroyed	X 1900-1912 X 1913-1933 X 1934-present In question	5 center pedestal sinks - 2 destroyed. 2 urinals. 2 metal stall showers.
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 X 1934-present In question	stenciled door signage - "HEAD."
SUMMARY:		Good Fair X Poor Destroyed	X 1900-1912 X 1913-1933 X 1934-present In question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS: (1) View South (2) View West (3) View North ROOM NO. 116

PHOTOGRAPHS: (4) showers, View Northeast ROOM NO. 116

PHOTOGRAPHS:

ROOM NO. 116

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 182

ROOM NO: 117 LAST KNOWN USE: Bathroom SQUARE FEET: 77 CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Tile destroyed in NW corner. structural tile exposed on N wall.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Greatest deterioration towards N wall.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble surrounds: doors and windows.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators 1 [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 unusual wall-mounted sink on brass supports. 1 toilet — broken base.
MISCELLANEOUS:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 large metal cabinet — Rusted. 1 original (?) toilet paper holder.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View North. (2) Cabinet, East wall. ROOM NO. 117

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 184

ROOM NO: 118 LAST KNOWN USE: Dental clinic SQUARE FEET: 135 CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient Vinyl [ ] Wood [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Standard	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Some structural tile exposed N. & E. walls. ghost of mirror or cabinet above sink; W. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile exposed NE corner. electric conduit in metal housing - rusted.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	w/ clear glass transom.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	fine example.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [X] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 single-pedestal medical sink w/ through indentations; molded ledge: vandalized.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 switch plate mounted on panel on S wall; 1 elevator key box. 1 semi-circular shelf or ogee bracket. 1 beveled-edge strip w/ 4 hooks behind door.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View North (2) View South (3) View East (4) sink ROOM NO. 118

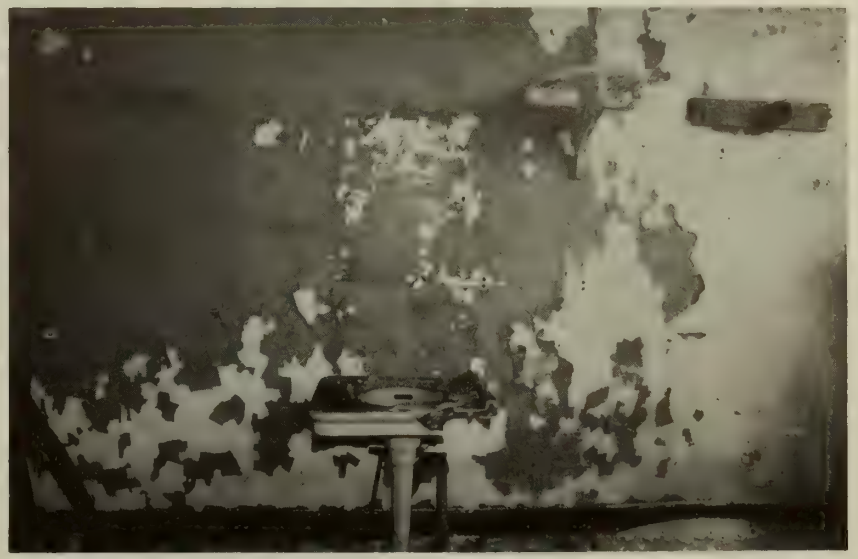

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 186

ROOM NO: 19 LAST KNOWN USE: Dental clinic SQUARE FEET: 135 CEILING HEIGHT: DATE: 7 Nov 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient vinyl [ ] Wood [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Ver standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Partially obscured by plaster debris.
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Some structural tile exposed N and E walls. E Wall - unstable.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile exposed: N. end. General surface cracking
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	No door: wood eframement on marble base, E wall. Arched window w/ air deflector.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Cake shaped globe.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 wall-mounted sink: fixtures missing. 1 wall-mounted rotary fan w/ cover. (switch on wood plaque below).
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 wood shelf on metal bracket: (approx 22" above floor). 1 wood shelf on wood brackets: W wall. 2 wood cylendars on wall above sink for mirror or shelf.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View North (2) View East ROOM NO. 119

PHOTOGRAPHS: (3) View West

ROOM NO. 119

PHOTOGRAPHS:

ROOM NO. 119

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 190

ROOM NO: H101 LAST KNOWN USE: Dental Laboratory SQUARE FEET: 147 CEILING HEIGHT: DATE: 7 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient linoleum [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [X] Wood [X] Other: standard	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	wood base on partition wall: S, the rest, standard.
WALLS:	[X] Plaster [X] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	S wall - wood + glass panel partition. Exposed lath of infilled door, E. wall.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Most structural tile exposed.
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	"106" stenciled on S. door.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 radiator - in front of original main entry door N. wall. 1 slop sink.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	3 gas spigots. 1 wood laboratory table w/ drawers.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) view Northwest (2) view North (3) view Northeast ROOM NO. H101

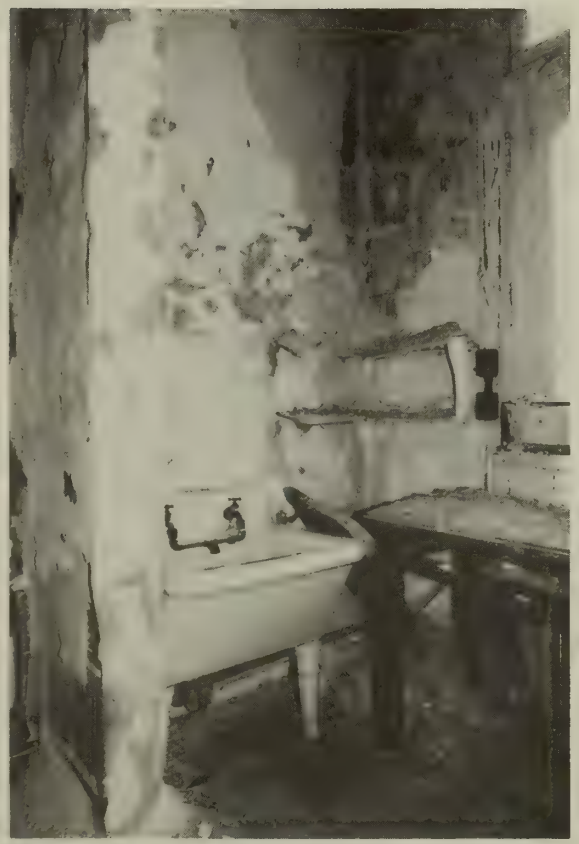

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 192

PHOTOGRAPHS: (4) View South (5) East wall, infilled door. ROOM NO. H101

PHOTOGRAPHS:

ROOM NO. H101

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 194

ROOM NO: H102 LAST KNOWN USE: Corridor SQUARE FEET: 521 CEILING HEIGHT: 12'-5½" DATE: 7 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	(Tile)/Concrete X Resilient Wood Other:	Good Fair Poor X Destroyed	1900-1912 1913-1933 1934-present X In question	over standard.
BASE:	Tile/Concrete Resilient X Wood X Other: standard	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	wood base @ partition to H101.
WALLS:	X Plaster X Partitions Tile Wainscot Other:	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present In question	some damage at elevator door. exposed structural tile above N. entry partition.
CEILING:	X Plaster Acoustic panels X Cove Other	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	exposed structural tile near N. entry partition.
DOORS/ OPENINGS:	X Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	X Good X Fair X Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	1 metal elevator door: fair 1 wood panelled door to N. entry: good 8 single veneer doors to rooms: see indiv. forms. 2 prs. double doors: safety glass lights.
LIGHTING:	Incandescent/Type A Incandescent/Type B X CML/Sconce X Other:	Intact Destroyed Intact Destroyed 1 Intact Destroyed 1 Intact Destroyed	1900-1912 1913-1933 X 1934-present In question	1 globe on rod extending from wall above elevator. 1 CML w/ white base + flared glass shade.
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans Sink/Toilet/Urinal Other:	1 Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	X 1900-1912 1913-1933 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present X In question	1 fire alarm 1 circuitry box 1 plaque for fire extinguisher.
SUMMARY:		Good X Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS: ① View West ② View East ROOM NO. H102

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 196

ROOM NO: H103 LAST KNOWN USE: Corridor SQUARE FEET: 118 CEILING HEIGHT: DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair obscured ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair obscured ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Black painted dado line 6'-10" from floor.
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	2 pairs double doors; safety glass lights and transoms. Veneer doors to rooms.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ CM/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed \ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	| Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	1 "Faraday" fire alarm. 1 fire extinguisher leaning on top of radiator.
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: ① View West

ROOM NO. H103

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 198

ROOM NO: H104 LAST KNOWN USE: Corridor SQUARE FEET: 217 CEILING HEIGHT: 12'-2½" DATE: 6 Nov 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[X] Good [ ] Fair [ ] Poor obscured [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[X] Good [ ] Fair [ ] Poor obscured [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Board attached to N. wall between rms. 104 and 105.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	General loosened plaster.
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	2 pairs double doors w/ double transoms 5 single veneer doors to rms. E. exit: glass panelled door w/ sidelights and transom.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce (5) [X] Other: 1	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Red light bulb over E. exit. CML w/ glass flared shade.
HEATING/ VENTILATION PLUMBING:	[X] Radiators (1) [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 fire hose cabinet. 1 fire extinguisher plaque.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View East ② Door to 107 ③ View West ROOM NO. H104

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 200

ROOM NO: H104A LAST KNOWN USE: closet SQUARE FEET: 28 CEILING HEIGHT: DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☒ Other: standard	☒ Good ☐ Fair obscured ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☒ Other: standard	☒ Good ☐ Fair obscured ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	supports for shelving on walls exposed structural tiles in lower areas.
CEILING:	☒ Plaster ☒ Acoustic panels ☒ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	transom - light.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	fire equipment box opening into hallway.
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. H104A

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 202

ROOM NO: H104B LAST KNOWN USE: closet SQUARE FEET: 28 CEILING HEIGHT: DATE: 6 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: standard	X Good Fair obscured Poor Destroyed	✓ 1900-1912 1913-1933 1934-present In question	Black overpaint.
BASE:	Tile/Concrete Resilient Wood X Other: standard	X Good Fair obscured Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	X Good Fair Poor Destroyed	✓ 1900-1912 1913-1933 1934-present In question	supports for shelves. support for clothes rod. Hooks on beaded backboard. Cracks in S. wall.
CEILING:	X Plaster Acoustic panels X Cove Other	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Transom with clear glass light.
LIGHTING:	Incandescent/Type A Incandescent/Type B X CML/Sconce I Other:	Intact Destroyed Intact Destroyed X Intact Destroyed Intact Destroyed	1900-1912 1913-1933 X 1934-present In question	missing shade.
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans Sink/Toilet/Urinal Other:	Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1912 1913-1933 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	
SUMMARY:		Good X Fair Poor Destroyed	✓ 1900-1912 1913-1933 X 1934-present In question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / Minor / X Negligible

PHOTOGRAPHS:

ROOM NO. H104B

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 204

ROOM NO: H105 LAST KNOWN USE: Corridor SQUARE FEET: CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	(Tile/Concrete) / X Resilient linoleum / Wood / Other:	Good / Fair / X Poor / Destroyed	Not checked / 1900-1912 / 1913-1933 / 1934-present / X In question	over standard
BASE:	Tile/Concrete / Resilient / Wood / X Other: Standard	X Good / Fair / Poor / Destroyed	X 1900-1912 / 1913-1933 / 1934-present / In question	
WALLS:	X Plaster / Partitions / Tile Wainscot / Other:	X Good / Fair / Poor / Destroyed	X 1900-1912 / 1913-1933 / 1934-present / In question	
CEILING:	X Plaster / Acoustic panels / X Cove / Other	X Good / Fair / Poor / Destroyed	X 1900-1912 / 1913-1933 / 1934-present / In question	
DOORS/ OPENINGS:	X Wood/Glass Paneled / X Wood Veneer / Galvanized Metal / Other:	X Good / Fair / X Poor / Destroyed	X 1900-1912 / 1913-1933 / 1934-present / In question	2 pairs double push doors w/ safety glass: lights, transoms: Good Door to rm. 112: Veneer, poor cond.
LIGHTING:	Incandescent/Type A / Incandescent/Type B / X (CML)/Sconce (/ Other:	Intact / Destroyed / X Intact / Destroyed / Intact / Destroyed / Intact / Destroyed	1900-1912 / 1913-1933 / X 1934-present / In question	No shade.
HEATING/ VENTILATION PLUMBING:	Radiators / Vents/Fans / Sink/Toilet/Urinal / Other:	Intact / Destroyed / Intact / Destroyed / Intact / Destroyed / Intact / Destroyed	1900-1912 / 1913-1933 / 1934-present / In question	
MISCELLANEOUS:		Good / Fair / Poor / Destroyed	1900-1912 / 1913-1933 / 1934-present / X In question	fire alarm: "ACme F.A.CO. N.Y." fire hose in semi-circular iron support - S. wall.
SUMMARY:		X Good / Fair / Poor / Destroyed	X 1900-1912 / 1913-1933 / X 1934-present / X In question	**ARCHITECTURAL SIGNIFICANCE:** X Most / Some / Minor / Negligible

PHOTOGRAPHS: (1) View East.

ROOM NO. H105

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 206

ROOM NO: H106 LAST KNOWN USE: Corridor SQUARE FEET: 213 CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Linoleum over standard
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 double door to ward : poor. 1 double door : E. - see H105. 1 double door : W - fair 3 single doors to rooms : see rm. forms. Doors painted white.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce 1 [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Glazed glass shade.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Fire-hose box w/ glass door : hose on floor. Circuit box - S. wall
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Small red arched plaque - S. wall. Fire alarm : S. wall. Ghosts of small objects attached to frame of H106A door.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) Fire-hose box.

ROOM NO. H106

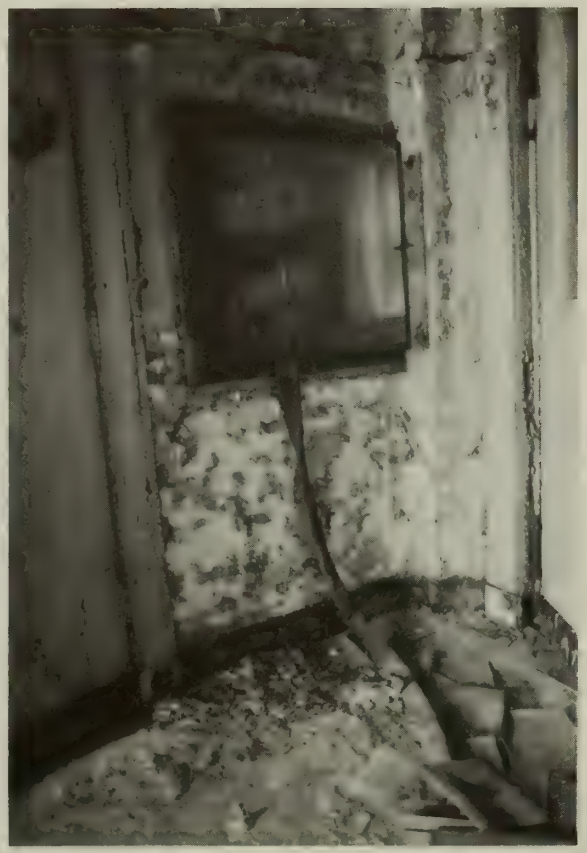

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 208

ROOM NO: H106A LAST KNOWN USE: closet SQUARE FEET: 28 CEILING HEIGHT: DATE: 7 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	shelving supports attached to walls. 1 gray shelf: 9' above floor. 3 hooks on board on W. wall. Ghosts of other shelves.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CM1/Sconce 1 [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Box for fire hose of H106 built into wall.
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. H106A

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 210

ROOM NO: H106B LAST KNOWN USE: closet SQUARE FEET: 28 CEILING HEIGHT: DATE: 7 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	covered by leaking chemicals.
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	1 shelf, supports for 2 others. Beaded board approx. 4' from floor w/ hooks attached.
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
LIGHTING:	☐ Incandescent/Type A ☒ Intact ☐ Destroyed ☐ Incandescent/Type B ☐ Intact ☐ Destroyed ☒ CML/Sconce ☐ Intact ☐ Destroyed ☐ Other: ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question		
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	7 Leaking cans of "U.S. Foam Liquid 5.0"
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View South

ROOM NO. H106B

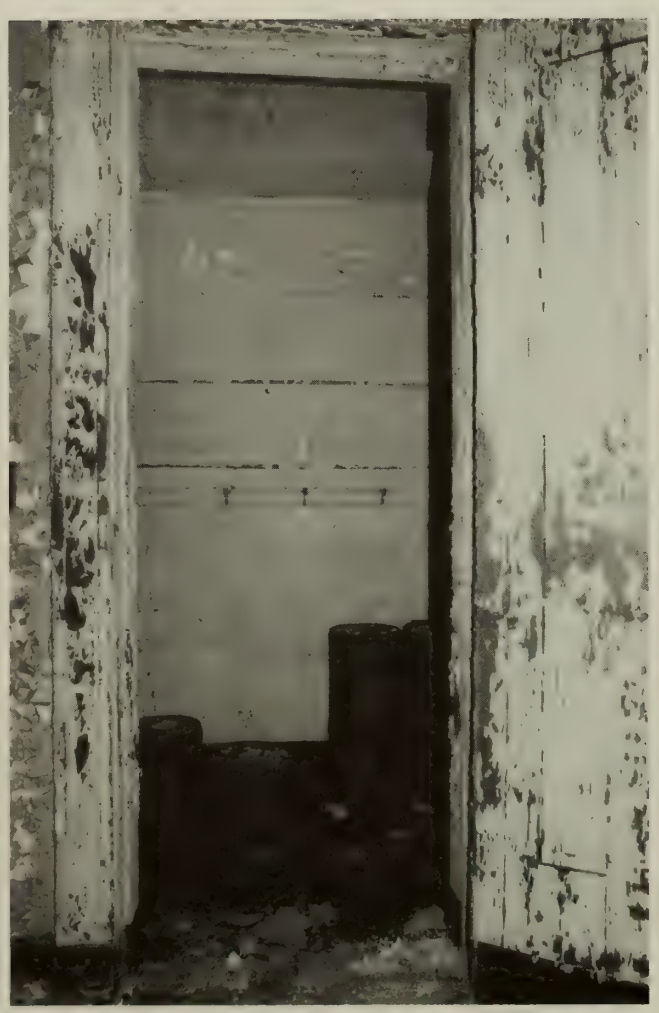

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 212

ROOM NO: 1101 LAST KNOWN USE: Hallway SQUARE FEET: CEILING HEIGHT: DATE: 8 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [X] Resilient linoleum [ ] Wood [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Double Metal doors w/ glass lights connect w/ Administration building.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	area used as storage space for 12 radiators; 1 safe; 2 radiator covers.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Exterior wall of Administration Bldg. exposed on West wall. Arched window w/ limestone Keystone infilled to become doorway.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View West

ROOM NO. I101

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 214

ROOM NO: I102 LAST KNOWN USE: Toilet SQUARE FEET: CEILING HEIGHT: DATE: 8 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	white hexagonal tiles.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	ghosts of 2 sinks.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble window + door surrounds.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CM/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 wall-mounted base. 1 Ceiling-mounted fixture without shade.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 wall-mounted sectional radiator 2 toilets.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble stalls w/ wood double swinging doors. Latches, when closed say "occupied."
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View Southeast (2) View Southwest ROOM NO. I102

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 216

ROOM NO: I103 LAST KNOWN USE: Slop room SQUARE FEET: CEILING HEIGHT: DATE: 8 Nov. 1995

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	plaster above wainscot: poor cond.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Interior marble door surround. Dutch door with mail slot.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Capped pipes and marks for fixtures on South wall.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) Dutch door.

ROOM NO. I103

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 218

ROOM NO: 201 LAST KNOWN USE: cystoscopy room SQUARE FEET: 277 CEILING HEIGHT: DATE: 8 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer 2 ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Both doors stencilled "200."
LIGHTING:	☒ Incandescent/Type A ☐ Incandescent/Type B ☒ CML/Sconce 1 ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	2 type A lamps with cake shaped globes.
HEATING/ VENTILATION PLUMBING:	☒ Radiators 1 ☐ Vents/Fans ☒ Sink/Toilet/Urinal ☐ Other:	☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1912 ☒ 1913-1933 ☐ 1934-present ☐ In question	1 porcelain rounded pedestal wall sink.
MISCELLANEOUS:	☐ ☐ ☐ ☐	☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☒ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: ① Southwest door ② View East ③ View West ROOM NO. 201

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 220

ROOM NO: 202 LAST KNOWN USE: Bathroom SQUARE FEET: 79 CEILING HEIGHT: DATE: 8 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete; [ ] Resilient; [ ] Wood; [ ] Other:	[X] Good; [ ] Fair; [ ] Poor; [ ] Destroyed	[X] 1900-1912; [ ] 1913-1933; [ ] 1934-present; [ ] In question	white hexagonal tiles.
BASE:	[X] Tile/Concrete; [ ] Resilient; [ ] Wood; [ ] Other:	[X] Good; [ ] Fair; [ ] Poor; [ ] Destroyed	[X] 1900-1912; [ ] 1913-1933; [ ] 1934-present; [ ] In question	
WALLS:	[ ] Plaster; [ ] Partitions; [X] Tile Wainscot; [ ] Other:	[X] Good; [ ] Fair; [ ] Poor; [ ] Destroyed	[X] 1900-1912; [ ] 1913-1933; [ ] 1934-present; [ ] In question	3 dowels mounted just above wainscot to hang clothes.
CEILING:	[X] Plaster; [ ] Acoustic panels; [ ] Cove; [ ] Other	[X] Good; [ ] Fair; [ ] Poor; [ ] Destroyed	[X] 1900-1912; [ ] 1913-1933; [ ] 1934-present; [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled; [X] Wood Veneer; [ ] Galvanized Metal; [ ] Other:	[ ] Good; [ ] Fair; [ ] Poor; [ ] Destroyed	[X] 1900-1912; [ ] 1913-1933; [ ] 1934-present; [ ] In question	"HEAD" stencilled on exterior. Marble window + door surrounds.
LIGHTING:	[ ] Incandescent/Type A; [ ] Incandescent/Type B; [X] CML/Sconce 1; [ ] Other:	[ ] Intact [ ] Destroyed; [ ] Intact [ ] Destroyed; [X] Intact [ ] Destroyed; [ ] Intact [ ] Destroyed	[ ] 1900-1912; [ ] 1913-1933; [X] 1934-present; [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators 1; [ ] Vents/Fans; [X] Sink/Toilet/Urinal; [X] Other: tub	[X] Intact [ ] Destroyed; [ ] Intact [ ] Destroyed; [X] Intact [ ] Destroyed; [X] Intact [ ] Destroyed	[X] 1900-1912; [X] 1913-1933; [ ] 1934-present; [ ] In question	1 toilet. 1 sink. 1 bathtub w/ shower curtain rod.
MISCELLANEOUS:		[ ] Good; [ ] Fair; [ ] Poor; [ ] Destroyed	[ ] 1900-1912; [ ] 1913-1933; [ ] 1934-present; [ ] In question	Cord tied on curtain rod — as clothes line.
SUMMARY:		[X] Good; [ ] Fair; [ ] Poor; [ ] Destroyed	[X] 1900-1912; [X] 1913-1933; [ ] 1934-present; [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most; [ ] Some; [X] Minor; [ ] Negligible

PHOTOGRAPHS: (1) View North (2) View South ROOM NO. 202

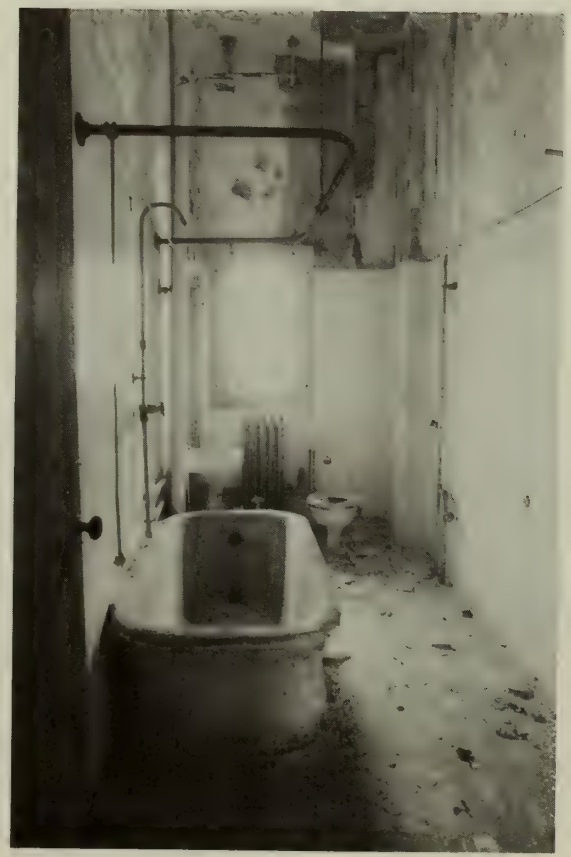

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 222

ROOM NO: 203 LAST KNOWN USE: Bathroom SQUARE FEET: 87 CEILING HEIGHT: DATE: 8 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	N. wall = exterior wall - structural tile has fallen out where pipe is located. Supports for shelves attached to W. wall.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	"HEAD" stenciled on door. Transom w/ safety glass.
LIGHTING:	☒ Incandescent/Type A ☐ Incandescent/Type B ☐ CML/Sconce ☐ Other:	☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	globe intact: lying on floor.
HEATING/ VENTILATION PLUMBING:	☒ Radiators 1 ☐ Vents/Fans ☒ Sink/Toilet/Urinal ☒ Other: 2 showers	☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☒ Intact ☒ Destroyed ☒ Intact ☐ Destroyed	☒ 1900-1912 ☒ 1913-1933 ☒ 1934-present ☐ In question	2 toilets w/ tanks. 1 central pedestal sink. 1 free standing urinal - not attached to pipes.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☒ 1913-1933 ☐ 1934-present ☐ In question	Metal shower stalls. Toilet stall rusted metal: painted grey. Ghosts of 3 sinks: W. wall.
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☒ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: ① View North ② View South ROOM NO. 203

PHOTOGRAPHS: (3) View East (4) View West ROOM NO. 203

PHOTOGRAPHS:

ROOM NO. 203

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 226

ROOM NO: 204 LAST KNOWN USE: Bathroom SQUARE FEET: 87 CEILING HEIGHT: DATE: 8 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	white hexagonal.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Ghosts of missing sinks.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	painted white: stencilled "HEAD." window screen: destroyed.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: 2 showers	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	1 slop sink. 1 marble shower stall. 1 metal shower stall.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View North ② Door signage ③ shower stall ROOM NO. 204

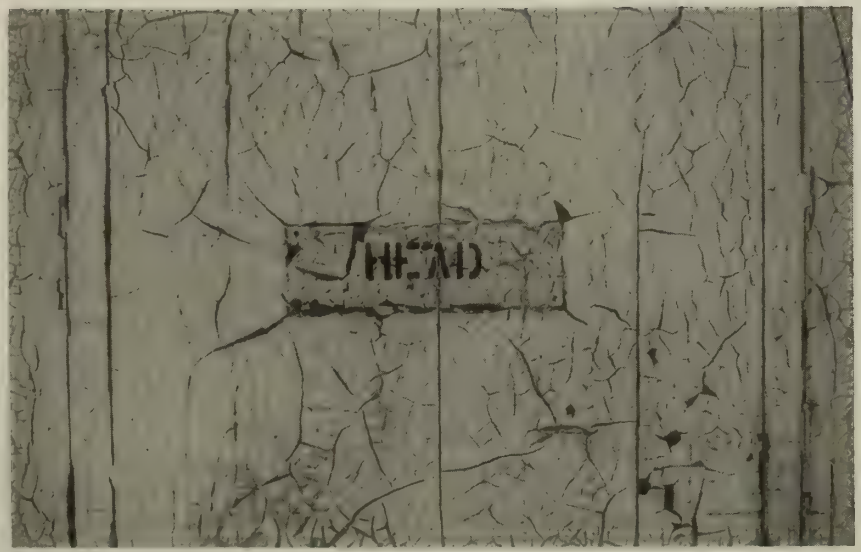

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 228

ROOM NO: 205 LAST KNOWN USE: Toilet SQUARE FEET: 85 CEILING HEIGHT: DATE: 8 NOV. 1985.

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	white hexagonal.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	NE corner = exterior wall - severe water damage - organic growth in hole above wainscot Pipe exposed.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble window and door surrounds, - left side and top missing from window surround.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 sconce. no shade. 1 CML. " "
HEATING/ VENTILATION PLUMBING:	[X] Radiators! [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	2 porcelain, rounded pedestal wall sinks. 2 toilets. 1 urinal.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Drill holes for mirrors over sinks. Marble toilet stalls - w/ doors destroyed.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View North ② View South ROOM NO. 205

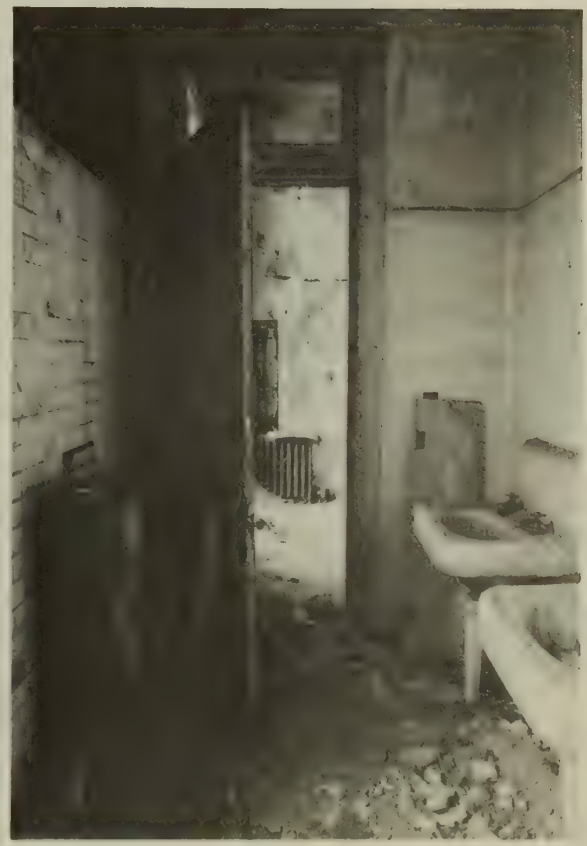

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 230

ROOM NO: 206 LAST KNOWN USE: Barracks SQUARE FEET: 1540 CEILING HEIGHT: 12'-6" DATE: 8 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: standard	Good Fair Poor obscured Destroyed	X 1900-1912 1913-1933 1934-present In question	
BASE:	Tile/Concrete Resilient Wood X Other: standard	Good Fair Poor obscured Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Structural tile exposed E. + W walls.
CEILING:	X Plaster Acoustic panels X Cove Other	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	X Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good Fair X Poor X Destroyed	X 1900-1912 1913-1933 1934-present In question	1 wood/glass panelled door: S. wall-poor 1 veneer door: W. wall - destroyed 1 double door to hall (N. wall) - destroyed
LIGHTING:	Incandescent/Type A Incandescent/Type B X CML/Sconce Other:	Intact Destroyed Intact Destroyed X Intact X Destroyed Intact Destroyed	1900-1912 X 1913-1933 X 1934-present In question	2 CML's — 1 intact, 1 destroyed. 17 sconces intact — 1 w/ glass shade. 1 louvred night-light N. wall, 1 ft. above floor, W. of door.
HEATING/ VENTILATION PLUMBING:	X Radiators X Vents/Fans Sink/Toilet/Urinal Other:	10 Intact Destroyed / Intact Destroyed Intact Destroyed Intact Destroyed	X 1900-1912 1913-1933 1934-present X In question	4 wall-mounted rotary fans w/ covers 1 window fan above S. door.
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	"No Smoking" stencilled in black and white: N. wall. unattached screen door leaning on W. wall.
SUMMARY:		Good Fair X Poor Destroyed	X 1900-1912 X 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** X Most Some Minor Negligible

PHOTOGRAPHS: ① View South ② View North ③ Night light ROOM NO. 206

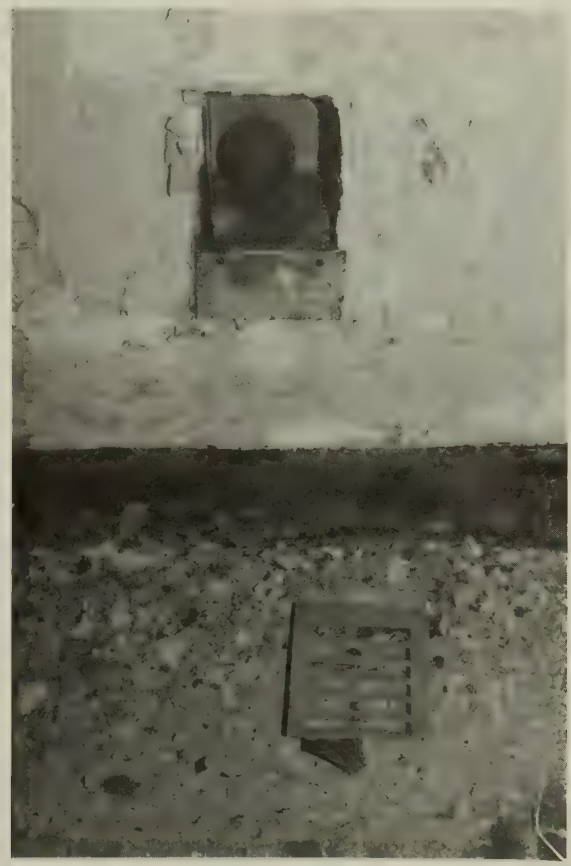

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 232

ROOM NO: 207 LAST KNOWN USE: Ward SQUARE FEET: 313 CEILING HEIGHT: DATE: 8 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [X] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	rolled linoleum over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [X] Fair obscured. [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile exposed: SE wall.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer 3 [ ] Galvanized Metal [ ] Other:	[ ] Good 2 Fair [ ] Poor 1 Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	east door: destroyed, N. door: fair West door: fair. 8"x5" ghost of rectangular plaque on N. door.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML sconce 2 [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 1 Intact 1 Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators 1 [X] Vents/Fans 1 [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 wall mounted rotary fan w/ cover.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	"201" stencilled on door. 1 wood air-deflector from window, destroyed, on floor.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View Southeast ② View East ③ View North ④ View S. West ROOM NO. 207

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 234

ROOM NO: 208 LAST KNOWN USE: Kitchen C.P.O Mess SQUARE FEET: 1501 CEILING HEIGHT: 12'-4½" DATE: 8 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	(Tile/Concrete) [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Asphalt tile over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile exposed: S wall.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	large areas of structural tile exposed.
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Door surrounds painted white. 3 doors to N. Hall: fair, painted white, w/ black base; East door: fair. same paint W. door - poor cond.; south door - veneer + glass panel. Transom - poor cond.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] (CML)/Sconce 3 [ ] Other:	Intact / Destroyed: [ ] / [ ] [ ] / [ ] [X] / [ ] [ ] / [ ]	[ ] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[✓] Radiators 1 [X] Vents/Fans 1 [ ] Sink/Toilet/Urinal [ ] Other:	Intact / Destroyed: [ ] / [X] [ ] / [X] [ ] / [ ] [ ] / [ ]	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	window fan over casement window.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	3 detached screen doors against S. wall. Stencil on W. Hall door "P.O. MESS" "NO SMOKING" over E. door. W. door stencil: "C.P.O MESS"
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

ROOM NO. 208

Misc. Cont.

- Wood elevator door opens into space.
- Red painted fire extinguisher plaque mounted near elevator.
- Fuse box, N. wall.
- Pipes for sink, N. wall.
- Pipes for gas cooking unit, center of floor.
- Curved wood veneer counter with linoleum top, W. end.
- "Hobart Utensil Sterilizer" dishwasher, with "Allen Bradley" metal box with start/stop push buttons, to left of dishwasher on wall.

PHOTOGRAPHS: ① View West ② View West ③ View East ④ Elevator ROOM NO. 208

PHOTOGRAPHS: ⑤ Southwest Corner ⑥ East door to H201, Stencil ROOM NO. 208

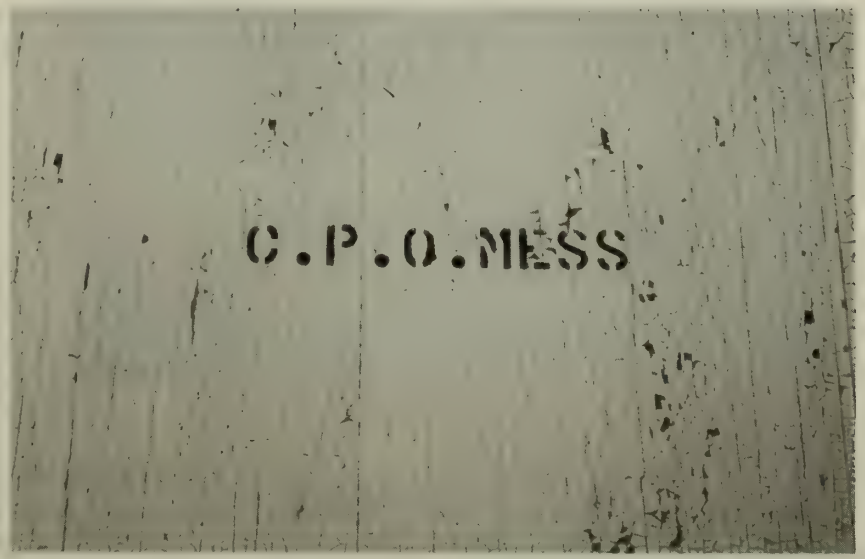

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 238

ROOM NO: 209 LAST KNOWN USE: Ward SQUARE FEET: 323 CEILING HEIGHT: DATE: 11 NOV 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Rolled linoleum over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer 3 [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Doors painted white.
LIGHTING:	[X] Incandescent/Type A 1 [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators 1 [X] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 sink w/ shallow porcelain bowl, mounted on pipes. Wall-mounted rotary fan w/ cover.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Band w/ electrical socket runs across E and N walls. plywood plaque on N wall under fan.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View South ② View North ROOM NO. 209

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 240

ROOM NO: 210 LAST KNOWN USE: Barracks SQUARE FEET: 1512 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	rolled linoleum over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile exposed and broken @ pipe in SE corner.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 double wood veneer door @ N. end. 1 glass panelled door @ S end – nailed shut – poor condition. 1 veneer door, E wall. fair.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [X] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	17 wall sconces intact / 1 with glass shade. 2 CMLs – 1 destroyed, 1 intact.
HEATING/ VENTILATION PLUMBING:	[X] Radiators 9 [X] Vents, Fans 4 [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	4 wall mounted rotary fans w/ covers.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View South ② View North ROOM NO. 210

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 242

ROOM NO: 211 LAST KNOWN USE: Toilet SQUARE FEET: 85 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	white hexagonal.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	plaster above wainscot: poor. NW corner: destroyed.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble door and window surrounds, top sections are missing.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	1 sconce: no shade. 1 CML.
HEATING/ VENTILATION PLUMBING:	[X] Radiators / Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	2 toilets. 1 urinal. 2 sinks (central pedestals)
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Marble stalls. 4 toilet paper dispensers.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: (1) View Northeast (2) View North (3) View South ROOM NO. 211

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 244

ROOM NO: 212 LAST KNOWN USE: Bathroom SQUARE FEET: 142 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair obscured. [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	white hexagonal.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	ghosts of 3 sinks.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	2 hooks on inside of door. Marble door and window surrounds w/ white overpaint. Top of window surround missing.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [X] Other: showers	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	1 marbel shower stall. 2 metal shower stalls. 1 slop sink.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View North ② View South ROOM NO. 212

PHOTOGRAPHS: (3) View Northwest ROOM NO. 212

PHOTOGRAPHS:

ROOM NO. 212

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 248

ROOM NO: 213 LAST KNOWN USE: Bathroom SQUARE FEET: 142 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Drain in floor.
BASE:	Tile/Concrete Resilient Wood X Other: standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	N. Wall (exterior wall) - plaster destroyed. Structural tile exposed + broken @ pipe.
CEILING:	X Plaster Acoustic panels Cove Other	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
LIGHTING:	X Incandescent/Type A Incandescent/Type B CML/Sconce Other:	Intact X Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1912 1913-1933 X 1934-present In question	Globe destroyed - bulb + chain intact.
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans X Sink/Toilet/Urinal X Other: showers	X Intact Destroyed Intact Destroyed X Intact Destroyed X Intact Destroyed	1900-1912 X 1913-1933 X 1934-present In question	2 metal shower stalls. 1 sink.
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	Ghosts of 5 sinks on E wall, w/ supports for shelves + clothes hooks above.
SUMMARY:		Good Fair Poor Destroyed	X 1900-1912 X 1913-1933 X 1934-present In question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS: ① View South ② View Southwest ROOM NO. 213

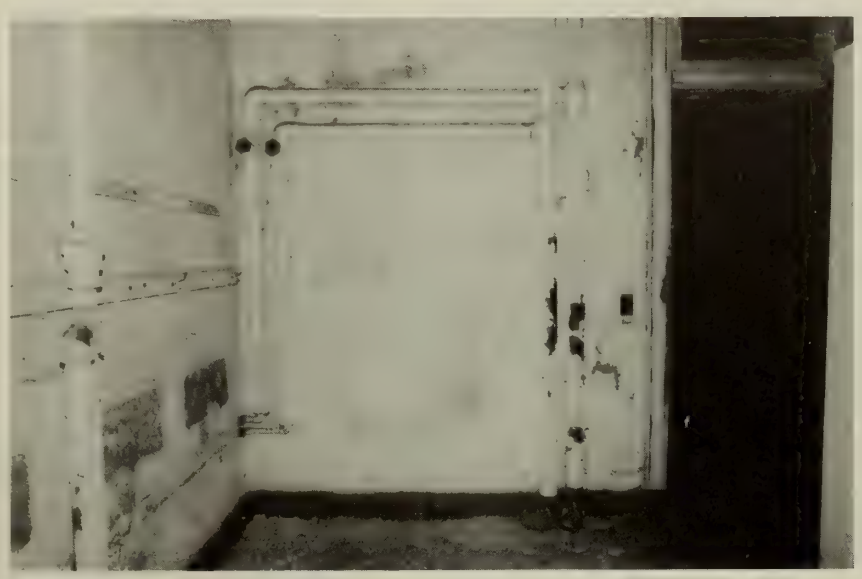

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 250

ROOM NO: 214 LAST KNOWN USE: Bathroom SQUARE FEET: 77 CEILING HEIGHT: DATE: 11 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	E. door to rm. 215 has been infilled. Traces of red paint over tile.
CEILING:	[ ] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer 2 [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Clothes-hook on inside of S. door.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 white glass globe w/ yellow decoration.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other: shower	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [X] Intact [ ] Destroyed	[ ] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	1 toilet. 1 shower (metal). 2 wall-mounted sinks.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Window sill extremely deep- wall extra thick.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View North

ROOM NO. 214

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 252

ROOM NO: 215 LAST KNOWN USE: Darkroom SQUARE FEET: 277 CEILING HEIGHT: DATE: 8 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: Standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	N. and E. walls destroyed: structural tile exposed completely. W. and S. Walls intact. W. Wall has infilled doorway.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer 4 ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Door to rm. 214: narrow, swinging, w/out hardware.
LIGHTING:	☐ Incandescent/Type A ☒ Incandescent/Type B 1 ☐ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators 1 ☒ Vents/Fans 1 ☐ Sink/Toilet/Urinal ☐ Other:	☒ Intact ☐ Destroyed ☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	1 wall-mounted rotary fan.
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View West (2) View East ROOM NO. 215

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 254

ROOM NO: 216 LAST KNOWN USE: X-ray reading room SQUARE FEET: 148 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[\] Wood/~~Glass~~ Panelled [\] Wood Veneer [ ] Galvanized Metal [ ] Other:	[X] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Door on W. wall to rm. 215 panelled, in good cond.
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [\] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators \ [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Square plywood plaque (approx. 1'x1') mounted on upper S. wall near door.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View South

ROOM NO. 216

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 256

ROOM NO: H201 LAST KNOWN USE: Corridor SQUARE FEET: 521 CEILING HEIGHT: 12'-5½" DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	(Tile)/Concrete X Resilient Wood Other:	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present X In question	Asphalt tile over standard.
BASE:	Tile/Concrete Resilient Wood X Other: standard	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Structural tile exposed @ center of N wall; S wall near elevator door.
CEILING:	X Plaster Acoustic panels X Cove Other	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	X Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	X Good X Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present X In question	10 doors to rooms: see indiv. forms. 1 pr. double metal doors at each end of hall. Wood grained w/ safety glass lights. Fair cond.
LIGHTING:	Incandescent/Type A Incandescent/Type B X (CM)/Sconce X Other:	Intact Destroyed Intact Destroyed 2 Intact Destroyed Intact 1 Destroyed	1900-1912 1913-1933 X 1934-present In question	2 CM Ls with flared glass shades - standard for corridors. 1 rusting metal base above elevator, in wall.
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans Sink/Toilet/Urinal Other:	Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1912 1913-1933 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	1 fire alarm. Elevator door stenciled "Use for 111 GHI only." Type written elev. operating instructions in frame on elev. door.
SUMMARY:		X Good Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** X Most / Some / Minor / Negligible

PHOTOGRAPHS: ① View East ② Elevator door, South wall. ROOM NO. H201

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 258

ROOM NO: H202 LAST KNOWN USE: Corridor SQUARE FEET: 118 CEILING HEIGHT: DATE: 8 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	(Tile)/Concrete X Resilient Wood Other:	Good Fair Poor X Destroyed	X 1900-1912 1913-1933 1934-present X In question	over standard.
BASE:	Tile/Concrete Resilient Wood X Other: standard	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
CEILING:	X Plaster Acoustic panels X Cove Other	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Structural tile exposed @ N. end.
DOORS/ OPENINGS:	X Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Double doors; E. and W.: glass panelled. Door to 207: veneer.
LIGHTING:	Incandescent/Type A Incandescent/Type B X (CML)/Sconce Other:	Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1912 1913-1933 X 1934-present In question	shade missing.
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans Sink/Toilet/Urinal Other:	Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1912 1913-1933 1934-present X In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present In question	Red fire alarm box on S. wall: stencilled above: "US G" (the rest is illegible).
SUMMARY:		Good X Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS: (1) View East (2) View West ROOM NO. H202

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 260

ROOM NO: H203 LAST KNOWN USE: Corridor SQUARE FEET: 217 CEILING HEIGHT: 12'-6½" DATE: 8 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	(X) Tile/Concrete (X) Resilient ( ) Wood ( ) Other:	( ) Good ( ) Fair ( ) Poor (X) Destroyed	(X) 1900-1912 ( ) 1913-1933 ( ) 1934-present (X) In question	over standard.
BASE:	( ) Tile/Concrete ( ) Resilient ( ) Wood (X) Other: standard	(X) Good ( ) Fair ( ) Poor ( ) Destroyed	(X) 1900-1912 ( ) 1913-1933 ( ) 1934-present ( ) In question	
WALLS:	(X) Plaster ( ) Partitions ( ) Tile Wainscot ( ) Other:	( ) Good (X) Fair ( ) Poor ( ) Destroyed	(X) 1900-1912 ( ) 1913-1933 ( ) 1934-present ( ) In question	
CEILING:	(X) Plaster ( ) Acoustic panels (X) Cove ( ) Other	( ) Good ( ) Fair (X) Poor ( ) Destroyed	(X) 1900-1912 ( ) 1913-1933 ( ) 1934-present ( ) In question	structural tile exposed E. end.
DOORS/ OPENINGS:	(X) Wood/Glass Panelled (X) Wood Veneer ( ) Galvanized Metal ( ) Other:	( ) Good (X) Fair (X) Poor ( ) Destroyed	(X) 1900-1912 ( ) 1913-1933 ( ) 1934-present ( ) In question	Double doors to 206: Veneer, poor cond. 3 doors to North rooms: see indiv. forms. Double doors: West - painted white, black base, safety glass lights: fair cond.
LIGHTING:	( ) Incandescent/Type A ( ) Incandescent/Type B (X) CML/Sconce (X) Other:	( ) Intact ( ) Destroyed ( ) Intact ( ) Destroyed ( ) Intact (X) Destroyed (X) Intact ( ) Destroyed	( ) 1900-1912 ( ) 1913-1933 (X) 1934-present ( ) In question	No shade on CML. 1 bulb attached to circuit box.
HEATING/ VENTILATION PLUMBING:	(X) Radiators ( ) Vents/Fans ( ) Sink/Toilet/Urinal ( ) Other:	(X) Intact ( ) Destroyed ( ) Intact ( ) Destroyed ( ) Intact ( ) Destroyed ( ) Intact ( ) Destroyed	(X) 1900-1912 ( ) 1913-1933 ( ) 1934-present ( ) In question	
MISCELLANEOUS:		( ) Good ( ) Fair ( ) Poor ( ) Destroyed	( ) 1900-1912 ( ) 1913-1933 ( ) 1934-present (X) In question	1 fire hose in glass cabinet. 1 circuit box. 1 fire extinguisher plaque on N. wall.
SUMMARY:		( ) Good ( ) Fair (X) Poor ( ) Destroyed	(X) 1900-1912 ( ) 1913-1933 (X) 1934-present (X) In question	**ARCHITECTURAL SIGNIFICANCE:** ( ) Most (X) Some ( ) Minor ( ) Negligible

PHOTOGRAPHS: (1) View East (2) View West ROOM NO. H203

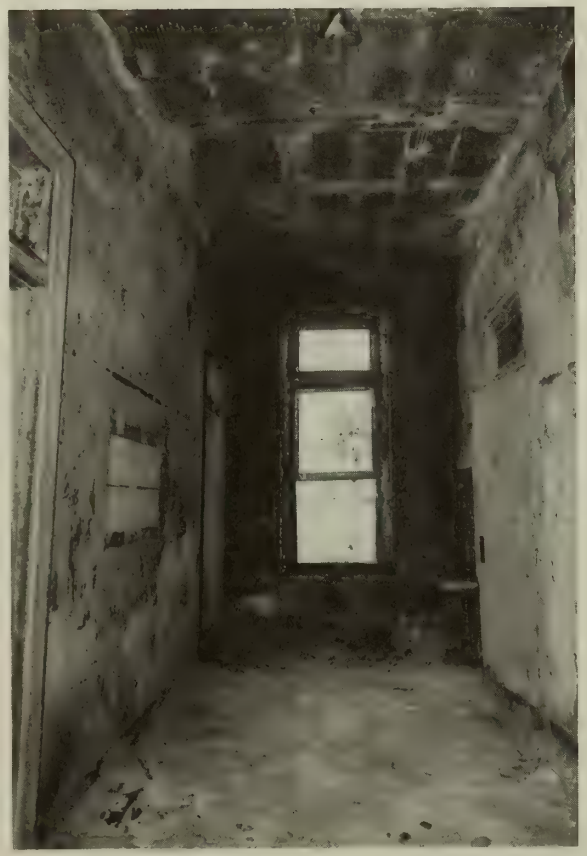

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 262

ROOM NO: H203A LAST KNOWN USE: Closet SQUARE FEET: 28 CEILING HEIGHT: DATE: 8 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Standard	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	painted black.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Standard	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	support for shelving: painted black.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Fire hose box from wall - built into N. wall.
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS:

ROOM NO. H203A

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 264

ROOM NO: H203B LAST KNOWN USE: closet SQUARE FEET: 28 CEILING HEIGHT: DATE: 8 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	shelve supports.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. H203B

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 266

ROOM NO: H204 LAST KNOWN USE: Corridor SQUARE FEET: 118 CEILING HEIGHT: DATE: 11 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	(X) Tile/Concrete X Resilient Wood Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present X In question	linoleum over standard.
BASE:	Tile/Concrete Resilient Wood X Other: standard	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
CEILING:	X Plaster Acoustic panels X Cove Other	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	X Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	E: standard Hallway double doors. W: " " " painted white. S: 1 veneer door to 209.
LIGHTING:	Incandescent/Type A Incandescent/Type B X (CM)/Sconce Other:	Intact Destroyed Intact Destroyed 1 Intact Destroyed Intact Destroyed	1900-1912 1913-1933 X 1934-present In question	
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans Sink/Toilet/Urinal Other:	Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1912 1913-1933 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present X In question	"Coast Guard fire box": stenciled above fire-box, S. wall. fire-hose on sconce - circular metal mount.
SUMMARY:		Good X Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS: (1) View East

ROOM NO. H204

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 26-B

ROOM NO: H205 LAST KNOWN USE: Corridor SQUARE FEET: 213 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	(Tile/Concrete) X Resilient Wood Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present X In question	Linoleum over standard
BASE:	Tile/Concrete Resilient Wood X Other: Standard	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
CEILING:	X Plaster Acoustic panels Cove Other	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	X Wood/Glass Panelled Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	2 pairs standard hallway double doors: fair cond. Doors to rooms: see indiv. forms.
LIGHTING:	Incandescent/Type A Incandescent/Type B X (CML)/Sconce Other:	Intact Destroyed Intact Destroyed 1 Intact Destroyed Intact Destroyed	1900-1912 1913-1933 X 1934-present In question	w/out shade.
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans Sink/Toilet/Urinal Other:	Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1912 1913-1933 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present X In question	Fire-hose in glass cabinet. Fire alarm. Fire extinguisher. S. wall.
SUMMARY:		X Good Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS: (1) View East

ROOM NO. H205

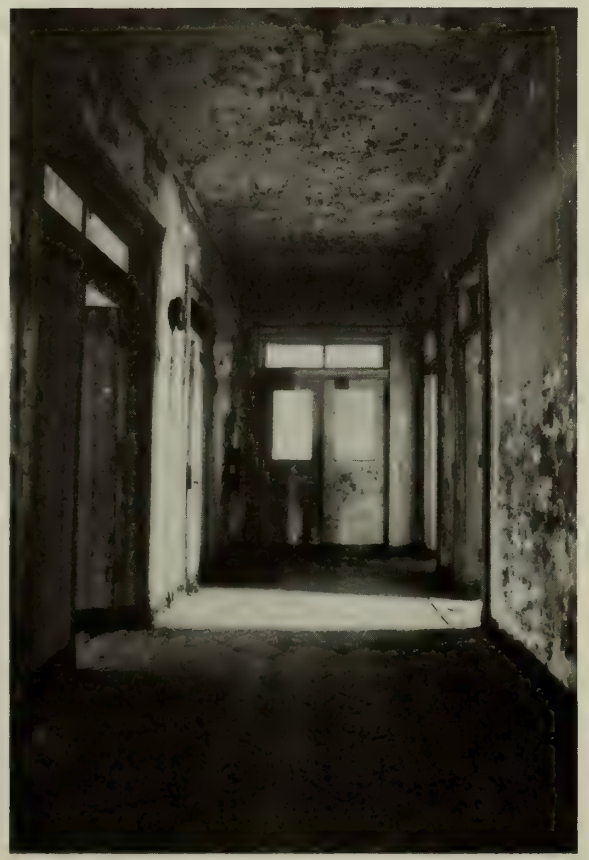

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 270

ROOM NO: H205a LAST KNOWN USE: closet SQUARE FEET: 28 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	shelve supports.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Ghost of inventory plague on inside. Housing for padlock.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS:

ROOM NO. H205A

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 272

ROOM NO: H205B LAST KNOWN USE: closet SQUARE FEET: 28 CEILING HEIGHT: DATE: 11 Nov. 1995

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Type-written inventory in frame on inside of door: "INVENTORY"
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ (CM)/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	002 ... 1 Soda acid ... 2 1½" hose ... 2 lengths Battle lanterns ... 2
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Crow bar ... 1 Sledge hammer ... 1 Pinch bar ... 1 Pole hook ... 1
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	All purpose nozzle ... 2 Spanner wrench ... 2
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☐ Minor ☒ Negligible

PHOTOGRAPHS: (1) Inventory plaque

ROOM NO. H205B

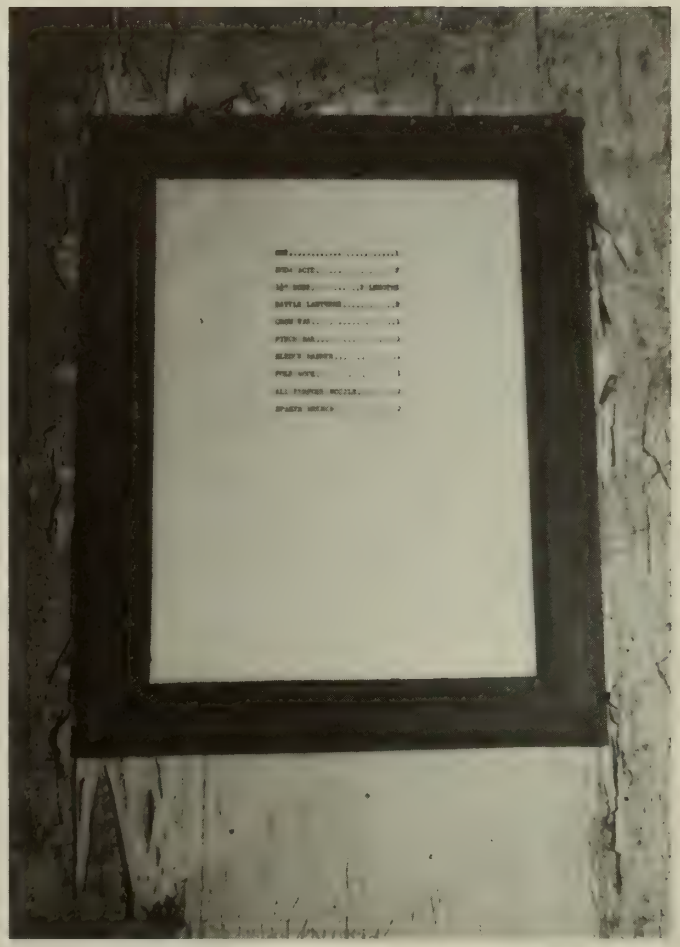

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 274

ROOM NO: I201 LAST KNOWN USE: Hallway SQUARE FEET: CEILING HEIGHT: DATE: 12 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	linoleum over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Standard	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[X] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 metal door w/ wire glass light. - light is approx. 10" sq., red overpaint. 1 pr. double veneer doors to hall painted white (standard hallway doors).
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: (1) View West (2) View East (3) View Northwest (4) Southeast ROOM NO. I201

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 276

ROOM NO: I202 LAST KNOWN USE: toilet SQUARE FEET: CEILING HEIGHT: DATE: 12 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor (obscured) [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Tile destroyed in SE. stall.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble window surround.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CMU/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [X] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/~~Urinal~~ [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 wall-hung sectional radiator. 2 toilets. 2 sinks - pipe mounted basins.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	2 Marble stalls, wood doors: poor cond.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View Southeast ② Sinks, west wall. ROOM NO. I202

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 278

ROOM NO: I203 LAST KNOWN USE: Slop room SQUARE FEET: CEILING HEIGHT: DATE: 12 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	5" sq. metal plate in floor.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	plaster above wainscot = fair. Exterior wall of Administration Bldg. exposed on west wall. South wall, evidence of pipe removal
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble surround.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML (Sconce) [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	1 shelf above tile: S. wall.
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View South

ROOM NO. I203

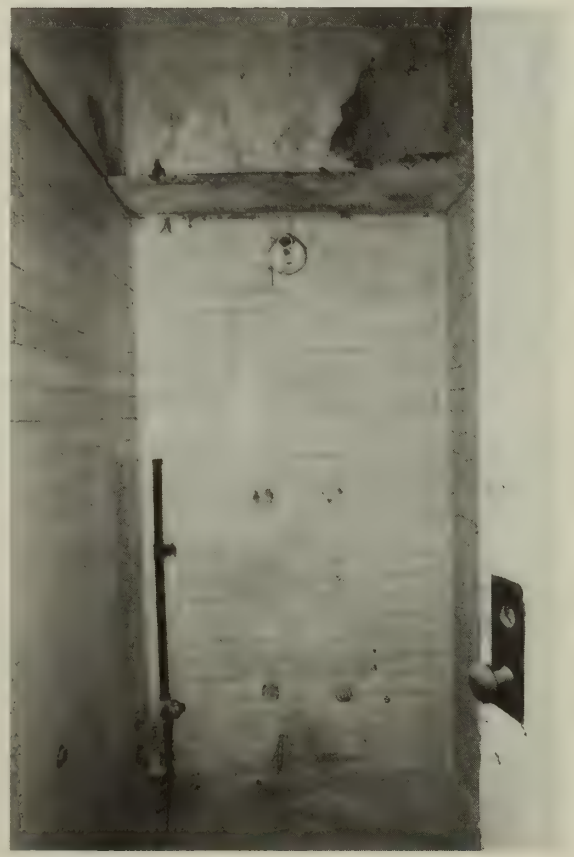

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 280

ROOM NO: 301 LAST KNOWN USE: unknown SQUARE FEET: 143 CEILING HEIGHT: 7'-6½" DATE: 12 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair obscured ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair obscured ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Holes in structural tile: N. & W. walls.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
LIGHTING:	☒ Incandescent/Type A 1 ☐ Intact ☐ Destroyed ☐ Incandescent/Type B ☐ Intact ☐ Destroyed ☒ CML/Sconce 1 ☐ Intact ☐ Destroyed ☐ Other: ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	1 sconce w/out shade. 1 incandescent A: white opague glass globe w/ gold pattern.
HEATING/ VENTILATION PLUMBING:	☒ Radiators 1 ☐ Intact ☐ Destroyed ☐ Vents/Fans ☐ Intact ☐ Destroyed ☐ Sink/Toilet/Urinal ☐ Intact ☐ Destroyed ☐ Other: ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	"308" stencilled on door.
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: (1) View Northwest (2) View South ROOM NO. 301

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 282

ROOM NO: 302 LAST KNOWN USE: unknown SQUARE FEET: 140 CEILING HEIGHT: DATE: 12 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	structural tile exposed: N. end.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
LIGHTING:	☒ Incandescent/Type A — 1 — ☐ Intact ☐ Destroyed ☐ Incandescent/Type B — ☐ Intact ☐ Destroyed ☒ CML (Sconce) — 2 — ☐ Intact ☐ Destroyed ☐ Other: — ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	1 white glass globe w/ gold pattern. 2 sconces w/ glass shades.
HEATING/ VENTILATION PLUMBING:	☒ Radiators — 1 — ☐ Intact ☐ Destroyed ☐ Vents/Fans — ☐ Intact ☐ Destroyed ☐ Sink/Toilet/Urinal — ☐ Intact ☐ Destroyed ☐ Other: — ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	"306" stencilled on door. "No Smoking" stencilled on wall.
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: ① View North ② View South ROOM NO. 302

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 284

ROOM NO: 303 LAST KNOWN USE: Bathroom SQUARE FEET: 75 CEILING HEIGHT: DATE: 12 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair (obscured) [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	drain in floor.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Plaster above wainscot: fair cond.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	wood door-stop. Marble door and window surrounds.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 2 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 sconce. 1 CML.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other: tub	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 toilet. 1 central-pedestal sink. 1 tub w/ shower plumbing.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	pipes from removed plumbing fixture: E. wall. "304" stenciled on door.
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View North ② View South ROOM NO. 303

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 286

ROOM NO: 304 LAST KNOWN USE: toilet SQUARE FEET: 68 CEILING HEIGHT: DATE: 12 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Non-opening skylight w/ wire safety-glass.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer 2 [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble surrounds - E. door missing upper piece.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 slop sink w/ faucets removed: E. wall. 1 toilet: cracked tank. 1 wall-hung sink w/ 1 faucet and ceramic waste plunger.
MISCELLANEOUS:	[ ] [ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	ghost of mirror or cabinet above sink. Door stencilled "302"
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① East ② West ③ Northeast ROOM NO. 304

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 288

ROOM NO: 305 LAST KNOWN USE: sterilizing room SQUARE FEET: 164 CEILING HEIGHT: 9'-10¾" DATE: 12 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	skylight w/ wire glass: 1 missing pane, hardware intact.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	door to 306 has marble surround.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 medical double front pedestal sink - 2 basins w/ central indentation + knee lever.
MISCELLANEOUS:	[ ] [ ] [ ] [ ]	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Wood shelf on metal bracket w/ ghost of 24"×18" rectangle above: W. Wall.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View West ② View East ③ View Northeast ROOM NO. 305

PHOTOGRAPHS: ④ Medical sink, Northeast corner ROOM NO. 305

PHOTOGRAPHS:

ROOM NO. 305

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 292

ROOM NO: 306 LAST KNOWN USE: Operating room SQUARE FEET: 311 CEILING HEIGHT: DATE: 12 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [X] Other skylight	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Hole in ceiling, NE. corner. Skylight w/ wire safety glass: opening mechanism intact. Brackets for air-deflector on window.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer 2 [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble surrounds.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed	[ ] 1900-1912 [X] 1913-1933 [ ] 1934-present [X] In question	2 bulbs hanging from wire electric cord. 1 operating-table lamp.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 "Clinic Brand" surgical sink w/ foot pedals.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	6 pipe caps on west wall, 2 beside sink on east wall. Metal bolts, W. wall, above wainscot.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View North ② View South ③ View Southeast ④ View West ROOM NO. 306

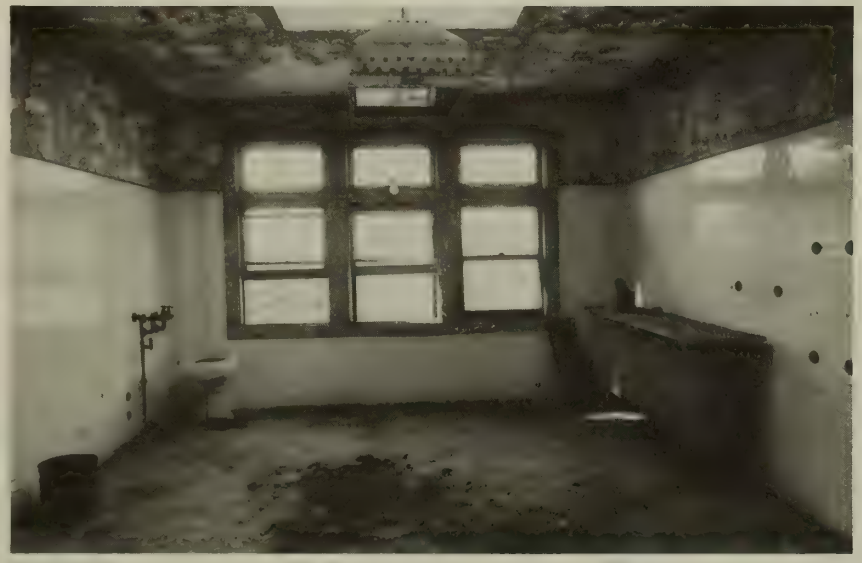

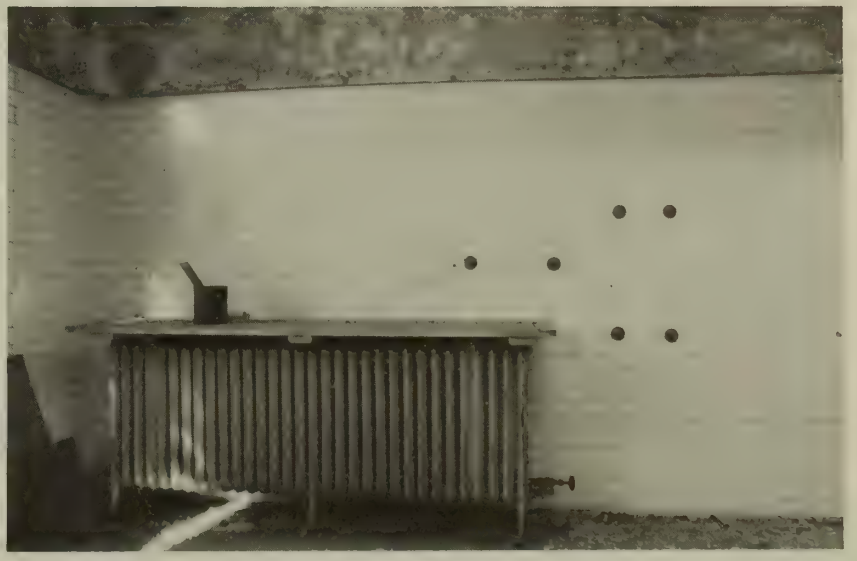

PHOTOGRAPHS: (5) Southwest corner (6) Operating lamp (7) Surgical sink ROOM NO. 306

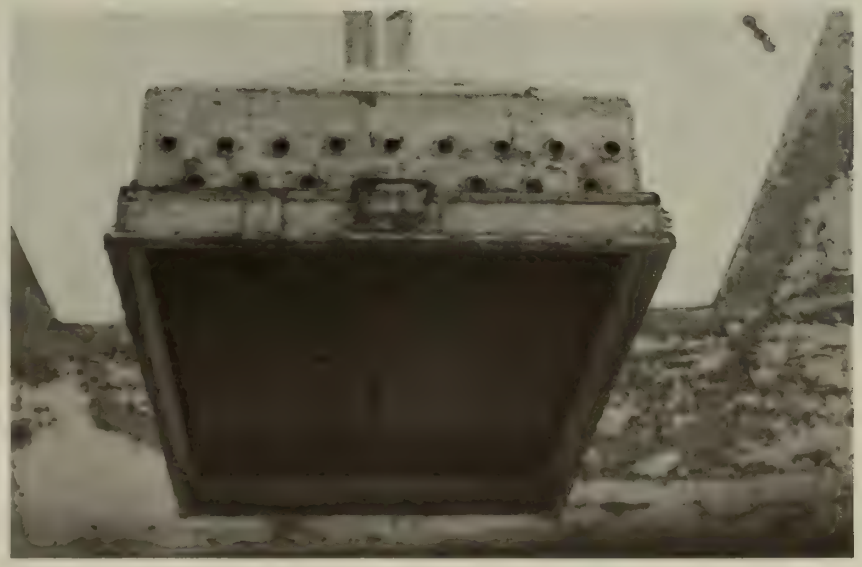

PHOTOGRAPHS: (8) skylight (9) light fixture (10) light fixture ROOM NO. 306

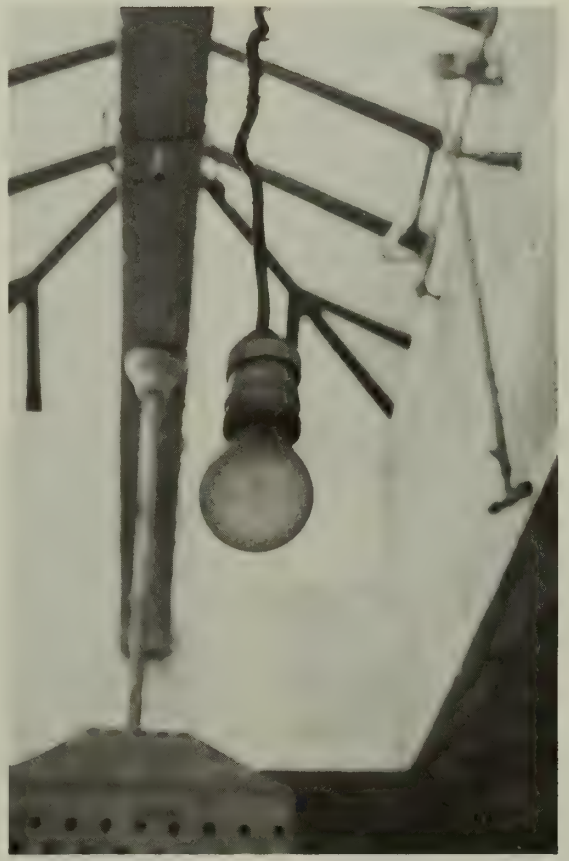

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 296

ROOM NO: 307/307C LAST KNOWN USE: unknown SQUARE FEET: 128 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: Standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
BASE:	X Tile/(Concrete) Resilient Wood X Other: standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Standard: S, E, and part of N walls. W wall + part of N wall = concrete.
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present In question	
CEILING:	X Plaster Acoustic panels Cove Other	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	X Wood/~~Glass~~ Panelled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present In question	4-panel door to vestibule. Veneer door to closet.
LIGHTING:	X Incandescent/Type A Incandescent/Type B X (CML)/Sconce Other:	1 Intact / Destroyed Intact / Destroyed 1 Intact / Destroyed Intact / Destroyed	1900-1912 1913-1933 X 1934-present In question	CML in closet – string pull.
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans Sink/Toilet/Urinal Other:	1 Intact / Destroyed Intact / Destroyed Intact / Destroyed Intact / Destroyed	X 1900-1912 1913-1933 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present X In question	"305" stencilled on door.
SUMMARY:		Good X Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS: ① View South ② View Southwest ③ View North ROOM NO. 307

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 29E

ROOM NO: 307A/307B LAST KNOWN USE: unknown SQUARE FEET: 168 CEILING HEIGHT: DATE: 12 Nov. 1986

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
BASE:	X Tile/~~Concrete~~ Resilient Wood X Other: standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	closet - standard. Rest of room gray cementitious material.
WALLS:	X Plaster Partitions Tile Wainscot X Other:	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 X 1934-present In question	West wall: Ebsary addition
CEILING:	X Plaster Acoustic panels Cove Other	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Structural tile exposed: S. end.
DOORS/ OPENINGS:	X Wood/~~Glass~~ Panelled Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	1900-1912 1913-1933 X 1934-present In question	two 4-panel doors: 1 to closet, 1 to vestibule.
LIGHTING:	Incandescent/Type A Incandescent/Type B X CML/Sconce Other:	Intact / Destroyed Intact / Destroyed 1 Intact / 1 Destroyed Intact / Destroyed	1900-1912 1913-1933 X 1934-present In question	
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans Sink/Toilet/Urinal Other:	Intact / Destroyed Intact / Destroyed Intact / Destroyed Intact / Destroyed	1900-1912 1913-1933 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present X In question	"No smoking" stenciled on N. wall, "307" on door. closet w/ 3 shelves, clothes rod.
SUMMARY:		X Good Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** Most / Some / X Minor / Negligible

PHOTOGRAPHS: ① View South ② View North ③ West wall ROOM NO. 307A/B

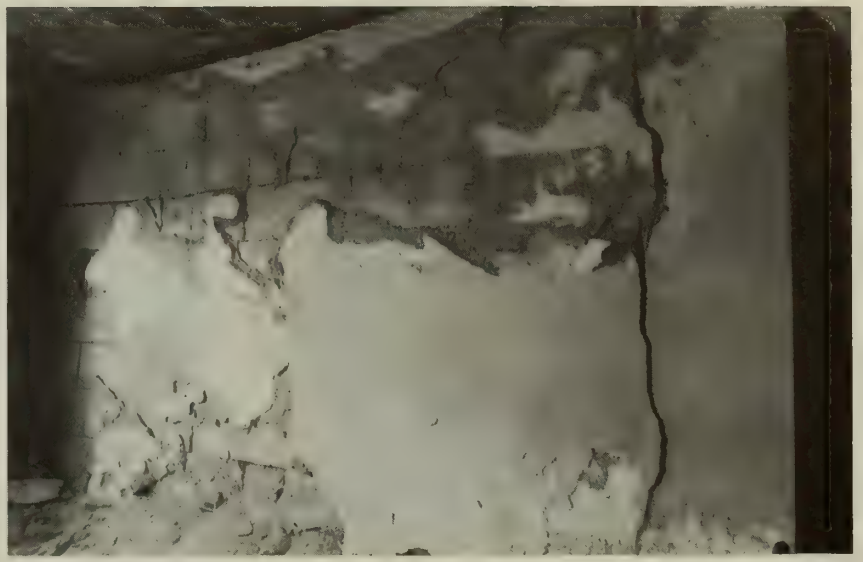

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 300

ROOM NO: 308/308A LAST KNOWN USE: unknown SQUARE FEET: 123 CEILING HEIGHT: DATE: 12 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [X] Fair [ ] Poor obscured [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [X] Fair obscured [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [X] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	East wall: later alteration, built of "ebsary" blocks.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
LIGHTING:	[X] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [1] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	closet w/ 2 shelves; Hooks on beaded board attached to wall.
SUMMARY:		[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View Southwest

ROOM NO. 308

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 302

ROOM NO: 309/309A LAST KNOWN USE: unknown SQUARE FEET: 178 CEILING HEIGHT: DATE: 12 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: Standard	☐ Good ☐ Fair ☐ Poor obscured ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: Standard	☐ Good ☐ Fair ☐ Poor ☐ Destroyed obscured	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☒ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	West wall - "ebsary" addition, completely collapsed.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer 2 ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
LIGHTING:	☒ Incandescent/Type A ☐ Incandescent/Type B ☐ CML/Sconce ☐ Other:	☐ Intact ☒ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	closet - 2 shelves, hooks.
SUMMARY:		☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: ① View from 309 West to 310A ② View from 310A East to 309 ROOM NO. 309

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 304

ROOM NO: 310/310C LAST KNOWN USE: unknown SQUARE FEET: 180 CEILING HEIGHT: DATE: 12 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☐ Fair ☐ Poor obscured ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☐ Fair ☐ Poor obscured ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☒ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	East and West walls - built of "ebsary" tile: collapsed
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☒ Wood/~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	two 4-panel doors.
LIGHTING:	☒ Incandescent/Type A 1 ☐ Intact ☐ Destroyed ☐ Incandescent/Type B ☐ Intact ☐ Destroyed ☐ CML/Sconce ☐ Intact ☐ Destroyed ☐ Other: ☐ Intact ☐ Destroyed		☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	Gold pattern on white glass globe.
HEATING/ VENTILATION PLUMBING:	☒ Radiators 1 ☐ Intact ☐ Destroyed ☐ Vents/Fans ☐ Intact ☐ Destroyed ☐ Sink/Toilet/Urinal ☐ Intact ☐ Destroyed ☐ Other: ☐ Intact ☐ Destroyed		☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	"smoking" stencilled on N. Wall. closet - 3 shelves.
SUMMARY:		☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: ① View Southeast from 310A ② Stencil, North wall ROOM NO. 310

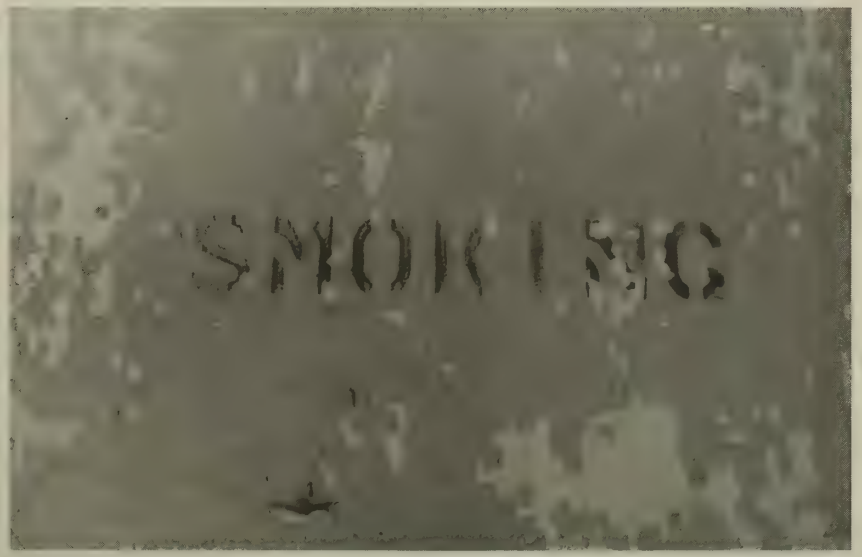

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 306

ROOM NO: 3104/3105 LAST KNOWN USE: SQUARE FEET: CEILING HEIGHT: DATE: 12 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☐ Fair obscured ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	some spalling + crumbling: S wall.
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☒ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	E. wall (later alteration) collapsed. constructed of gray "ebsary" blocks. N+W. walls: good cond. S. wall: structural tile exposed.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☒ Wood/~~Glass~~ Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	4-panel wood door to vestibule. Veneer door to closet.
LIGHTING:	☒ Incandescent/Type A ☐ Incandescent/Type B ☐ CML/Sconce ☒ Other:	☒ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☒ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	1 fixture w/ white glass globe. 1 bulb over door on interior of closet.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	1 Door stop w/ Knob-end by closet door.
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: ① View Northeast from 310A. ② Plaster block ③ Door. ROOM NO. 310A

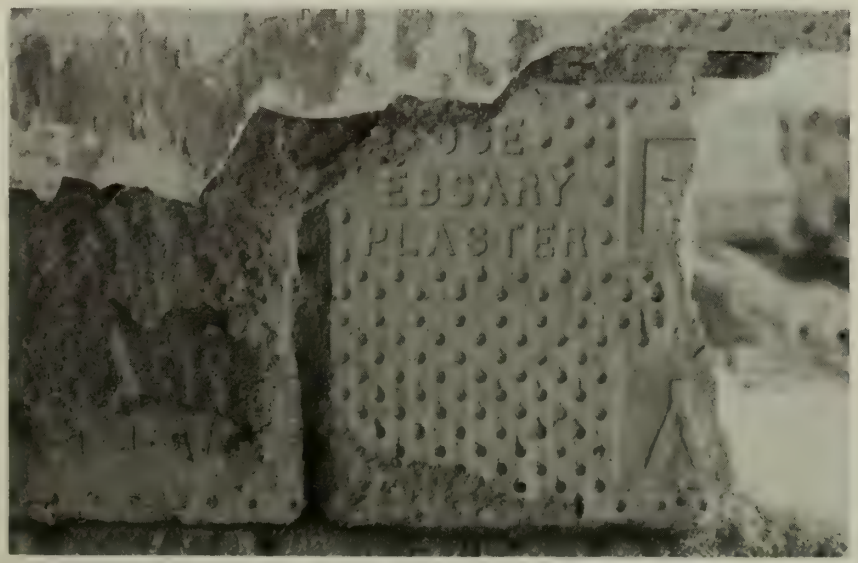

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 303

ROOM NO: 311 LAST KNOWN USE: Physiotherapy room SQUARE FEET: 313 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	plaster above wainscot: fair cond.. Remnants of black paint over Tile.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Central flat wood-framed skylight - under wire safety-glass roof housing. Dark gray painted strip runs around ceiling abutting walls.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled 1 [X] Wood Veneer 3 2 [ ] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble door and window surrounds.
LIGHTING:	[X] Incandescent/Type A 1 [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators 1 [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	door stencil: "317." 3 window shades on 3-bay window. Ghosts of shelves in closet. Loose metal pipes stored in closet.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [X] Most [ ] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View North ② View South ③ View South with Skylight ROOM NO. 311

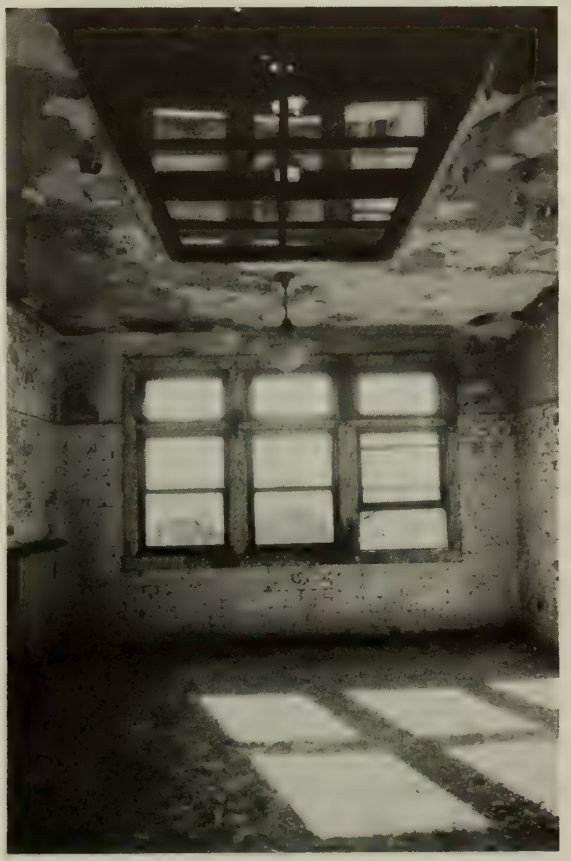

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 310

ROOM NO: 312/312A LAST KNOWN USE: Possible x-ray room SQUARE FEET: 292 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [X] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [X] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	linoleum over standard.
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: Standard	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [X] Poor 312A [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	Punctures + pipe openings in W. Wall (312). 2 screened, bottom-hinged vents to attic, W. + S. walls (312A).
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	Skylight w/ wire safety-glass. Supports w/ rods to hold skylight opening gear.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer 2 [ ] Galvanized Metal [ ] Other:	1 Good 1 Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	2 screened, bottom-hinged vents to attic, W & S walls.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 1 Intact 2 Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Holes in ceiling for 2 ceiling-fixtures.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed 1 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 wall-hung sink.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Stencil on door: "319" Stencil on wall: "No Smoking"
SUMMARY:		[X] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some 312 [X] Minor 312A [ ] Negligible

PHOTOGRAPHS: ① View North ② View Southeast ③ View North with skylight ROOM NO. 312

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 312

ROOM NO: 313 LAST KNOWN USE: Bathroom SQUARE FEET: 74 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor observed [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	White hexagonal tiles.
BASE:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [X] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	plaster walls above wainscot: poor.
CEILING:	[X] Plaster [ ] Acoustic panels [ ] Cove [ ] Other	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Marble window and door surrounds. "314" stencilled on door.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [X] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [X] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	1 wall-mounted enamel base w/ bulb.
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [X] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [ ] 1934-present [ ] In question	1 toilet 1 sink 1 tub w/ curtain rod + shower.
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	1 Mirror. 1 toilet paper holder. 1 towel rack.
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [X] 1913-1933 [X] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [X] Minor [ ] Negligible

PHOTOGRAPHS: ① View North ② View South ROOM NO. 313

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 314

ROOM NO: 314 LAST KNOWN USE: unknown SQUARE FEET: 140 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☐ Fair obscured. ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☐ Fair ☐ Poor obscured ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	N. Wall structural tile completely exposed.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	door transom missing glass.
LIGHTING:	☒ Incandescent/Type A ☐ Incandescent/Type B ☒ CML/Sconce ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	1 hanging white globe w/ gold pattern. 2 sconces, 1 with glass shade intact.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	"312" stencilled on door.
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☒ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: ① View North ② View South ROOM NO. 314

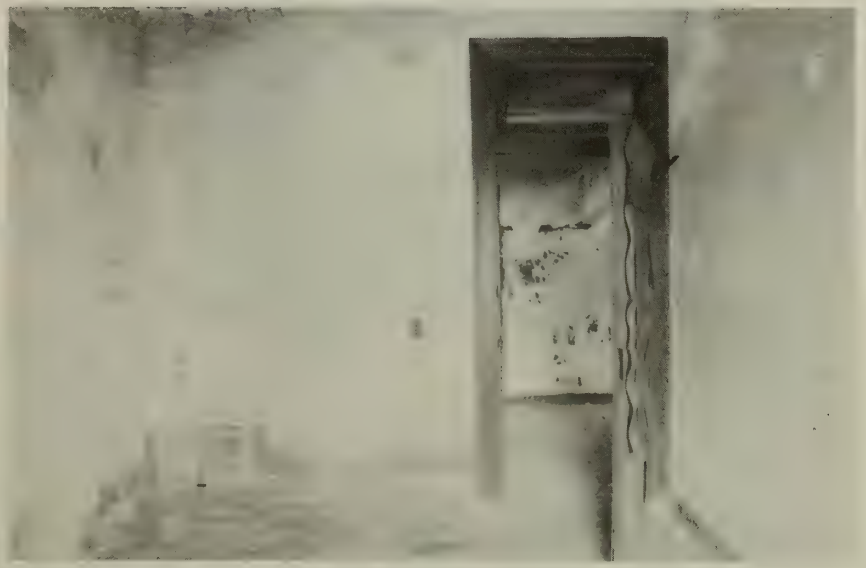

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 316

ROOM NO: 315 LAST KNOWN USE: unknown SQUARE FEET: 141 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: Standard	☐ Good ☐ Fair ☐ Poor obscured ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: Standard	☐ Good ☐ Fair obscured ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	N. wall, structural tile completely exposed.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☐ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
LIGHTING:	☒ Incandescent/Type A ☐ Incandescent/Type B ☒ CML (Sconce) ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	1 hanging white globe w/ gold pattern.
HEATING/ VENTILATION PLUMBING:	☒ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
SUMMARY:		☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: ① View South ② Light fixture ROOM NO. 315

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 318

ROOM NO: H301 LAST KNOWN USE: Corridor SQUARE FEET: 363 CEILING HEIGHT: DATE: 11 Nov. 1995

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: standard	Good Fair X Poor obscured Destroyed	X 1900-1912 1913-1933 1934-present In question	
BASE:	Tile/Concrete Resilient Wood X Other: standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	some infill where doors were infilled, + around elevator.
WALLS:	X Plaster Partitions Tile Wainscot Other:	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	Much structural tile exposed N. + S. walls.
CEILING:	X Plaster Acoustic panels X Cove Other	Good Fair X Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	X Wood/Glass Panelled X Wood Veneer Galvanized Metal X Other:	Good see indiv. rooms. X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present X In question	2 double veneer standard hallway doors. 1 metal elevator door. 6 veneer doors to rooms. Marble door frame plinths.
LIGHTING:	Incandescent/Type A Incandescent/Type B X CM/Sconce X Other:	Intact Destroyed Intact Destroyed 2 Intact 1 Destroyed 1 Intact Destroyed	1900-1912 1913-1933 X 1934-present X In question	1 glass globe on rod extended from wall above elevator.
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans Sink/Toilet/Urinal Other:	Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1912 1913-1933 1934-present In question	Arrow-shaped plaque mounted beside elevator.
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 X 1934-present X In question	1 fire alarm: S. wall. 1 elevator switch plate. 1 mount for fire extinguisher.
SUMMARY:		Good Fair X Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	1 circuitry box. **ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS: (1) View East. (2) Typical marble plinth. ROOM NO. H301

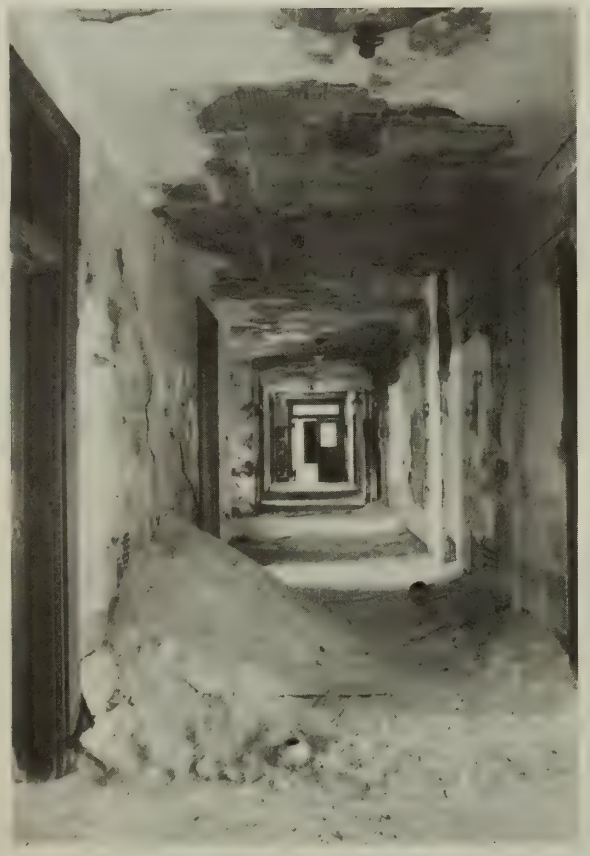

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 320

ROOM NO: H302 LAST KNOWN USE: Corridor SQUARE FEET: 82 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☐ Fair ☒ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Blistering and desintegration in part of S. wall. Evidence of much patched and repaired plaster.
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	skylight - Moss and plant growth under broken panes in skylight.
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	1 standard hallway double door. Door to rm 306: Veneer, fair cond. 306 door frame has hinges for missing screen door.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 2 Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	2 fire-hoses on cabinets on S. wall; 1 fire-extinguisher mount on S. wall; 1 black wood plaque w/ many holes (for phone?); letters carved beside plaque 2 A+.
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☒ Most ☐ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: ① View East ② Fire-hose, south wall. ROOM NO. H302

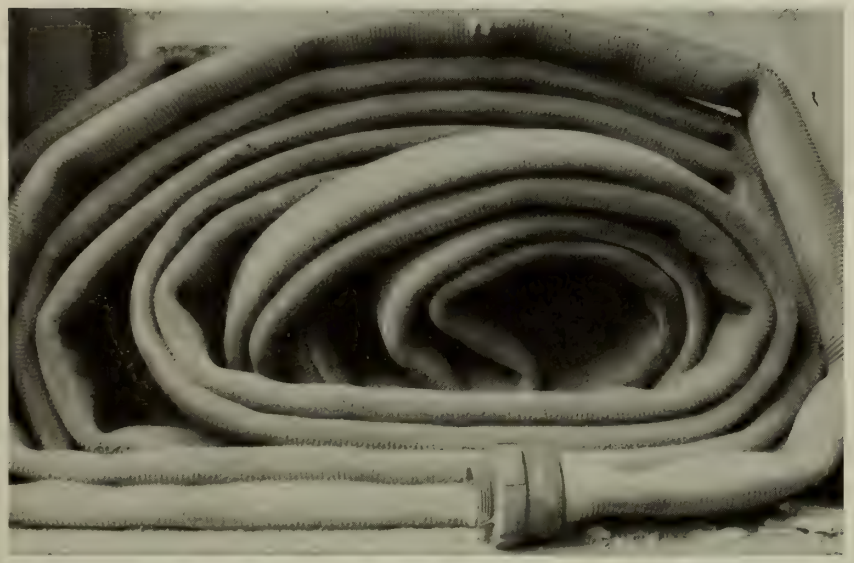

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 322

ROOM NO: H303/H303A LAST KNOWN USE: closet SQUARE FEET: CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: Standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
BASE:	Tile/Concrete Resilient Wood X Other: Standard	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
CEILING:	Plaster Acoustic panels Cove X Other	Good X Fair Poor Destroyed	1900-1912 1913-1933 1934-present X In question	Torn dark cloth - false ceiling.
DOORS/ OPENINGS:	Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good Fair Poor X Destroyed	X 1900-1912 1913-1933 1934-present In question	Labeled shelves lining walls: 3¼" x ½" light weight cardboard labels. Large type typewritten:
LIGHTING:	Incandescent/Type A Incandescent/Type B CML/Sconce Other:	Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1912 1913-1933 1934-present In question	1. "Hand towels" "Dish towels" "surgical gowns" "Surgeon's gowns"
HEATING/ VENTILATION PLUMBING:	Radiators Vents/Fans Sink/Toilet/Urinal Other:	Intact Destroyed Intact Destroyed Intact Destroyed Intact Destroyed	1900-1912 1913-1933 1934-present In question	2. "pillow cases" "Surgeon's, operating coats, pants"
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present X In question	3. "Old linen" "blankets"
SUMMARY:		X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some H303 / Minor / X Negligible

PHOTOGRAPHS: (1) View North, into closet

ROOM NO. H303A

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 324

ROOM NO: H304 LAST KNOWN USE: Corridor SQUARE FEET: 92 CEILING HEIGHT: 9'-10½" DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: Standard	☐ Good ☐ Fair ☐ Poor observed ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☐ Good ☐ Fair ☐ Poor observed ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Evidence of alterations on E. wall: 3 red cement blocks 10" above floor, 12"x18"
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☐ Other	☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☒ Wood Veneer ☐ Galvanized Metal ☐ Other:	☐ Good ☐ Fair ☒ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	1 wood 2-panel door w/ single light - destroyed. 2 veneer doors to 308 + 309 - poor.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☐ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
SUMMARY:		☐ Good ☐ Fair ☐ Poor ☒ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☒ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: ① View South

ROOM NO. H304

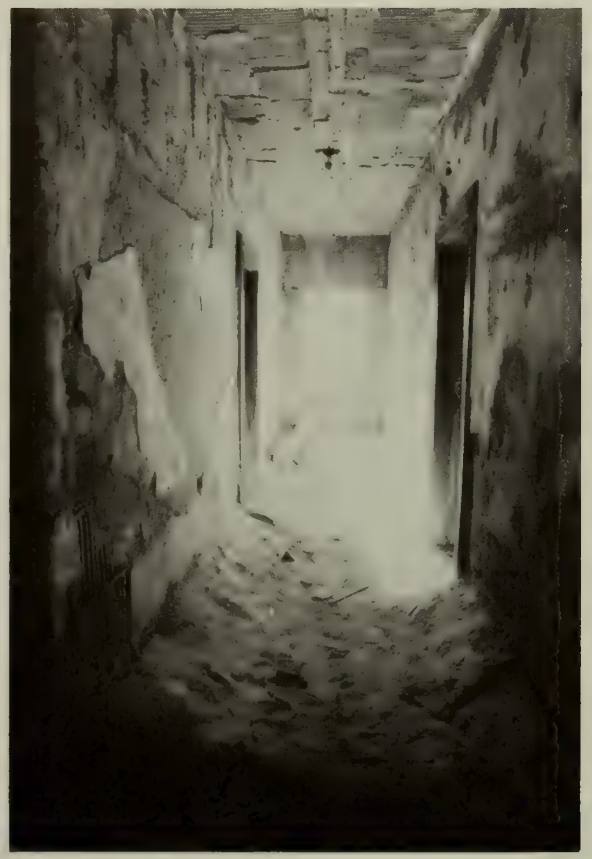

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 326

ROOM NO: H305 LAST KNOWN USE: corridor SQUARE FEET: 82 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: standard	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
CEILING:	☒ Plaster ☐ Acoustic panels ☒ Cove ☒ Other skylight	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	skylight has 1 glass pane boarded over, 3 other panes are missing.
DOORS/ OPENINGS:	☒ Wood/Glass Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	standard hallway double doors w/ safety glass lights + transom.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ CM/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed 1 Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	w/out shade.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☒ In question	1 iron fire-hose mount, semi-circular. 1 empty fire-hose cabinet - glass broken. Red plaque for fire extinguisher - sign above stenciled w/ instructions.
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☒ In question	**ARCHITECTURAL SIGNIFICANCE:** ☒ Most ☐ Some ☐ Minor ☐ Negligible

PHOTOGRAPHS: ① Fire-hose mount ② Fire extinguisher mount ROOM NO. H305

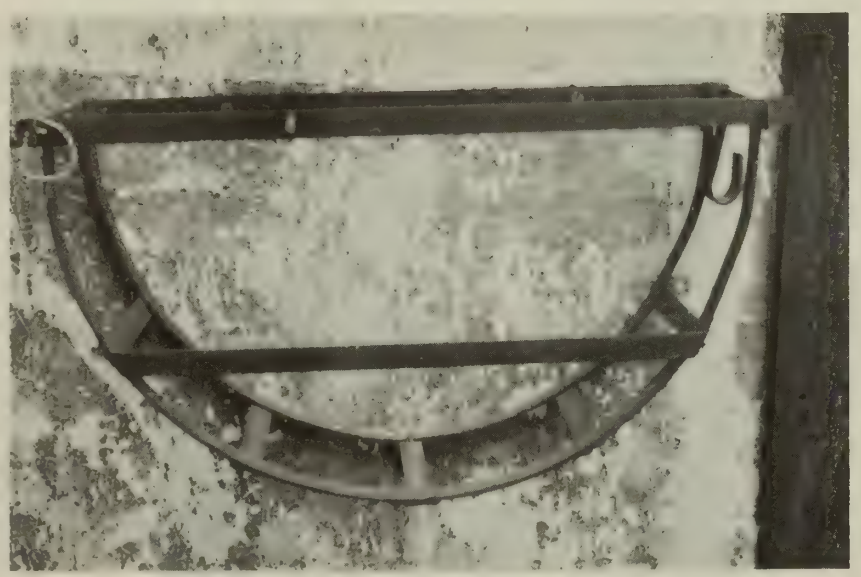

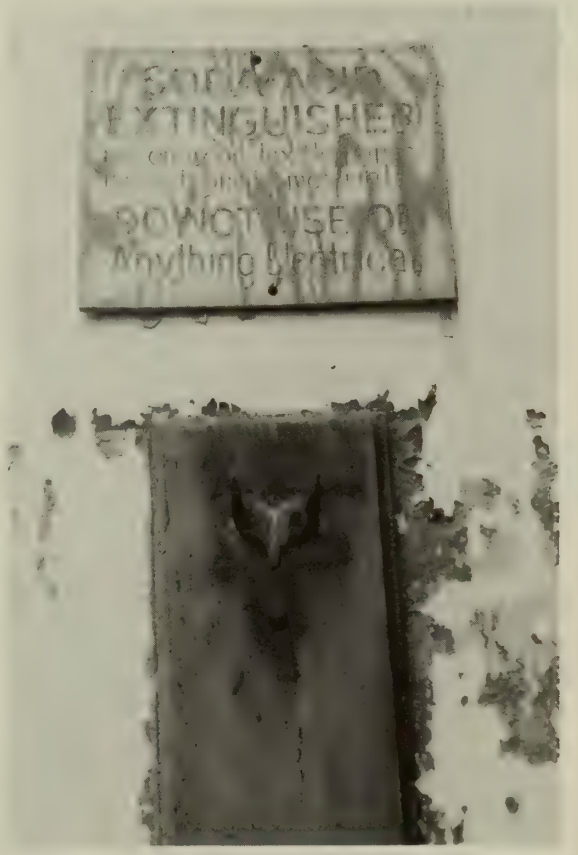

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 328

ROOM NO: H306 LAST KNOWN USE: corridor SQUARE FEET: 154 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	Tile/Concrete Resilient Wood X Other: standard	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
BASE:	Tile/Concrete Resilient Wood X Other: standard	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
WALLS:	X Plaster Partitions Tile Wainscot Other:	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	"2" stencilled in red on S. wall near door to A3A.
CEILING:	X Plaster Acoustic panels X Cove Other	X Good Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	
DOORS/ OPENINGS:	Wood/Glass Panelled X Wood Veneer Galvanized Metal Other:	Good X Fair Poor Destroyed	X 1900-1912 1913-1933 1934-present In question	see indiv. forms for rms. 312, A3A, A3B Veneer doors.
LIGHTING:	Incandescent/Type A Incandescent/Type B X CM/Sconce Other:	Intact / Destroyed Intact / Destroyed Intact / Destroyed Intact / Destroyed	1900-1912 1913-1933 X 1934-present In question	
HEATING/ VENTILATION PLUMBING:	X Radiators Vents/Fans Sink/Toilet/Urinal Other:	Intact / Destroyed Intact / Destroyed Intact / Destroyed Intact / Destroyed	X 1900-1912 1913-1933 1934-present In question	
MISCELLANEOUS:		Good Fair Poor Destroyed	1900-1912 1913-1933 1934-present X In question	red fire extinguisher plaque, S. wall. thick wood light switch plaque, N. wall
SUMMARY:		X Good Fair Poor Destroyed	X 1900-1912 1913-1933 X 1934-present X In question	**ARCHITECTURAL SIGNIFICANCE:** Most / X Some / Minor / Negligible

PHOTOGRAPHS: ① View West

ROOM NO. H306

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 330

ROOM NO: H307 LAST KNOWN USE: Vestibule SQUARE FEET: 51 CEILING HEIGHT: DATE: 12 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: Standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	standard except for cementitious alterations @ S. end.
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☒ Wood/~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	two 4-panel doors to 307 + 307A door to H301 removed-original surround + hinges remain.
LIGHTING:	☐ Incandescent/Type A ☐ Incandescent/Type B ☒ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact 1 Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
SUMMARY:		☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) View Southwest

ROOM NO. H307

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 332

ROOM NO: H308 LAST KNOWN USE: Vestibule SQUARE FEET: 47 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: Standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
BASE:	☐ Tile/Concrete ☐ Resilient ☐ Wood ☒ Other: Standard	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	Standard E, W + N walls. Gray cementitious material between doors.
WALLS:	☒ Plaster ☐ Partitions ☐ Tile Wainscot ☐ Other:	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	
CEILING:	☒ Plaster ☐ Acoustic panels ☐ Cove ☐ Other	☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
DOORS/ OPENINGS:	☒ Wood/~~Glass~~ Panelled ☐ Wood Veneer ☐ Galvanized Metal ☐ Other:	☒ Good ☐ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	2 wood 4-panel doors to 310 + 310A. Door to hallway removed; original hinge receivers remain on frame.
LIGHTING:	☒ Incandescent/Type A ☐ Incandescent/Type B ☐ CML/Sconce ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	white globe w/ gold pattern.
HEATING/ VENTILATION PLUMBING:	☐ Radiators ☐ Vents/Fans ☐ Sink/Toilet/Urinal ☐ Other:	☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed ☐ Intact ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
MISCELLANEOUS:		☐ Good ☐ Fair ☐ Poor ☐ Destroyed	☐ 1900-1912 ☐ 1913-1933 ☐ 1934-present ☐ In question	
SUMMARY:		☐ Good ☒ Fair ☐ Poor ☐ Destroyed	☒ 1900-1912 ☐ 1913-1933 ☒ 1934-present ☐ In question	**ARCHITECTURAL SIGNIFICANCE:** ☐ Most ☐ Some ☒ Minor ☐ Negligible

PHOTOGRAPHS: (1) View South.

ROOM NO. H308

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 334

ROOM NO: I301 LAST KNOWN USE: Hallway SQUARE FEET: CEILING HEIGHT: DATE: 11 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other: standard	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[X] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	West wall originally exterior wall of Administration Bldg: Brick and limestone.
CEILING:	[X] Plaster [ ] Acoustic panels [X] Cove [X] Other skylight	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Safety glass skylight w/ iron pole opening apparatus
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [ ] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [ ] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Metal door w/ 10" sq. window. Glass destroyed.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[X] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
SUMMARY:		[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [X] Some [ ] Minor [ ] Negligible

PHOTOGRAPHS: ① View West ② View East ③ Skylight ROOM NO. I 301

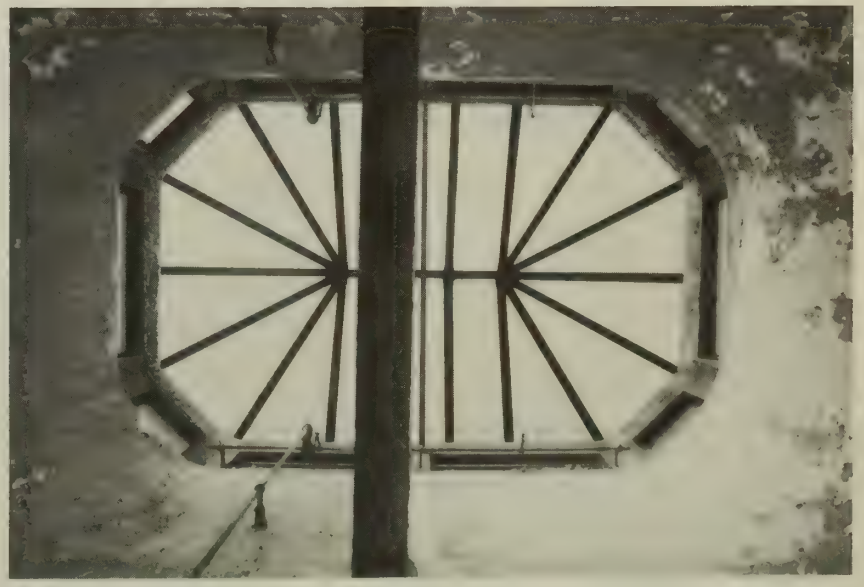

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 336

ROOM NO: Attic 3A LAST KNOWN USE: Storage SQUARE FEET: 1372 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [ ] Tile Wainscot [X] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Knee walls brick - the rest structural Tile.
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile. Rusting trusses.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	4 porthole windows. Wood circular sash, center pivot, copper clad, top catch.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] (CM)/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	"Damage Control locker" stencilled in red on door.
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	Addition to rm. 312 - wall built of "Ebsary" blocks: stamped w/ "Ebsary" trademark.
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [X] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View South (2) View North ROOM NO. A3A

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 338

ROOM NO: Attic 3B LAST KNOWN USE: storage SQUARE FEET: 2017 CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [ ] Tile Wainscot [X] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile. Brick kneewall.
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Structural tile. Iron trusses.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Door extant, but off hinge. 1 porthole dormer as A3A, glass destroyed.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [1] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	Book shelves on S. wall. Central pipe running thru roof + floor. Access to roof thru hatch, SE corner.
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) Southeast corner (2) View West ROOM NO. A3B

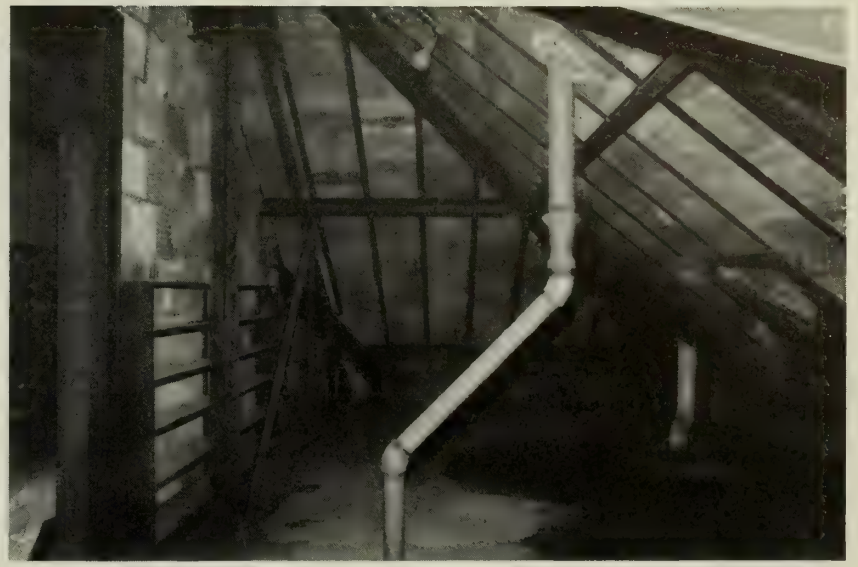

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 340

ROOM NO: Attic 3C LAST KNOWN USE: Storage SQUARE FEET: CEILING HEIGHT: DATE: 11 Nov. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [ ] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [ ] Tile Wainscot [X] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Structural tile. Brick knee wall.
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Structural tile. Iron trusses.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [X] Galvanized Metal [ ] Other:	[ ] Good [X] Fair [X] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	6 porthole dormers.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [X] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed 2 Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [X] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View North (2) View West ROOM NO. A3C

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 342

ROOM NO: central attic LAST KNOWN USE: storage SQUARE FEET: CEILING HEIGHT: 18'-3" at ridge DATE: 11 NOV. 1985

	FINISHES:	CONDITION:	DATE:	NOTES:
FLOOR:	[X] Tile/Concrete (circled) [ ] Resilient [ ] Wood [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
BASE:	[ ] Tile/Concrete [ ] Resilient [ ] Wood [X] Other:	[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
WALLS:	[ ] Plaster [ ] Partitions [ ] Tile Wainscot [ ] Other:	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Brick knee wall. Structural tile.
CEILING:	[ ] Plaster [ ] Acoustic panels [ ] Cove [X] Other	[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	structural tile. Rusting trusses.
DOORS/ OPENINGS:	[ ] Wood/Glass Panelled [X] Wood Veneer [ ] Galvanized Metal [X] Other:	[ ] Good [X] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Elevator door opens into space. 2 panel with safety glass light.
LIGHTING:	[ ] Incandescent/Type A [ ] Incandescent/Type B [ ] CML/Sconce [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
HEATING/ VENTILATION PLUMBING:	[ ] Radiators [ ] Vents/Fans [ ] Sink/Toilet/Urinal [ ] Other:	[ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed [ ] Intact [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	
MISCELLANEOUS:		[ ] Good [ ] Fair [ ] Poor [ ] Destroyed	[ ] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	Porthole dormers.
SUMMARY:		[X] Good [ ] Fair [ ] Poor [ ] Destroyed	[X] 1900-1912 [ ] 1913-1933 [ ] 1934-present [ ] In question	**ARCHITECTURAL SIGNIFICANCE:** [ ] Most [ ] Some [ ] Minor [X] Negligible

PHOTOGRAPHS: (1) View West (2) View East (3) View South ROOM NO. Central attic

PHOTOGRAPHS: (4) View North @ west end. (5) View North @ East end. ROOM NO. Central attic

PHOTOGRAPHS:	ROOM NO.

ROOM NO: S 01 LAST KNOWN USE: Staircase SQUARE FEET: CEILING HEIGHT: DATE: 11/13/85

DESCRIPTION:

General: Rectangular northeast stair with open well. Stair serves all three floors plus cellar with two runs and two landings per floor. Stair structure is cast iron with wood handrail. Newel posts are square headed with vertical paneled shafts; circular petal motif base supports the handrail uprights. Decorative wrought iron grillework surmounts the third floor landing rail. Similar grillework covers the windows of each mid-floor landing.

Condition: General rusting of metal surfaces. Some separation of laminated handrail into its three parts. The newels of the first floor landing have been encased in wood.

Floor: Treads are wood with iron risers. Landings between floors are of wood with landings at each floor constructed of corridor material. Rubber tread mats attached to some treads.

Condition: The wood mid-first and second floor landing has buckled and deflects slightly with weight.

Base: Cast iron

Condition: General surface rusting.

Walls: Painted plaster on structural tile block. Ghost of underlying dado visible on some wall areas of stair runs.

Condition: Fair to poor condition. Deterioration and loss of plaster to expose structural tile is evident on all floors. Vine growth is present at both first and second floor mid-landings. A vertical area of detached plaster is bowing outward from ceiling to base on the run to the third floor landing.

Ceilings: Painted plaster over metal mesh.

Condition: General spalling loss of plaster surfaces beneath staircase runs. Severe loss of plaster with rusting and loss of metal mesh at third floor skylight.

SUMMARY:				ARCHITECTURAL SIGNIFICANCE:	
		[ ]	Good	[X]	Most
		[X]	Fair	[ ]	Some
		[ ]	Poor	[ ]	Minor
		[ ]	Destroyed	[ ]	Negligible

ROOM NO. 501

Doors/Openings: One window with wood surround and decorative wrought iron interior grille is located at each mid-floor landing. A wire-glass and metal skylight lights the stairwell at the third floor roof level.

Lighting: Two ceramic utility fixtures remain on the mid-floor landing leading to the second floor.

Condition: Ten panes of glass are missing from the skylight admitting water and allowing access to pigeons.

PHOTOGRAPHS: ① Landing between 2nd + 3rd fl. ② 2nd fl., view NW ③ basement ROOM NO. S01

PHOTOGRAPHS: ④ Third floor, view West. ⑤ Skylight ROOM NO. 501

PHOTOGRAPHS: ⑥ Skylight, View West ⑦ Detail, iron grille ROOM NO. 501

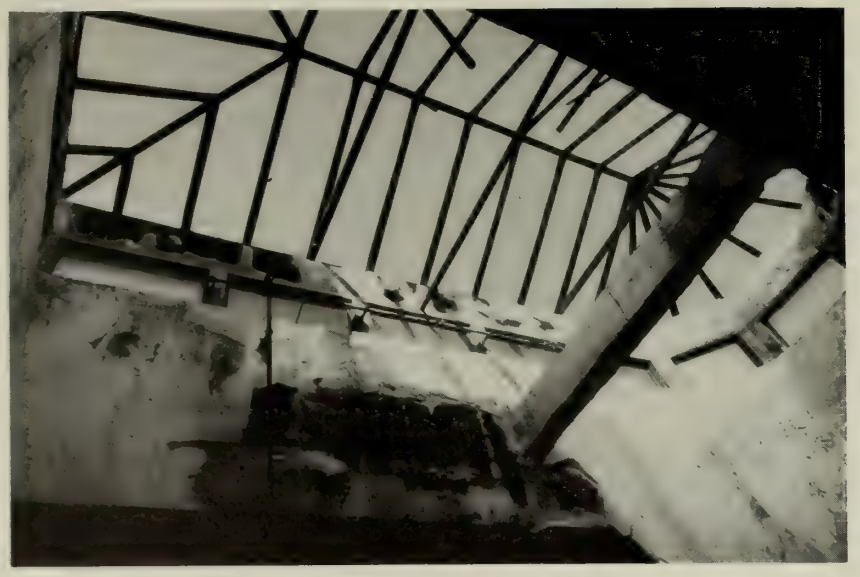

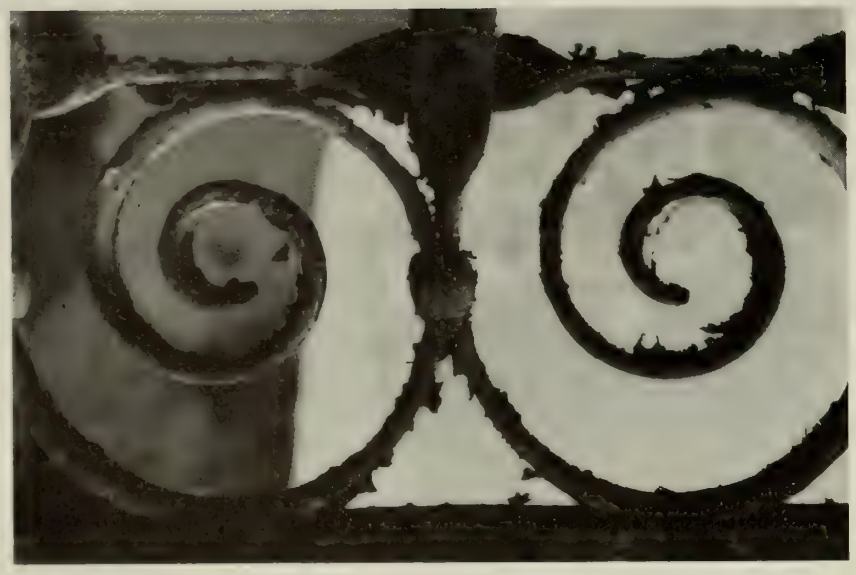

PHOTOGRAPHS:	ROOM NO.

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 352

ROOM NO: S02 **LAST KNOWN USE:** Staircase **SQUARE FEET:** **CEILING HEIGHT:** **DATE:** 11/11/85

DESCRIPTION:

General:	Similar to staircase S01. Rectangular northwest stair with open well. Stair serves all three floors plus cellar with two runs and two landings per floor. Stair structure is cast iron with wood handrail. Newel posts are square headed with vertical paneled shafts. Circular petal motif base supports the handrail uprights. Decorative wrought-iron grillework surmounts the third floor landing rail. Similar grillework covers the windows of each mid-floor landing.	Condition:	Condition of staircase and stairwell area generally exhibits greater deterioration than S01. General rusting of metal surfaces. Separation of laminated handrail into its three parts.
Floor:	Treads are wood with iron risers. Landings between floors are of wood with landings at each floor constructed of corridor material. Rubber tread mats attached to some treads with rubber runners at mid-floor landings.	Condition:	Obscured by debris.
Base:	Cast iron.	Condition:	Surface rusting. Obscured by debris.
Walls:	Painted plaster on structural tile block. Early painted wall finish remains on stair run to third floor.	Condition:	Moderate to severe deterioration of plaster surfaces with frequent exposure of structural tile.
Ceilings:	Painted plaster over metal mesh.	Condition:	Severe deterioration and loss of plaster with rusting and loss of metal lathe in the area of the third floor skylight.
Doors/ Openings:	One window with wood surround is located at each mid-floor landing. A decorative iron grille covers the upper portion of the window at the third floor mid-landing. A wire-glass and metal skylight lights the stairwell at the third floor roof level.	Condition:	Four panes of glass are missing from the skylight with one having been infilled with wood. Additional panes are cracked.

SUMMARY:

- [ ] Good
- [ ] Fair
- [XXX] Poor
- [ ] Destroyed

ARCHITECTURAL SIGNIFICANCE:

- [XXX] Most
- [ ] Some
- [ ] Minor
- [ ] Negligible

ROOM NO. S02

Lighting: Two fixtures remain on mid-landing to second floor with one retaining its metal shade . Ceiling mounted fixtures are present beneath stair runs.

Condition: Loss of glass globes and shades.

PHOTOGRAPHS: (1) second floor, view Northwest. (2) View Northeast. (3) Detail. ROOM NO. 502

PHOTOGRAPHS: ④ View North from top of stair. ⑤ Window grille. ⑥ Skylight ROOM NO. 502

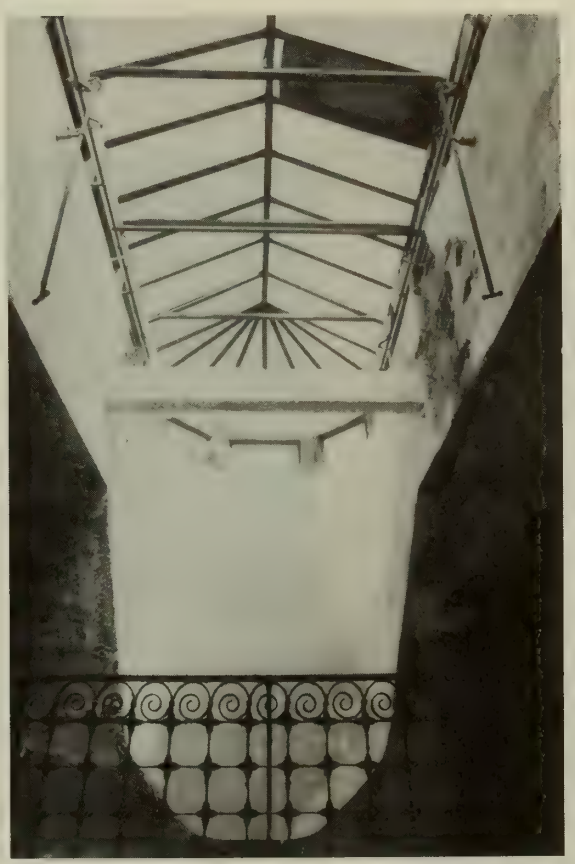

ELLIS ISLAND EXISTING CONDITION SURVEY New Hospital Extension page: 356

ROOM NO: S03 **LAST KNOWN USE:** Staircase **SQUARE FEET:** **CEILING HEIGHT:** **DATE:** 11/13/86

DESCRIPTION:

General:	Similar to S01 and S02. Rectangular central north elevation stair with open well. Stair leads from third floor to the main attic and has two runs and one mid-floor landing.	Condition:	Poor condition.
Floor:	Treads are wood with iron risers. Mid-floor landing is of wood.	Condition:	Severe deterioration and loss of a number of wood treads.
Base:	Cast iron.	Condition:	----------
Walls:	Painted plaster on structural tile block. Evidence of daubed painted finish at attic wall.	Condition:	Severe loss of plaster.
Ceilings:	Painted plaster over structural tile block with plaster over metal mesh under stair runs.	Condition:	General loss of metal lathe and plaster beneath stair runs.
Doors/ Openings:	Mid-floor landing bisects north elevation window. Window grille.	Condition:	----------
Lighting:	Oval ceramic wall sconce at mid-floor landing.		

SUMMARY:

- [ ] Good
- [ ] Fair
- [XX] Poor
- [ ] Destroyed

ARCHITECTURAL SIGNIFICANCE:

- [ ] Most
- [XXX] Some
- [ ] Minor
- [ ] Negligible

PHOTOGRAPHS:

ROOM NO.

BIBLIOGRAPHY
ELLIS ISLAND HISTORIC STRUCTURE REPORT
DOCUMENTATION

Prepared for the U.S. Department of Interior/National Park Service, Denver Service Center
by Beyer Blinder Belle/Notter Finegold Alexander

HISTORIC STRUCTURES REPORTS

Volume 1	The Main Building June 1, 1984	NPS D-41
Volume 2 Part One	Unit One Buildings December 1985	NPS D-42
Volume 2 Part Two	Unit One Buildings December 1985	NPS D-42
Volume 3	Powerhouse December 1985	NPS D-43
Volume 4 Part One	Units 2, 3 and 4 August 30, 1986	NPS D-44
Volume 4 Part Two	Units 2, 3 and 4 August 30, 1986	NPS D-44
Volume 4 Part Three	Units 2, 3 and 4 August 30, 1986	NPS D-44

EXISTING CONDITION SURVEYS

Volume 1 Appendix A	Main Building February 1, 1984	NPS D-41
Volume 2 Appendix D	Unit One Buildings July 1985	NPS D-42
Volume 3 Appendix A	Powerhouse December 1985	NPS D-43
Volume 4 Appendix A Part One	Units 2, 3 and 4 July 1986	NPS D-44
Volume 4 Appendix A Part Two	Units 2, 3 and 4 July 1986	NPS D-44

☆ U.S. GOVERNMENT PRINTING OFFICE: 1988—576-799 REGION NO. 8

As the nation's principal conservation agency, the Department of the Interior has basic responsibilities to protect and conserve our land and water, energy and minerals, fish and wildlife, parks and recreation areas, and to ensure the wise use of all these resources. The department also has major responsibility for American Indian reservation communities and for people who live in island territories under U.S. administration.

Publication services were provided by the graphics staff of the Denver Service Center.
NPS D-44 September 1988